

July 25, 2019



ENTECH
ENGINEERING, INC.

505 ELKTON DRIVE
COLORADO SPRINGS, CO 80907
PHONE (719) 531-5599
FAX (719) 531-5238

Jim Martens
8190 Poco Road
Colorado Springs, CO 80908

Re: Soil, Geology, Geologic Hazard
8190 Poco Road
Parcel No. 52280-00-001
Colorado Springs, Colorado

Dear Mr. Martens:

GENERAL SITE CONDITIONS AND PROJECT DESCRIPTION

The site is located in a portion of the NW¼ of Section 28, Township 12 South, Range 66 West of the 6th Principal Meridian in El Paso County, Colorado. The site is located approximately 1½ miles northeast of Colorado Springs city limits, northwest of Poco Road and Vollmer Road in El Paso County, Colorado. The location of the site is as shown on the Vicinity Map, Figure 1.

The topography of the site is gradually sloping generally to the south. A minor drainage is located in the western portion of the property. Water was not observed in the drainage at the time of this investigation. The site boundaries are indicated on the USGS Map, Figure 2. Previous land uses have included grazing and pasture land and a rural residential development. The site contains primarily field grasses and weeds with scattered areas of ponderosa pines. A house is located in the northeastern portion of the site with an existing septic system and water well. Site photographs, taken April 23, 2019, are included in Appendix A.

Total acreage involved in the proposed minor subdivision is 12 acres. Two single-family rural residential lots are proposed as part of the replat. The proposed lot sizes are 5-acres for the western lot and 7-acres for the eastern lot. The new lot will be serviced by an individual well and on-site wastewater treatment system. The existing house is located on the eastern 7-acre lot and will remain. The Site Plan with the proposed replat is presented in Figure 3.

LAND USE AND ENGINEERING GEOLOGY

This site was found to be suitable for the proposed development. Areas were encountered where the geologic conditions will impose some constraints on development and land use. These include areas of potentially seasonal shallow groundwater. Based on the proposed development plan, it appears that these areas will have some minor impacts on the development. These conditions will be discussed in greater detail in the report.

In general, it is our opinion that the development can be achieved if the observed geologic conditions on site are either avoided or properly mitigated. All recommendations are subject to the limitations discussed in the report.

Jim Martens
Soils, Geology, Geologic Hazard and Wastewater Study
8190 Poco Road
Parcel No. 52280-00-001
Colorado Springs, Colorado

SCOPE OF THE REPORT

The scope of the report will include the following:

- A general geologic analysis utilizing published geologic data. Detailed site-specific mapping will be conducted to obtain general information in respect to major geographic and geologic features, geologic descriptions and their effects on the development of the property.
- The site will be evaluated for individual on-site wastewater treatment systems in accordance with El Paso Land Development Code.

FIELD INVESTIGATION

Our field investigation consisted of the preparation of a geologic map of any bedrock features and significant surficial deposits. The Natural Resource Conservation Service (NRCS), previously the Soil Conservation Service (SCS) survey was also reviewed to evaluate the site. The position of mappable units within the subject property are shown on the Geologic Map. Our mapping procedures involved both field reconnaissance and measurements and air photo reconnaissance and interpretation. The same mapping procedures have also been utilized to produce the Geology/Engineering Geology Map which identified pertinent geologic conditions affecting development. The field mapping was performed by personnel of Entech Engineering, Inc. on April 23, 2019.

One (1) test pit was excavated on the site to determine general suitability for the use of on-site wastewater treatment systems and general soil characteristics. The location of the test pit is indicated on the Site Plan/Test Pit Location Map, Figure 3. The Test Pit Log is presented in Appendix B. Results of this testing will be discussed later in this report.

Laboratory testing was also performed on some of the soils to classify and determine the soils engineering characteristics. Laboratory tests included grain-size analysis, ASTM D-422, and Atterberg Limits, ASTM D-4318. Results of the laboratory testing are included in Appendix C. A Summary of Laboratory Test Results is presented in Table 1.

SOIL AND GEOLOGIC CONDITIONS

Soil Survey

The Natural Resource Conservation Service (NRCS) (Reference 1, Figure 4), previously the Soil Conservation Service (Reference 2) has mapped one soil type on the site. Complete descriptions of the soil type is presented in Appendix D. In general, the soils consist of sandy loam. The soils are described as follows:

<u>Type</u>	<u>Description</u>
71	Pring Coarse Sandy Loam, 3 – 8% Slopes

Jim Martens
Soils, Geology, Geologic Hazard and Wastewater Study
8190 Poco Road
Parcel No. 52280-00-001
Colorado Springs, Colorado

The soils have been described to have rapid permeabilities. The soils are described as well suited for use as homesites. Possible hazards with soils erosion are present on the site. The erosion potential can be controlled with vegetation. The soils have been described to have moderate erosion hazards (Reference 2).

Soils

The soils encountered in the test pit consisted of gravelly sandy loam (silty sand) overlying weathered to formational silty sandstone. Weathered bedrock was encountered at 3 feet in the test pit. The sample of sand tested had approximately 25 percent of the soil size particles passing the No. 200 sieve. The sample of sandstone tested had 29 percent of the soil size particles passing the No. 200 sieve. The upper sand soils are considered to have low expansion potential. An FHA Swell pressure of 280 psf was measured on the silty sandstone, indicating low expansion potential. Atterberg Limits Testing on the sandstone resulted in the sandstone being non-plastic.

Groundwater

Groundwater or signs of seasonally occurring water were not encountered in the test pit, which was excavated to 6 feet. It is anticipated groundwater will not affect shallow foundations on the majority of the site. An area of potentially seasonal shallow groundwater has been mapped in a drainage on the site that is discussed in the following sections. Fluctuations in groundwater conditions may occur due to variations in rainfall or other factors not readily apparent at this time. Isolated sand layers within the soil profile can carry water in the subsurface. Contractors should be cognizant of the potential for the occurrence of subsurface water features during construction.

Geology

Approximately 12 miles west of the site is a major structural feature known as the Rampart Range Fault. This fault marks the boundary between the Great Plains Physiographic Province and the Southern Rocky Mountain Province. The site exists within a large structural feature known as the Denver Basin. Bedrock in the area is typically gently dipping in a northerly direction (Reference 3). The bedrock underlying the site consists of the Dawson Formation of Cretaceous Age. The Dawson Formation typically consists of coarse-grained arkosic sandstone with interbedded layers siltstone or claystone.

The geology of the site was evaluated using the *Geologic Map of the Falcon NW Quadrangle*, by Madole in 2003, (Reference 4, Figure 5). The Geology for the site is presented in Figure 6. One mappable unit was identified on this site which is described as follows:

Qc/Tkd **Colluvium of Quaternary Age overlying Dawson Formation of Tertiary to Cretaceous Age:** The materials consist of colluvial or residual soils overlying the bedrock materials on-site. The colluvial soils were deposited by the action of sheetwash and gravity. The residual soils were derived from the in-situ weathering of the bedrock on site. These materials typically consist of silty to

Jim Martens
Soils, Geology, Geologic Hazard and Wastewater Study
8190 Poco Road
Parcel No. 52280-00-001
Colorado Springs, Colorado

clayey sand with potential areas of sandy clays. The bedrock consists of the Dawson Formation. The Dawson Formation typically consists of coarse-grained, arkosic sandstone with interbedded lenses of fine-grained sandstone, siltstone and claystone.

The soils listed above were mapped from site-specific mapping, the *Geologic Map of the Falcon NW Quadrangle* distributed by the Colorado Geologic Survey in 2003 (Reference 4, Figure 5), The *Geologic Map of the Colorado Springs-Castle Rock Area*, distributed by the US Geological Survey in 1979 (Reference 5), and the *Geologic Map of the Pueblo 1° x 2° Quadrangle*, distributed by the US Geological Survey in 1978 (Reference 6). The Test Pit was also used in evaluating the site and is included in Appendix B. The Geology Map prepared for the site is presented in Figure 6.

ENGINEERING GEOLOGIC HAZARDS

Mapping has been performed on this site to identify areas where various geologic conditions exist of which developers should be cognizant during the planning, design and construction stages where new construction is proposed. The engineering geologic hazards identified on this site include potentially seasonal shallow groundwater areas. These hazards and recommended mitigation techniques are discussed as follows:

Expansive Soils

Soils encountered in the test pit exhibited low expansion potential. However, highly expansive claystone and siltstone are commonly interbedded in the sandstone of the Dawson Formation. These occurrences are typically sporadic; therefore, none have been indicated on the maps. These clays, if encountered beneath foundations, can cause differential movement in the structure foundation.

Mitigation: Should expansive soils be encountered beneath the foundation; mitigation will be necessary. Mitigation of expansive soils will require special foundation design. Overexcavation and replacement with non-expansive soils at a minimum of 95% of its maximum Modified Proctor Dry Density, ASTM D-1557 is a suitable mitigation, which is common in the area. Floor slabs on expansive soils should be expected to experience movement. Overexcavation and replacement has been successful in minimizing slab movements.

Potentially Seasonal Shallow Groundwater Area

The site is not mapped within any floodplains according to the FEMA Map No. 08041CO535G, dated December 7, 2018 (Figure 7, Reference 7). Areas of potentially seasonal shallow groundwater were observed on the site (Figure 6). In these areas, we would anticipate the potential for periodically high subsurface moisture conditions and frost heave potential. These areas lie within low-lying areas and along the minor drainage in the western portion of the site. Water was not observed in any of the drainages at the time of our site investigation. These areas can likely be avoided or properly mitigated by development. The potential exists for high

Jim Martens
Soils, Geology, Geologic Hazard and Wastewater Study
8190 Poco Road
Parcel No. 52280-00-001
Colorado Springs, Colorado

groundwater levels during high moisture periods and should structures encroach on these areas the following precautions should be followed.

Mitigation: Foundations must have a minimum 30-inch depth for frost protection. In areas where high subsurface moisture conditions are anticipated periodically, subsurface perimeter drains are recommended to help prevent the intrusion of water into areas below grade. Typical drain details are presented in Figure 8. Any grading in these areas should be done to direct surface flow around construction to avoid areas of ponded water. All organic material would be completely removed prior to any fill placement. Specific drainage studies are beyond the scope of this report.

RELEVANCE OF GEOLOGIC CONDITIONS TO LAND USE PLANNING

As mentioned, the proposed development will be single-family residential. The existing geologic and engineering geologic conditions will impose minor constraints on development and construction. The geologic conditions on the site include potentially seasonal shallow groundwater areas, which can be satisfactorily mitigated through avoidance or proper engineering design and construction practices.

The site consists of a 12-acre rural-residential lot. The proposed development consists of replatting the site into two single-family residential lots. A single-family residence currently exists on the eastern lot which will remain. A single-family residence is proposed for the western lot. The exact location of the proposed residence was not available at the time of this investigation.

The upper granular soils encountered in the test pit on the site were encountered at medium dense states to dense. Expansive layers may also be encountered in the soil on this site. Expansive soils, if encountered, will require special foundation design. These soils will not prohibit development.

Areas of potentially shallow groundwater were observed on the site (Figure 6). In these areas, we would anticipate the potential for periodically high subsurface moisture conditions and frost heave potential. These areas lie within low-lying areas and along the minor drainage in the western portion of the site. These areas can likely be avoided or properly mitigated by development. The potential exists for high groundwater levels during high moisture periods and should structures encroach on these areas. A subsurface perimeter drain is recommended should structures encroach on this area. Typical drain details are presented in Figure 8. Septic systems are not recommended in these areas due to the potential for shallow groundwater. Any grading in these areas should be done to direct surface flow around construction to avoid areas of ponded water. All organic material should be completely removed prior to any fill placement. Specific drainage studies are beyond the scope of this report. The site is not mapped within any floodplains according to the FEMA Map No. 80841C0535G (Figure 7, Reference 7).

Jim Martens
Soils, Geology, Geologic Hazard and Wastewater Study
8190 Poco Road
Parcel No. 52280-00-001
Colorado Springs, Colorado

In summary, the granular soils will likely provide suitable support for shallow foundations. The geologic conditions encountered on site can be mitigated with avoidance or proper engineering and construction practices.

ON-SITE WASTEWATER TREATMENT

The site was evaluated for individual on-site wastewater treatment systems in accordance with El Paso Land Development Code. One (1) test pit was excavated on the site. The approximate location of the test pit is indicated on Figure 3, on the Geology/Engineering Geology Map, Figure 6, and on the Septic Suitability Map, Figure 9. Table 2 shows the results of the test pit. The Test Pit Log is shown in Appendix B.

An existing house is located on the eastern lot with septic field and water well. Available El Paso County Health Department records for the existing septic system are included in Appendix E. These records indicate the existing field consists of a trench system installed no deeper than 18 inches.

The Natural Resource Conservation Service (Reference 1), previously the Soil Conservation Service (Reference 2) has been mapped with one soil description. The Soil Survey Map (Reference 1) is presented in Figure 4, and the Soil Survey Descriptions (Reference 2) are presented in Appendix D. The soils are described as having rapid percolation rates.

Soils encountered in the tactile test pits consisted of gravelly sandy loam overlying weathered to formational silty sandstone. The limiting layers encountered in the test pit is the silty sandstone, which corresponds with USDA Soil Type 3A with an LTAR value of 0.30 gallons per day per square foot. Weathered bedrock was encountered at approximately 3 feet in the test pit. Signs of seasonally occurring groundwater were not observed in the test pit. Absorption fields must be maintained a minimum of 4 feet above groundwater or bedrock, or confining layer. Should groundwater or bedrock be encountered within 6 feet of the surface, designed systems will be required.

In summary, it is our opinion the site is suitable for individual on-site wastewater treatment systems (OWTS) and that contamination of surface and subsurface water resources should not occur provided the OWTS sites are evaluated and installed according to El Paso County and State Guidelines and properly maintained. Based on the testing performed as part of this investigation designed systems may be required for the new lot. The Septic Suitability Map is presented in Figure 9. Individual soil testing is required for proposed construction on each lot prior to construction. Absorption fields must be located a minimum of 100 feet from any well, including those on adjacent properties. Absorption fields must also be located a minimum of 50 feet from any drainages, floodplains or ponded areas and 25 feet from dry gulches.

Jim Martens
Soils, Geology, Geologic Hazard and Wastewater Study
8190 Poco Road
Parcel No. 52280-00-001
Colorado Springs, Colorado

ECONOMIC MINERAL RESOURCES

Some of the sandy materials on-site could be considered a low-grade sand resource. According to the *El Paso County Aggregate Resource Evaluation Map* (Reference 8), of the area of the site is mapped as upland deposits. According to the *Atlas of Sand, Gravel and Quarry Aggregate Resources, Colorado Front Range Counties* distributed by the Colorado Geological Survey (Reference 9), areas of the site are not mapped with any resources. According to the *Evaluation of Mineral and Mineral Fuel Potential* (Reference 10), the area of the site has been mapped as "Fair" for industrial minerals. However, considering the silty to clayey nature of much of these materials and abundance of similar materials through the region and the close proximity to developed land, they would be considered to have little significance as an economic resource.

According to the *Evaluation of Mineral and Mineral Fuel Potential of El Paso County State Mineral Lands* (Reference 10), the site is mapped within the Denver Basin Coal Region. However, the area of the site has been mapped as "Poor" for coal resources. No active or inactive mines have been mapped in the area of the site. No metallic mineral resources have been mapped on the site (Reference 10).

The site has been mapped as "Fair" for oil and gas resources (Reference 10). No oil or gas fields have been discovered in the area of the site. The sedimentary rocks in the area may lack the geologic structure for trapping oil or gas; therefore, it may not be considered a significant resource. Hydraulic fracturing is a new method that is being used to extract oil and gas from rocks. It utilizes pressurized fluid to extract oil and gas from rocks that would not normally be productive. The area of the site has not been explored to determine if the rocks underlying the site would be commercially viable utilizing hydraulic fracturing. The practice of hydraulic fracturing has come under review due to concerns about environmental impacts, health and safety.

EROSION CONTROL

The soil types observed on the site are mildly to highly susceptible to wind erosion, and moderately to highly susceptible to water erosion. A minor wind erosion and dust problem may be created for a short time during and immediately after construction. Should the problem be considered severe enough during this time, watering of the cut areas or the use of chemical palliative may be required to control dust. However, once construction has been completed and vegetation re-established, the potential for wind erosion should be considerably reduced.

With regard to water erosion, loosely compacted soils will be the most susceptible to water erosion, residually weathered soils and weathered bedrock materials become increasingly less susceptible to water erosion. For the typical soils observed on site, allowable velocities or unvegetated and unlined earth channels would be on the order of 3 to 4 feet/second, depending upon the sediment load carried by the water. Permissible velocities may be increased through the use of vegetation to something on the order of 4 to 7 feet/second, depending upon the type of vegetation established. Should the anticipated velocities exceed these values, some form of

Jim Martens
Soils, Geology, Geologic Hazard and Wastewater Study
8190 Poco Road
Parcel No. 52280-00-001
Colorado Springs, Colorado

channel lining material may be required to reduce erosion potential. These might consist of some of the synthetic channel lining materials on the market or conventional riprap. In cases where ditch-lining materials are still insufficient to control erosion, small check dams or sediment traps may be required. The check dams will serve to reduce flow velocities, as well as provide small traps for containing sediment. The determination of the amount, location and placement of ditch linings, check dams and of the special erosion control features should be performed by or in conjunction with the drainage engineer who is more familiar with the flow quantities and velocities.

Cut and fill slope areas will be subjected primarily to sheetwash and rill erosion. Unchecked rill erosion can eventually lead to concentrated flows of water and gully erosion. The best means to combat this type of erosion is, where possible, the adequate re-vegetation of cut and fill slopes. Cut and fill slopes having gradients more than three (3) horizontal to one (1) vertical become increasingly more difficult to revegetate successfully. Therefore, recommendations pertaining to the vegetation of the cut and fill slopes may require input from a qualified landscape architect and/or the Soil Conservation Service.

CLOSURE

It is our opinion that the existing geologic engineering and geologic conditions will impose some minor constraints on development and construction of the site. The majority of these conditions can be avoided by construction. Others can be mitigated through proper engineering design and construction practices. The proposed development and use are consistent with anticipated geologic and engineering geologic conditions.

It should be pointed out that because of the nature of data obtained by random sampling of such variable and non-homogeneous materials as soil and rock, it is important that we be informed of any differences observed between surface and subsurface conditions encountered in construction and those assumed in the body of this report. Individual investigations for new building sites and septic systems will be required prior to construction. Construction and design personnel should be made familiar with the contents of this report. Reporting such discrepancies to Entech Engineering, Inc. soon after they are discovered would be greatly appreciated and could possibly help avoid construction and development problems.

This report has been prepared for Jim Martens, for application to the proposed project in accordance with generally accepted geologic soil and engineering practices. No other warranty expressed or implied is made.

Jim Martens
Soils, Geology, Geologic Hazard and Wastewater Study
8190 Poco Road
Parcel No. 52280-00-001
Colorado Springs, Colorado


We trust that this report has provided you with all the information that you required. Should you require additional information, please do not hesitate to contact Entech Engineering, Inc.

Respectfully Submitted,

ENTECH ENGINEERING, INC.

Reviewed by:


Logan L. Langford, P.G.
Geologist


Kristen A. Andrew-Hoeser, P.G.
Senior Geologist

LLL/III

Encl.

Entech Job No. 190411
AAprojects/2019/190411 sg&ghs



Jim Martens
Soils, Geology, Geologic Hazard and Wastewater Study
8190 Poco Road
Parcel No. 52280-00-001
Colorado Springs, Colorado

BIBLIOGRAPHY

1. Natural Resource Conservation Service, September 23, 2016. *Web Soil Survey*. United States Department Agriculture, <http://websoilsurvey.sc.egov.usda.gov/App/HomePage.htm>.
2. United States Department of Agriculture Soil Conservation Service. June 1981. *Soil Survey of El Paso County Area, Colorado*.
3. Scott, Gleen R.; Taylor Richard B.; Epis, Rudy C; and Wabus, Reinhard A. 1978. *Geologic Structure Map of the Pueblo 1° x 2° Quadrangle, South-Central Colorado*. Sheet 2. U.S. Geologic Survey. Map I-1022, Sheet 2.
4. Madole, Richard F., 2003. *Geologic Map of the Falcon NW Quadrangle, El Paso County, Colorado*. Colorado Geological Survey. Open-File Report 03-8.
5. Trimble, Donald E. and Machette, Michael N. 1979. *Geologic Map of the Colorado Springs-Castle Rock Area, Front Range Urban Corridor, Colorado*. USGS, Map I-857-F.
6. Scott, Gleen R.; Taylor Richard B.; Epis, Rudy C; and Wabus, Reinhard A. 1978. *Geologic Structure Map of the Pueblo 1° x 2° Quadrangle, South-Central Colorado*. Sheet 2. U.S. Geologic Survey. Map I-1022.
7. Federal Emergency Management Agency. December 7, 2018. *Flood Insurance Rate Maps for the City of Colorado Springs, Colorado*. Map Number 08041CO535G
8. El Paso County Planning Development. December 1995. *El Paso County Aggregate Resource Evaluation Maps*.
9. Schwochow, S.D.; Shroba, R.R. and Wicklein, P.C. 1974. *Atlas of Sand, Gravel, and Quarry Aggregate Resources, Colorado Front Range Counties*. Colorado Geological Survey. Special Publication 5-B.
10. Keller, John W.; TerBest, Harry and Garrison, Rachel E. 2003. *Evaluation of Mineral and Mineral Fuel Potential of El Paso County State Mineral Lands Administered by the Colorado State Land Board*. Colorado Geological Survey. Open-File Report 03-07.

TABLES

TABLE 1
SUMMARY OF LABORATORY TEST RESULTS

CLIENT JIM MARTENS
 PROJECT 8190 POCO ROAD
 JOB NO. 190411

SOIL TYPE	TEST BORING NO.	DEPTH (FT)	WATER (%)	DRY DENSITY (PCF)	PASSING NO. 200 SIEVE (%)	LIQUID LIMIT (%)	PLASTIC INDEX (%)	SULFATE (WT %)	FHA SWELL (PSF)	SWELL/ CONSOL (%)	UNIFIED CLASSIFICATION	SOIL DESCRIPTION
1	TP-1	0-2			25.4						SM	SAND, SILTY
2	TP-1	5-6			29.3	NV	NP		280		SM	WX SANDSTONE, SILTY

TABLE 1: SUMMARY OF TACTILE TEST PIT RESULTS

Test Pit No.	USDA Soil Type	LTAR Value	Depth to Bedrock (ft)	Depth to Groundwater (ft)
TP-1	3A*	0.3	N/A	N/A

* - CONDITIONS THAT REQUIRE AN ENGINEERED OWTS

FIGURES

SITE



Vollmer Rd

Wildflower Rd

Poco Rd

Vollmer Rd

N



ENTECH
ENGINEERING, INC.
505 ELKTON DRIVE
COLORADO SPRINGS, CO. 80907 (719) 531-5599

VICINITY MAP
8190 POCO ROAD
COLORADO SPRINGS, CO.
FOR: JIM MARTENS

DRAWN:
LLL


DATE:
5/24/19

CHECKED:

DATE:

JOB NO.:
190411

FIG NO.:
1

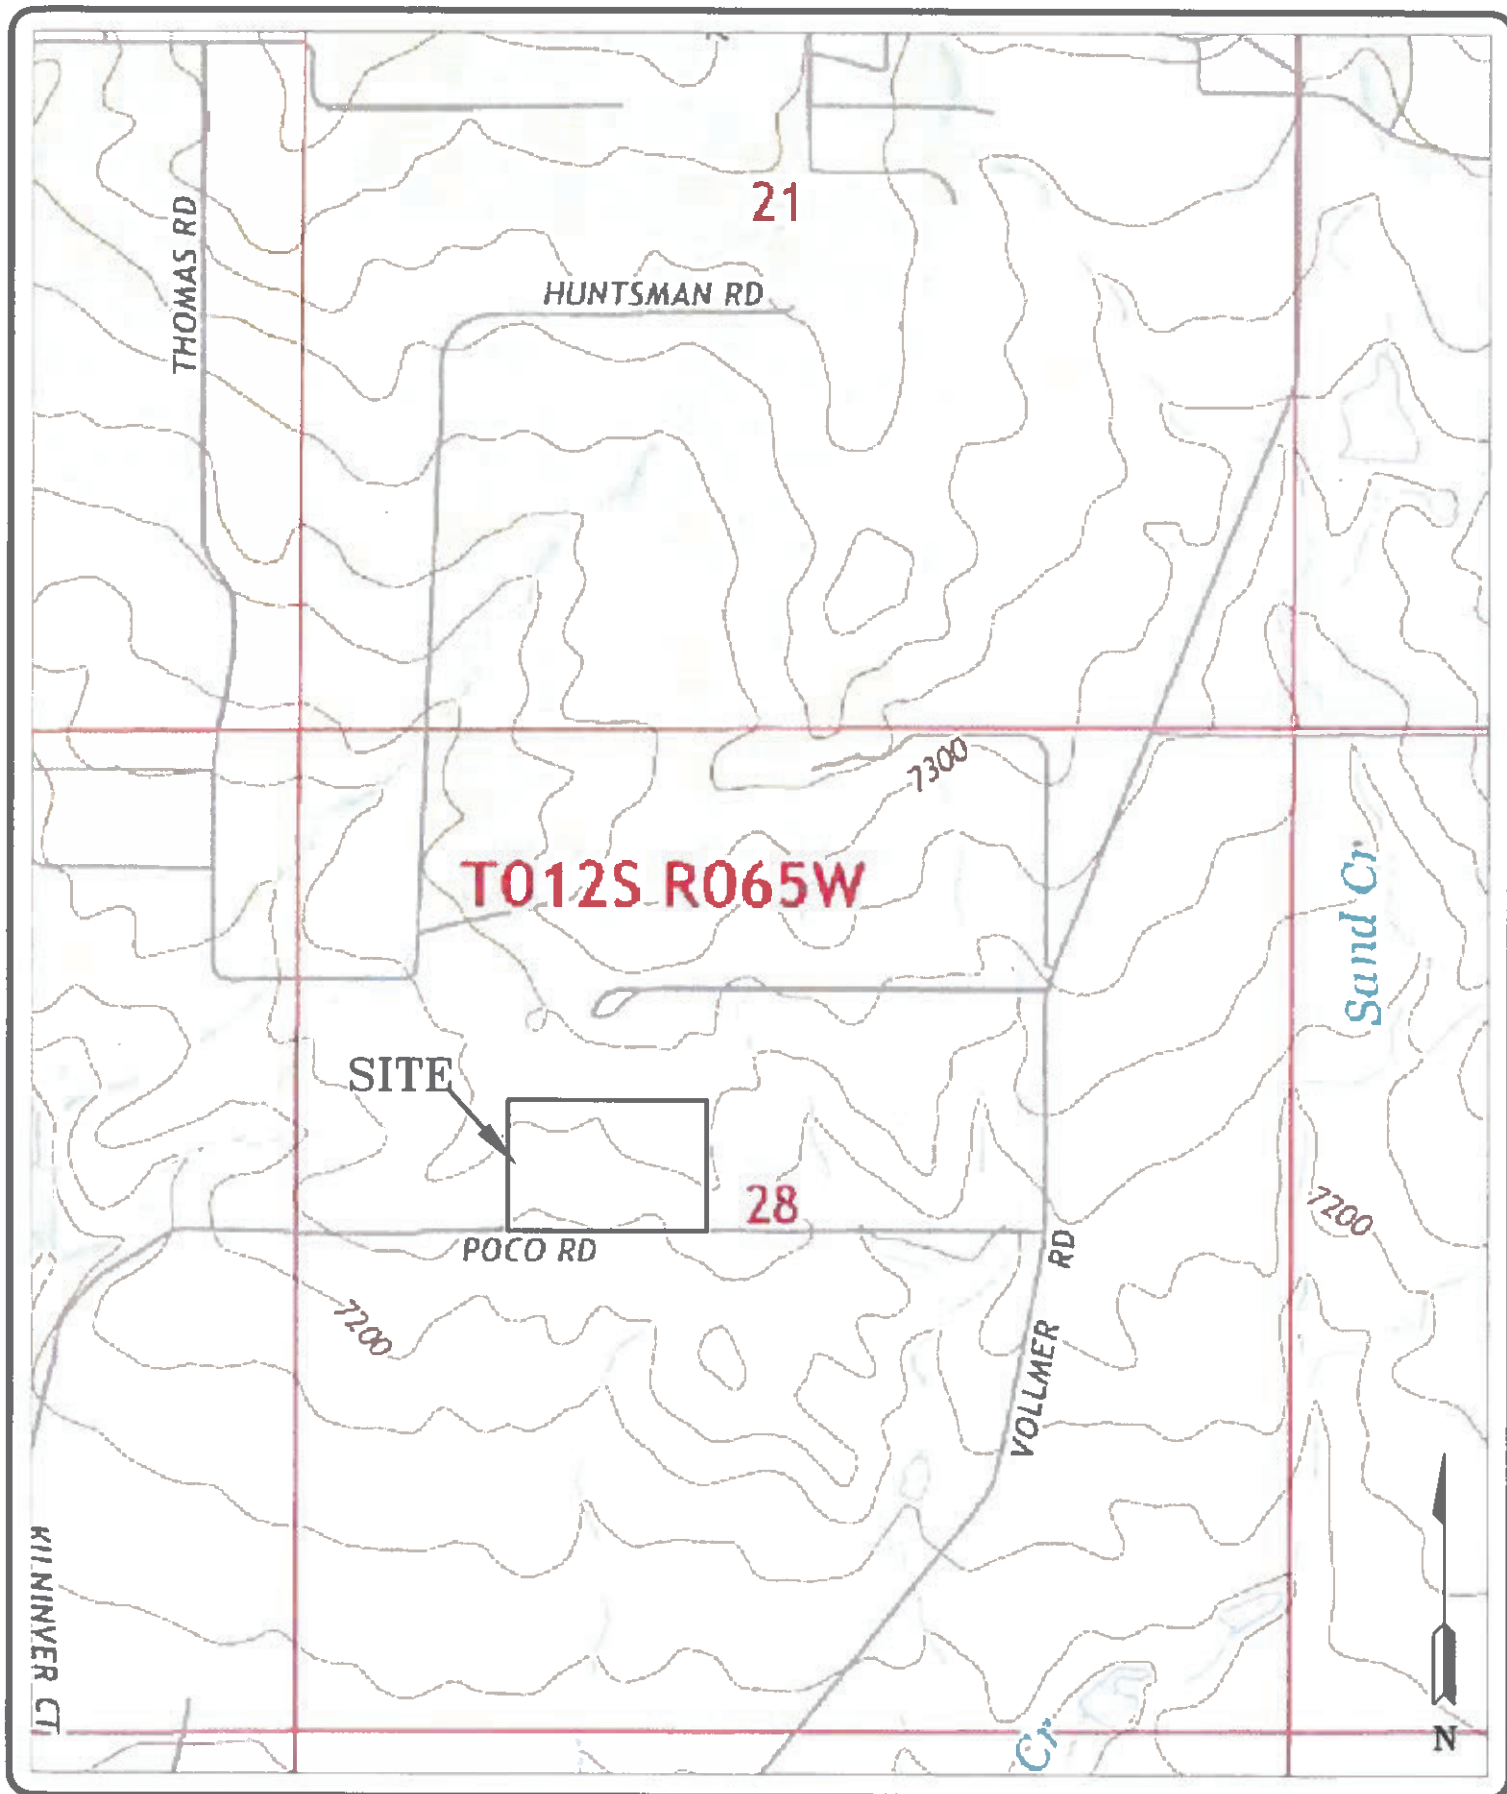

ENTECH
ENGINEERING, INC.
505 ELKTON DRIVE
COLORADO SPRINGS, CO. 80907 (719) 531-3599

USGS MAP
8190 POCO ROAD
COLORADO SPRINGS, CO.
FOR: JIM MARTENS

DRAWN:
LLL


DATE:
5/24/19

CHECKED:

DATE:

JOB NO.:
190411

FIG NO.:
2

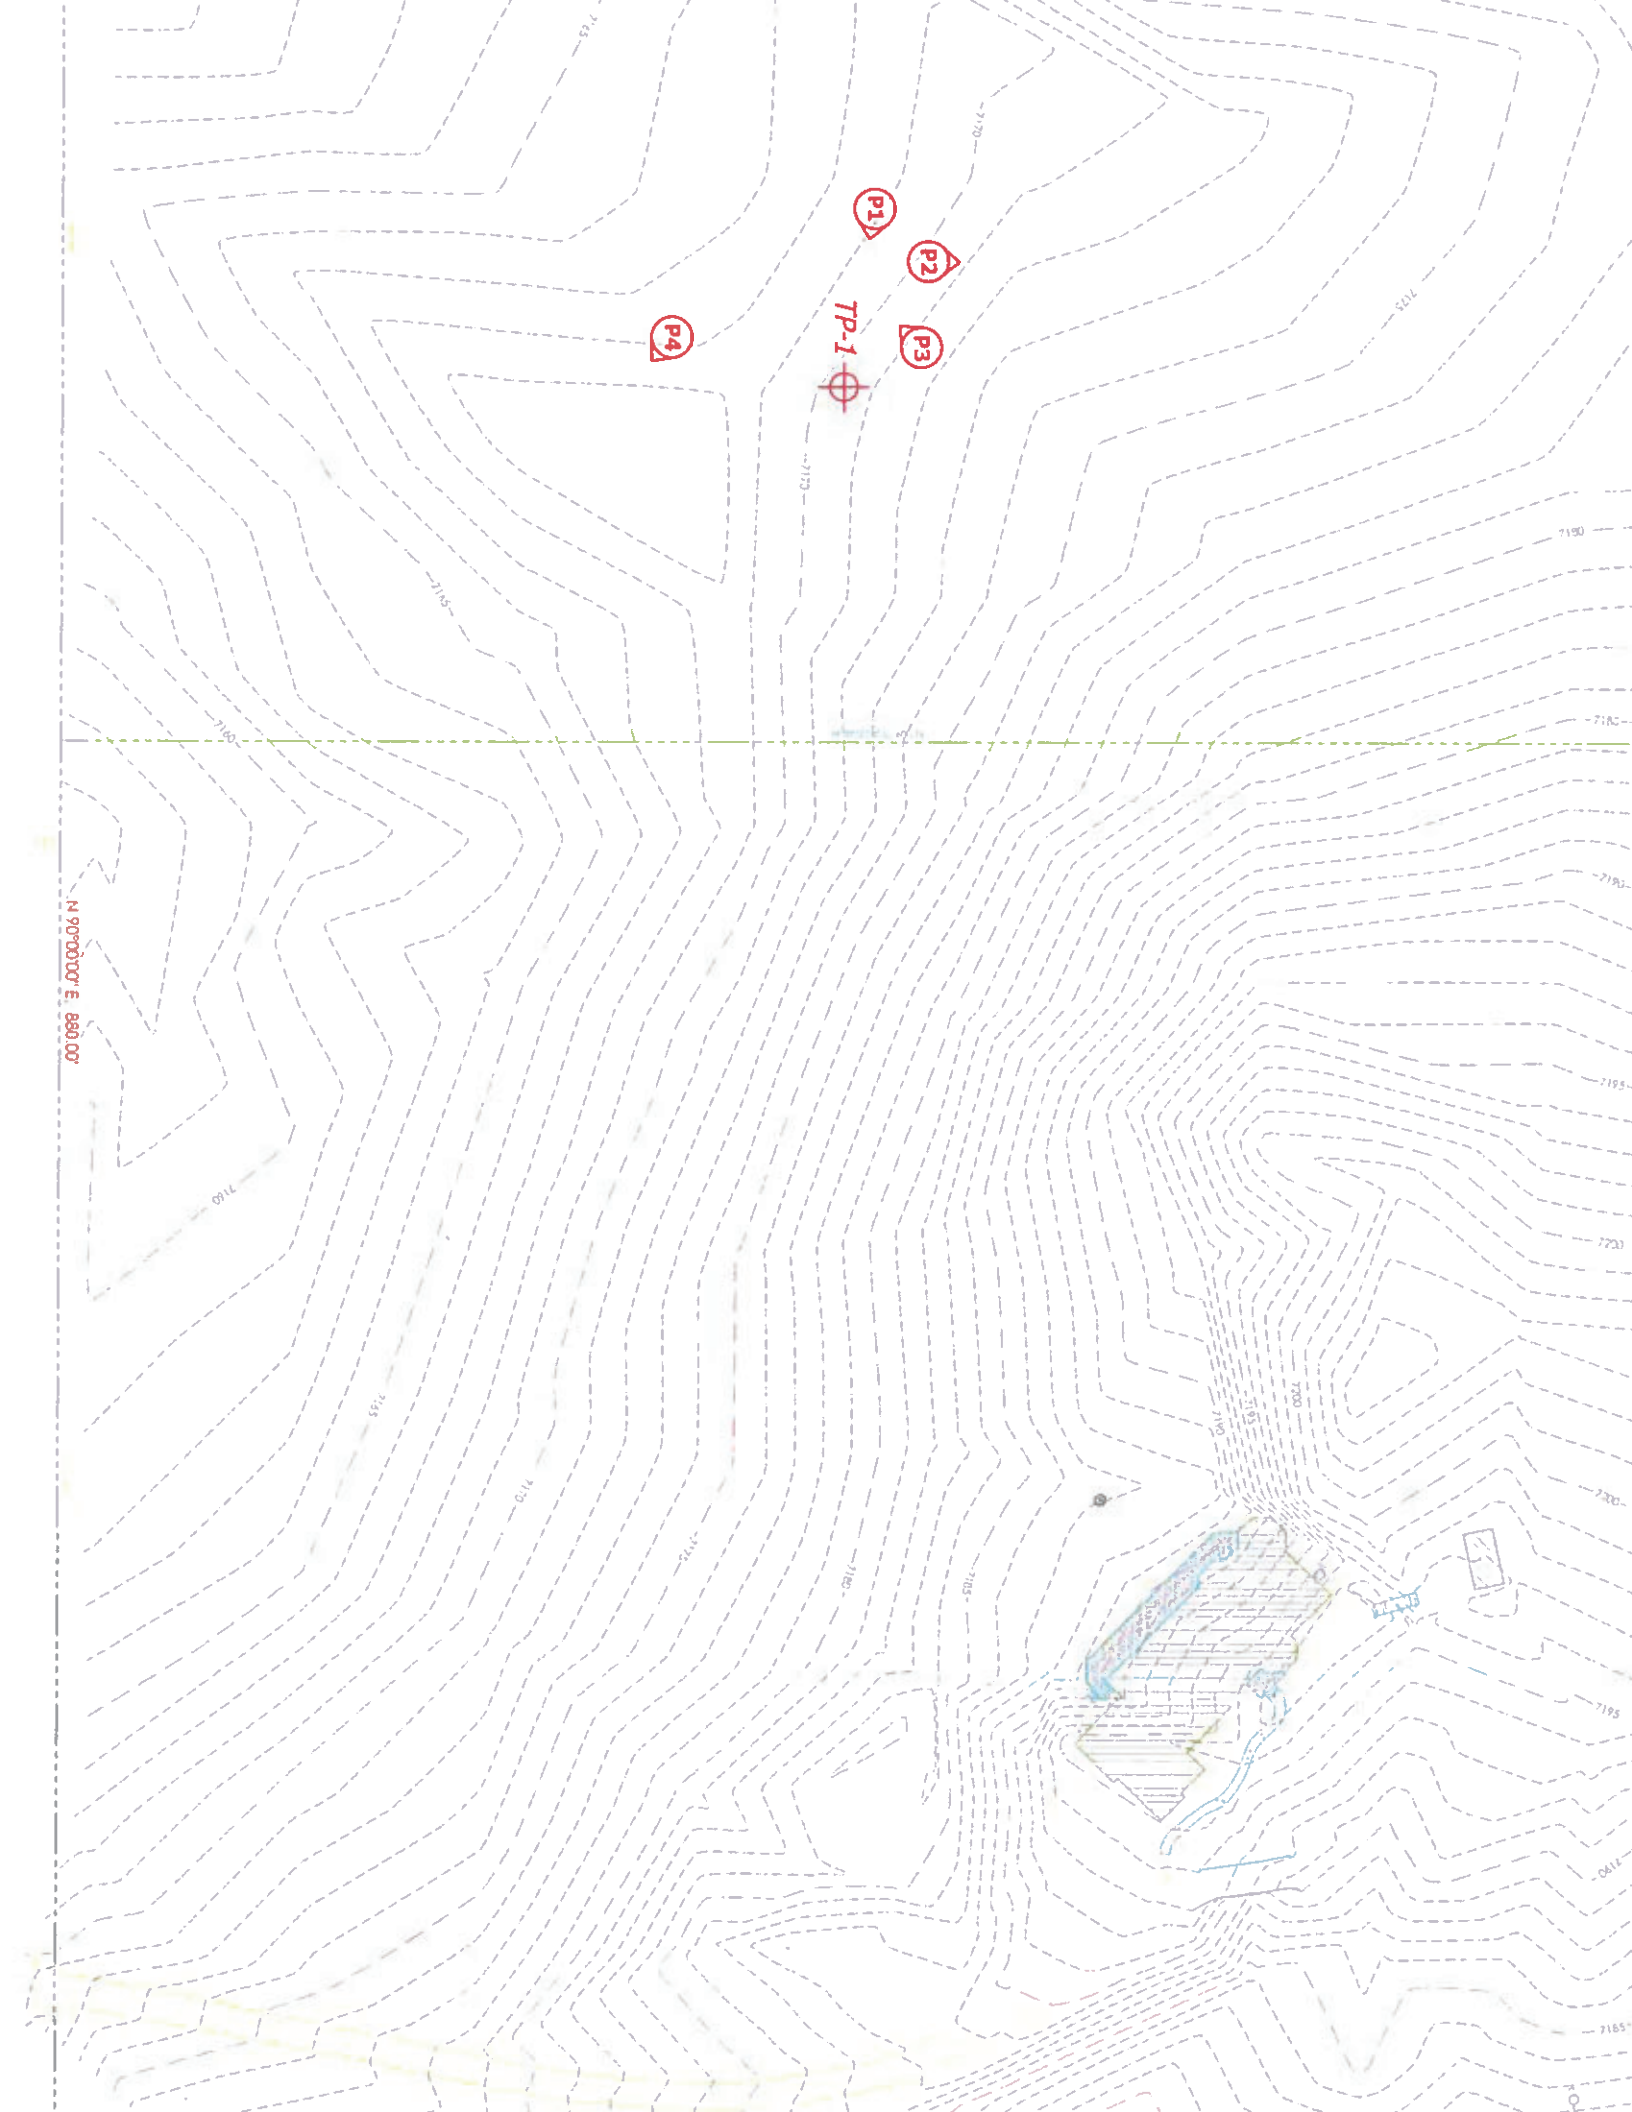

N 90°00'00" E 8800.00''



ENTECH
ENGINEERING, INC.
565 ELKTON DRIVE
COLORADO SPRINGS, CO. 80907 (719) 531-5599

SOIL SURVEY MAP
8190 POCO ROAD
COLORADO SPRINGS, CO.
FOR: JIM MARTENS

DRAWN:
LLL


DATE:
5/24/19

CHECKED:

DATE:

JOB NO.:
190411

FIG NO.:
4

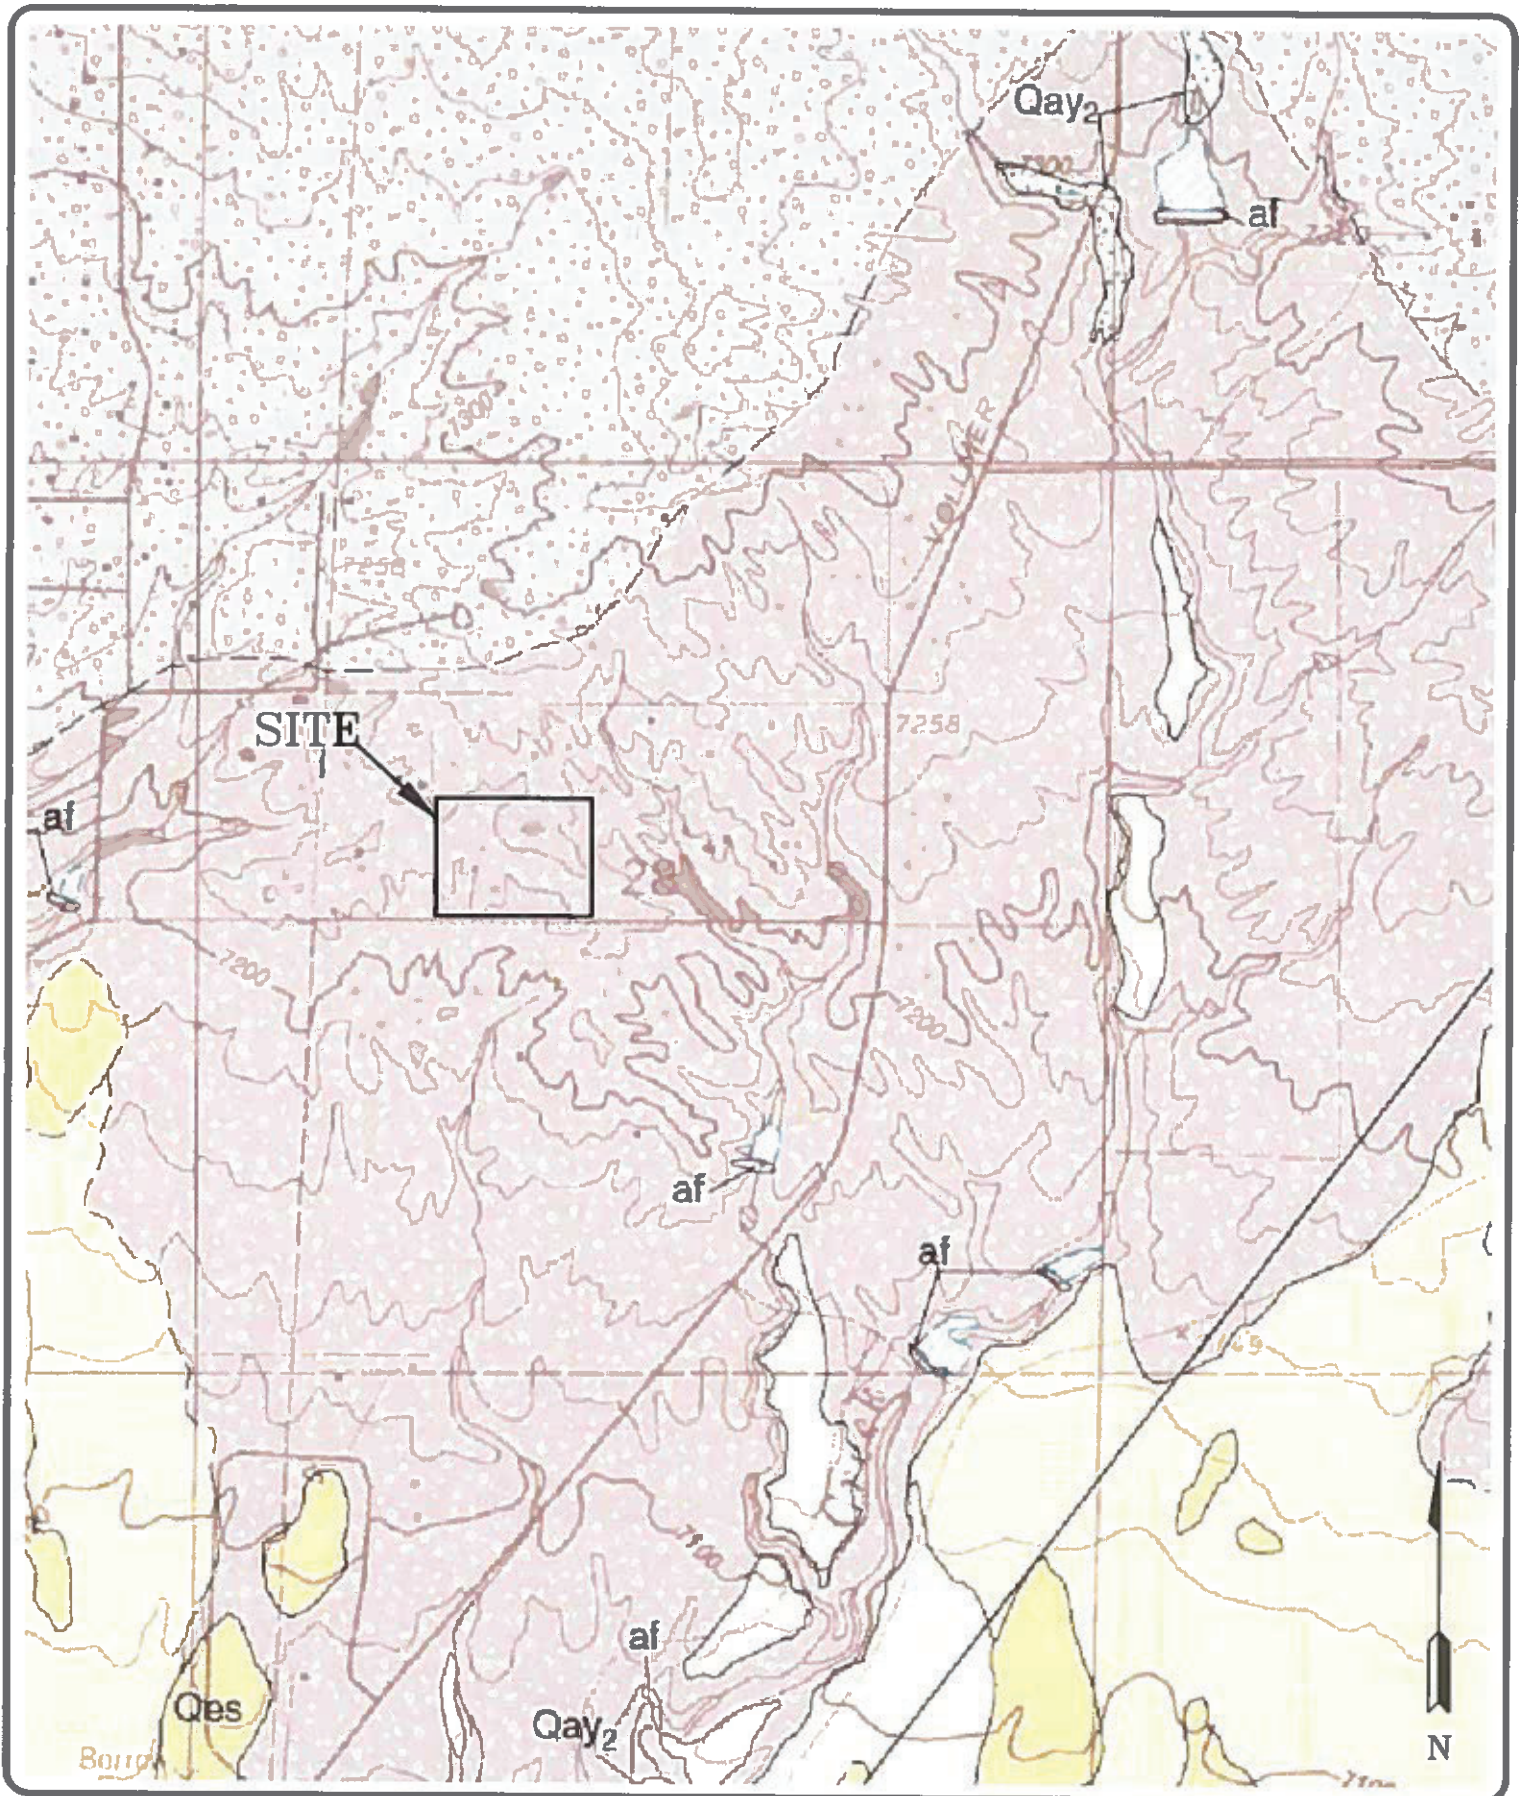

ENTECH
ENGINEERING, INC.
305 ELKTON DRIVE
COLORADO SPRINGS, CO. 80907 (719) 531-3399

FALCON NW QUADRANGLE GEOLOGIC MAP
8190 POCO ROAD
COLORADO SPRINGS, CO.
FOR: JIM MARTENS

DRAWN:
LLL


DATE:
5/24/19

CHECKED:

DATE:

JOB NO.:
190411

FIG NO.:
5

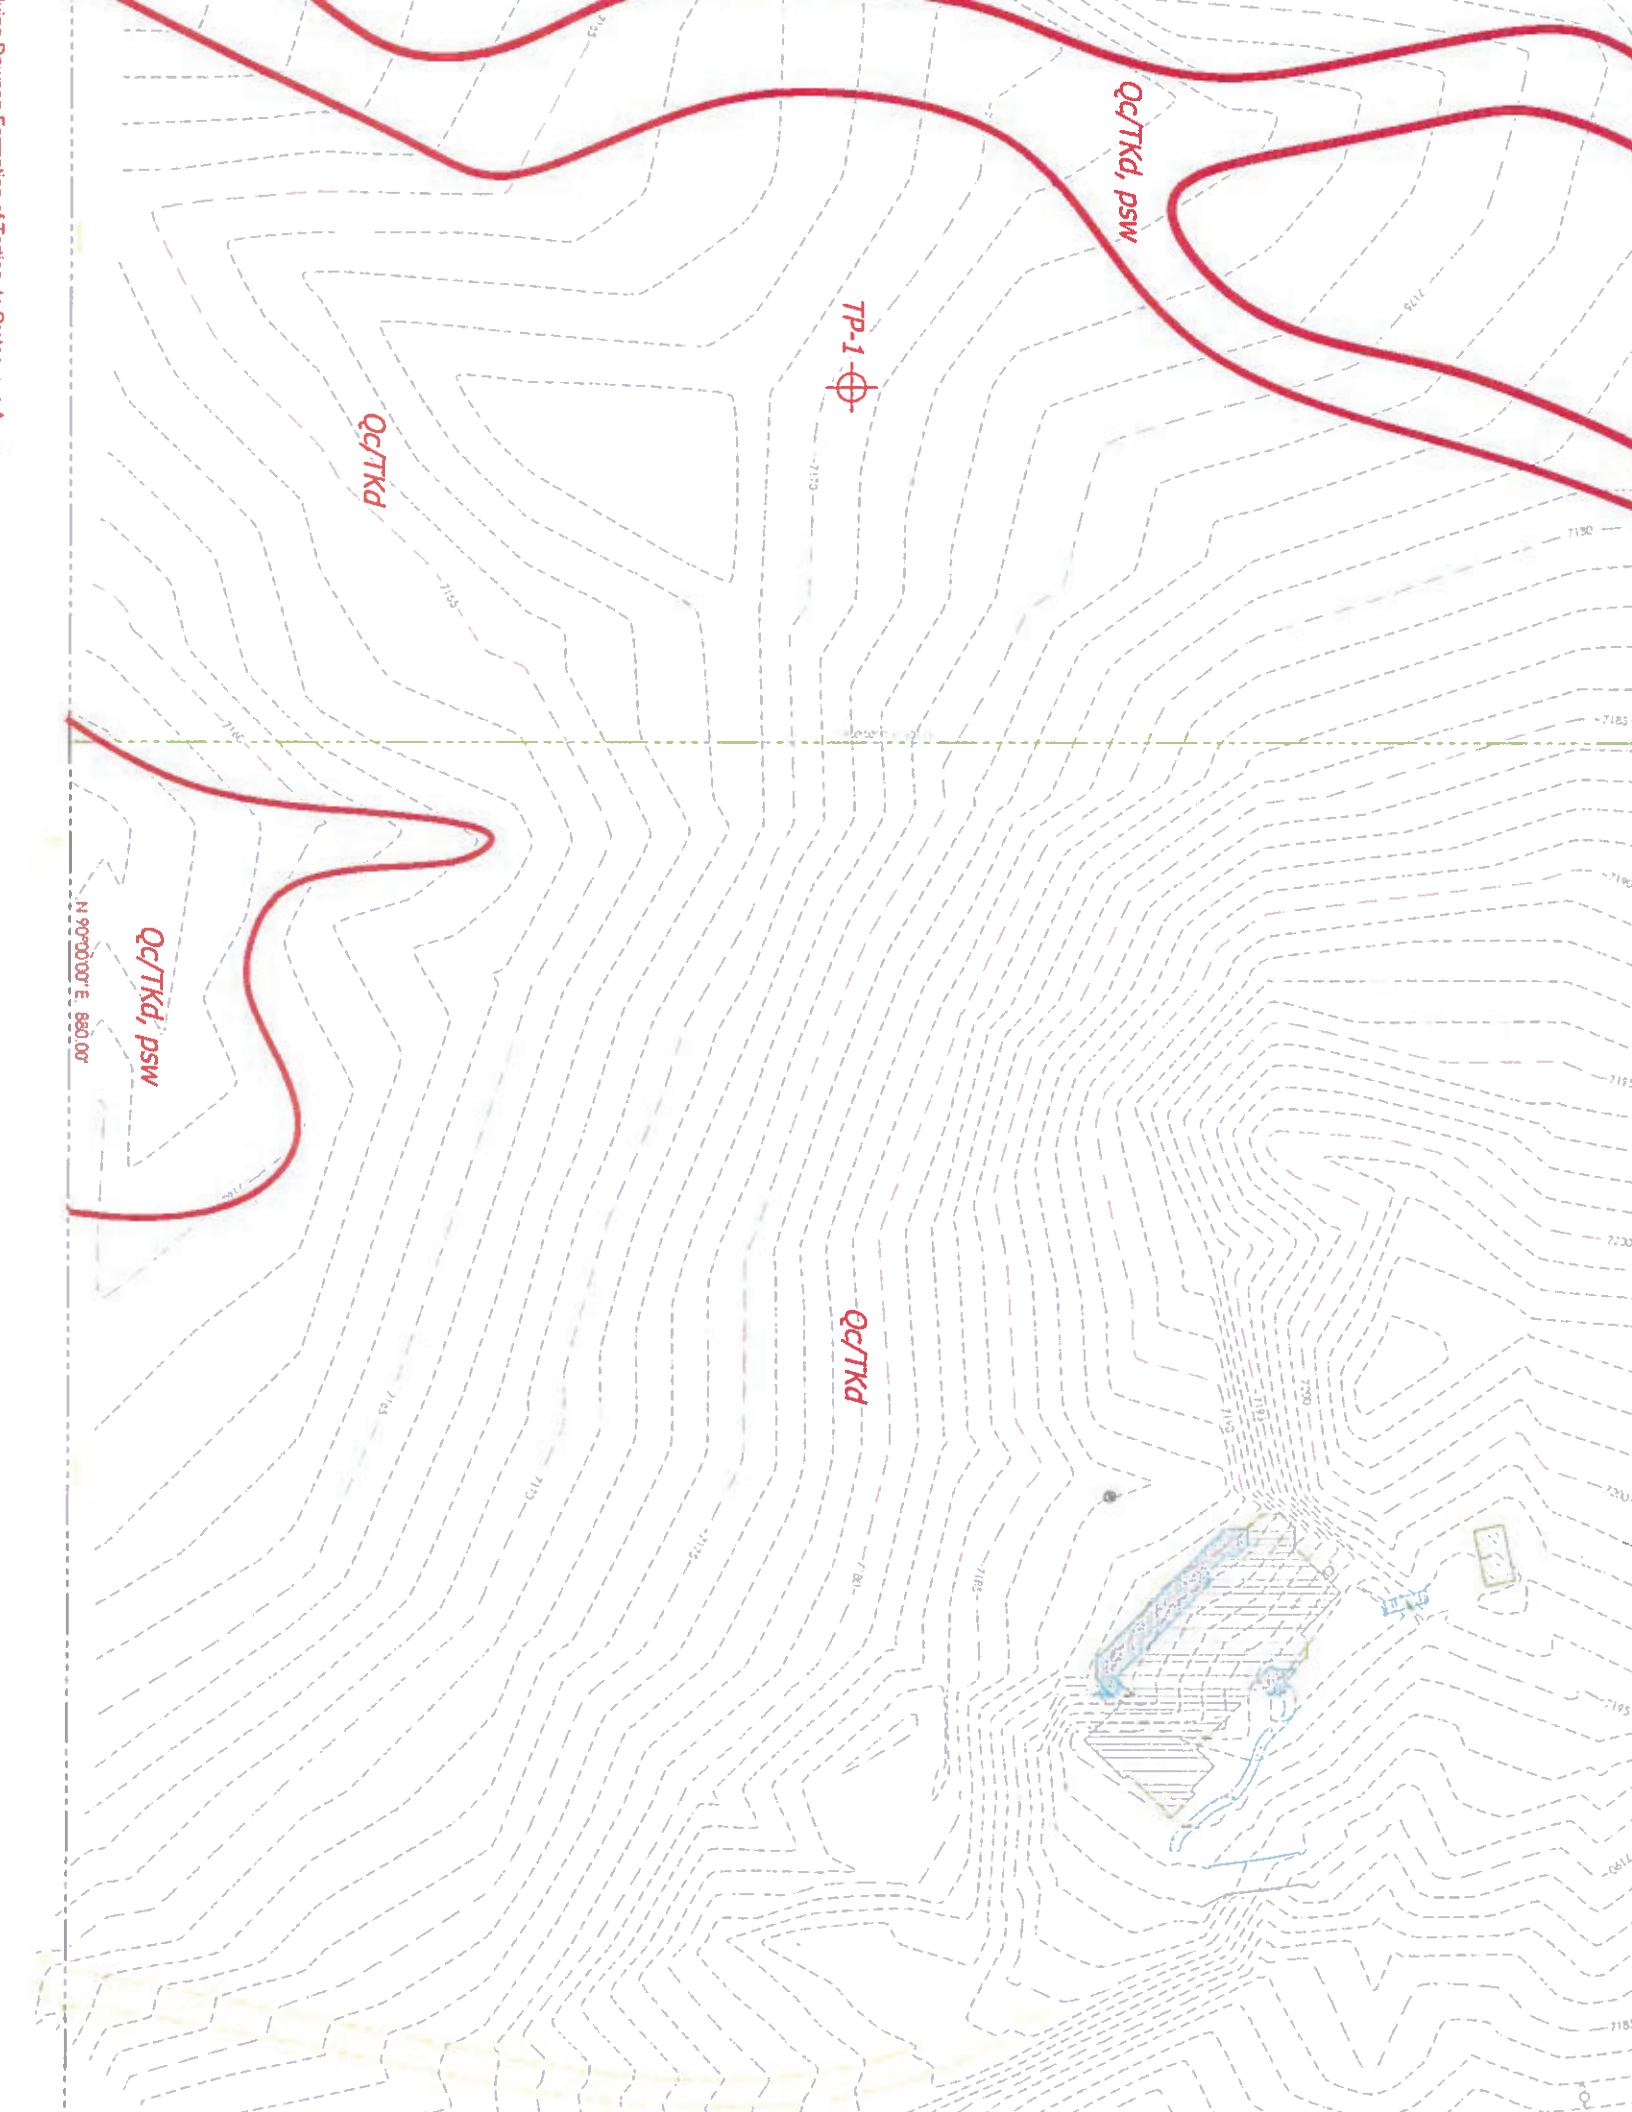

Qc/TKd, psw

TP-1

Qc/TKd

Qc/TKd, psw

Qc/TKd

N 90°00.00' E, 880.00'



ENTECH
ENGINEERING, INC.
505 ELKTON DRIVE
COLORADO SPRINGS, CO. 80907 (719) 531-3599

FEMA FLOODPLAIN MAP
8190 POCO ROAD
COLORADO SPRINGS, CO.
FOR: JIM MARTENS

DRAWN:
LLL



DATE:
5/24/19

CHECKED:

DATE:

JOB NO.:
190411

FIG NO.:
7

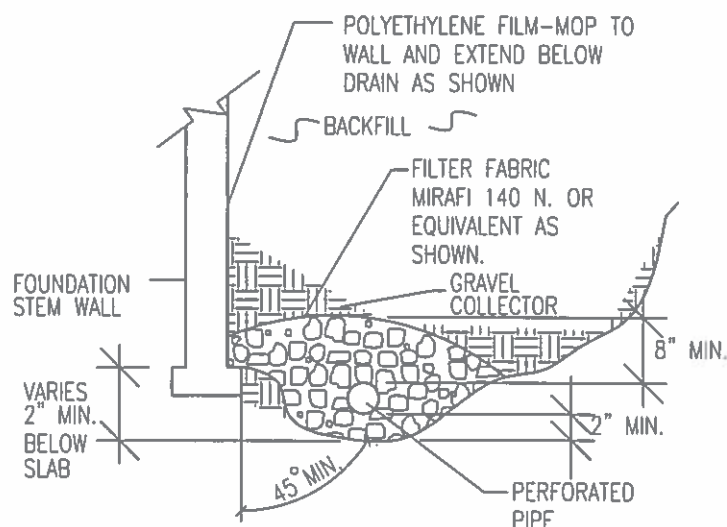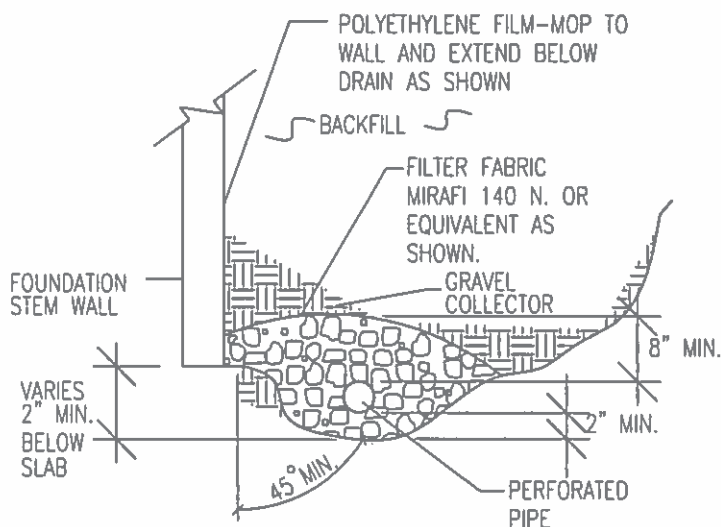

NOTES:

-GRAVEL SIZE IS RELATED TO DIAMETER OF PIPE PERFORATIONS-85% GRAVEL GREATER THAN 2x PERFORATION DIAMETER.

-PIPE DIAMETER DEPENDS UPON EXPECTED SEEPAGE. 4-INCH DIAMETER IS MOST OFTEN USED.

-ALL PIPE SHALL BE PERFORATED PLASTIC. THE DISCHARGE PORTION OF THE PIPE SHOULD BE NON-PERFORATED PIPE.

-FLEXIBLE PIPE MAY BE USED UP TO 8 FEET IN DEPTH, IF SUCH PIPE IS DESIGNED TO WITHSTAND THE PRESSURES. RIGID PLASTIC PIPE WOULD OTHERWISE BE REQUIRED.

-MINIMUM GRADE FOR DRAIN PIPE TO BE 1% OR 3 INCHES OF FALL IN 25 FEET.

-DRAIN TO BE PROVIDED WITH A FREE GRAVITY OUTFALL, IF POSSIBLE. A SUMP AND PUMP MAY BE USED IF GRAVITY OUTFALL IS NOT AVAILABLE.



ENTECH
ENGINEERING, INC.

503 ELKTON DRIVE
COLORADO SPRINGS, CO. 80907 (719) 531-5599

PERIMETER DRAIN DETAIL

DRAWN:

DATE DRAWN:

DESIGNED BY:

CHECKED:

D.S.


L.L.L.

JOB NO.:

190411

FIG. NO.:


4

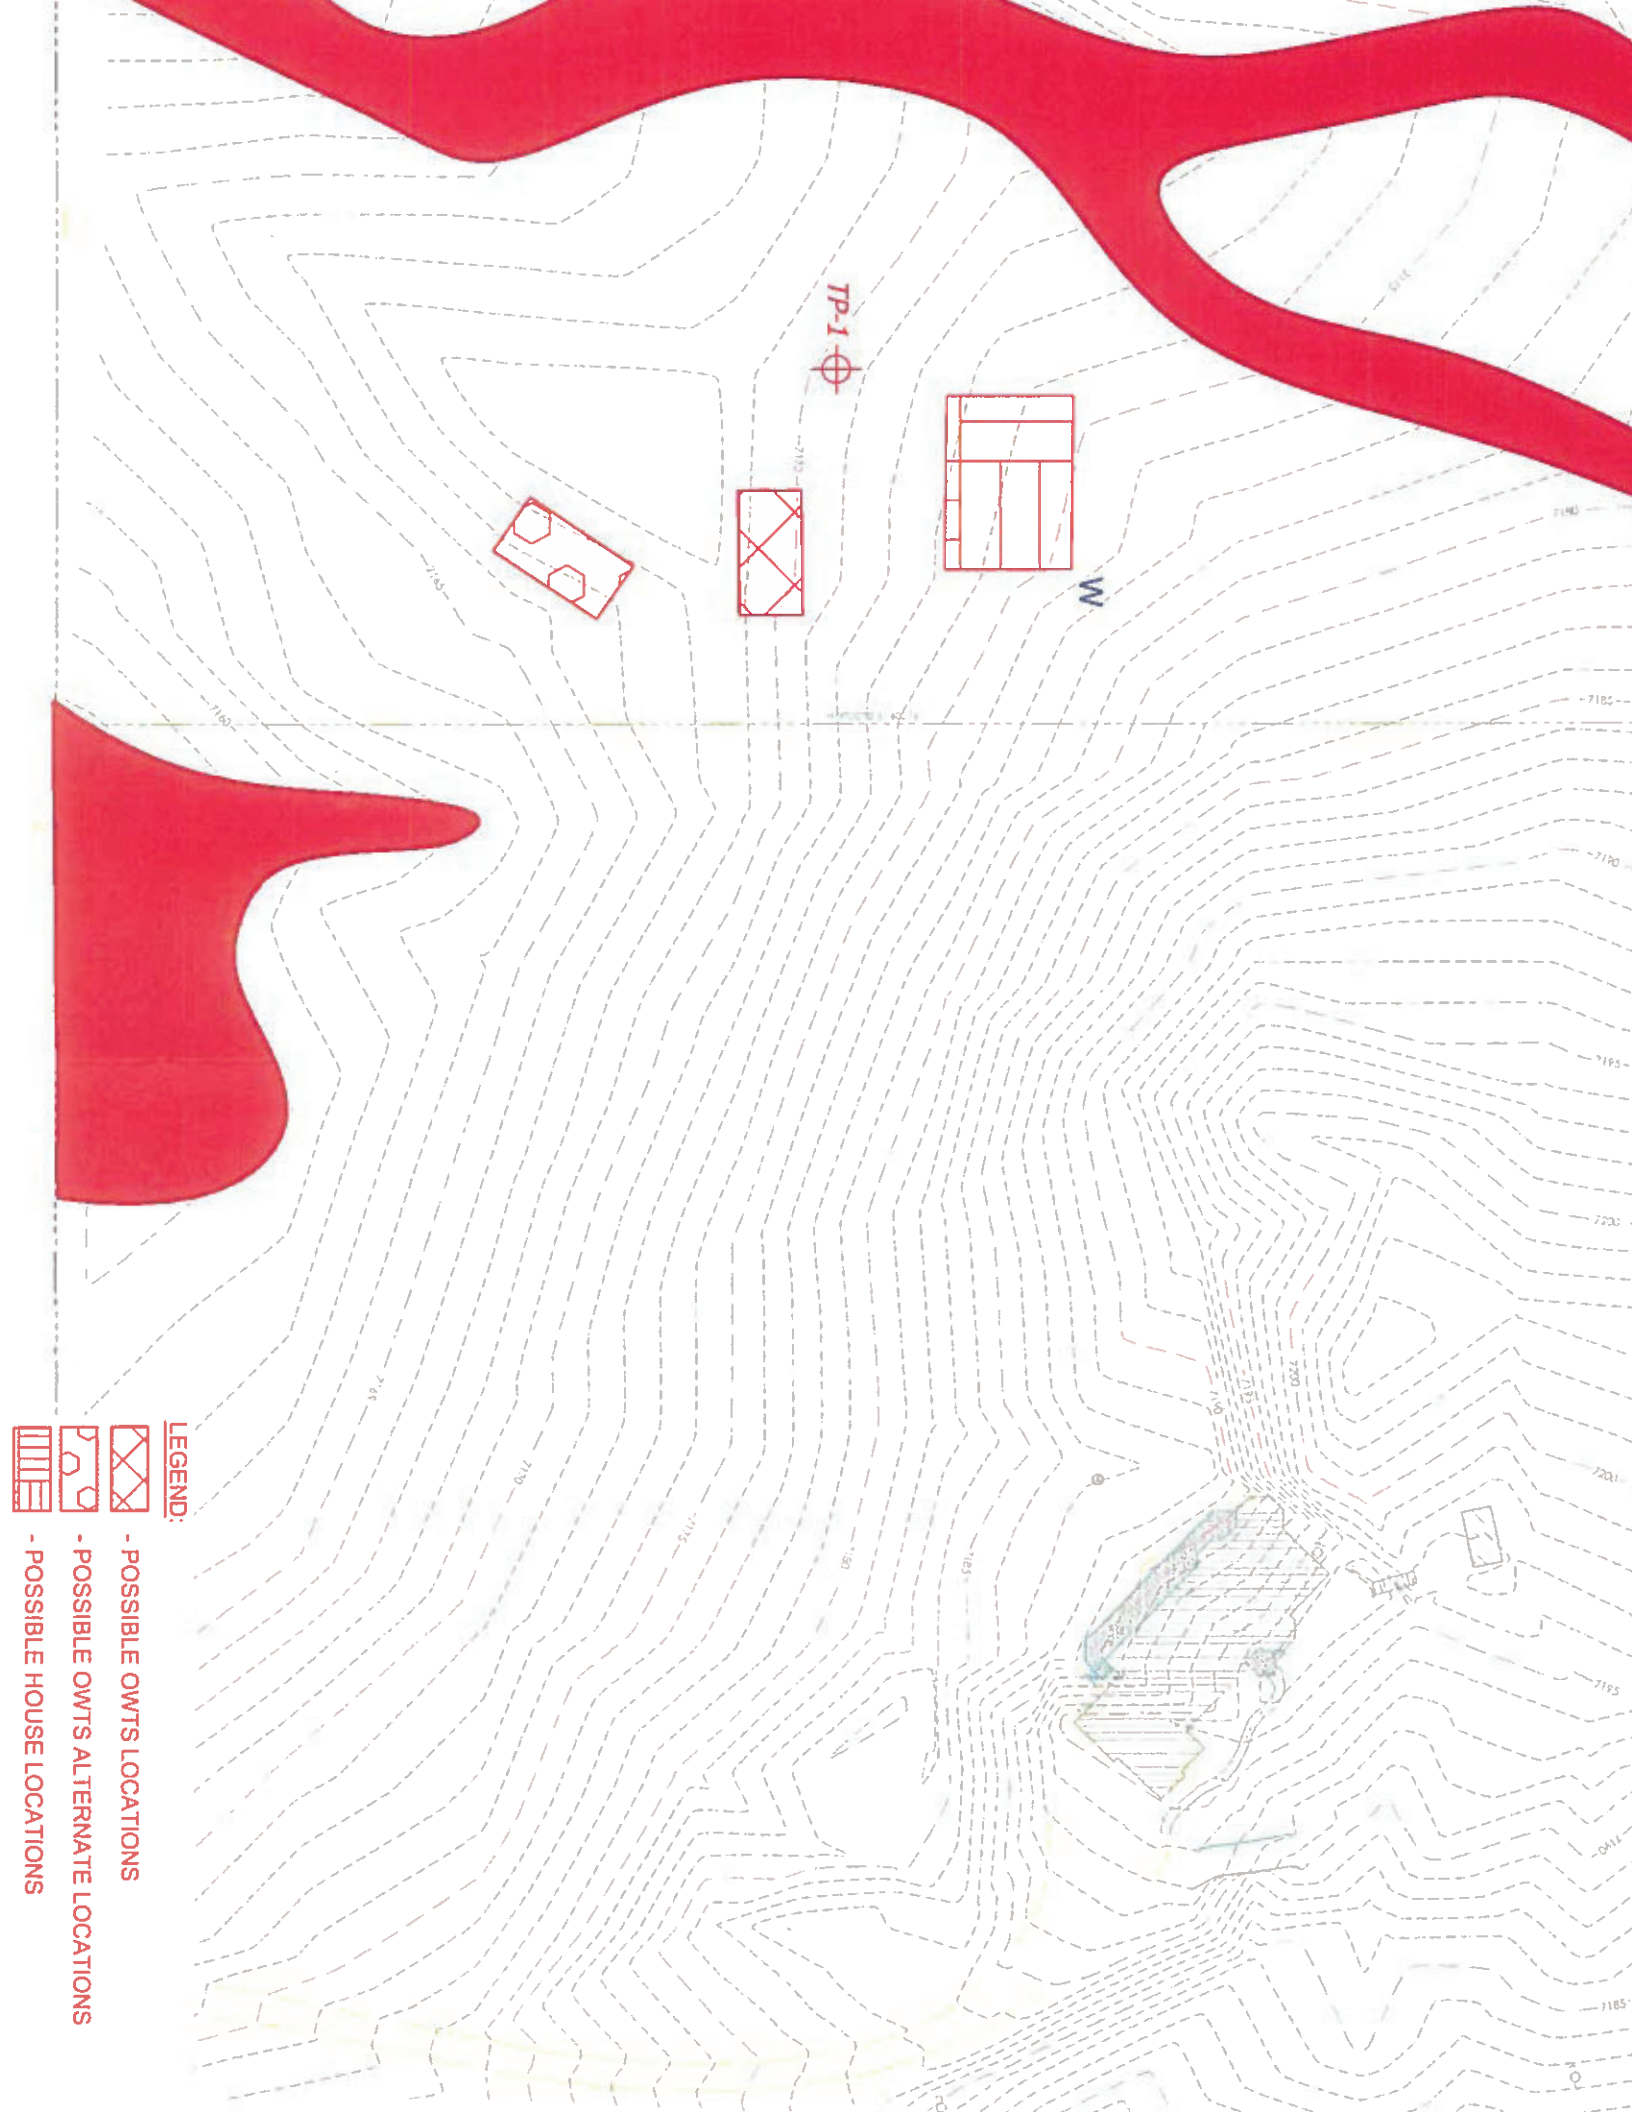

LEGEND:

- POSSIBLE OWTS LOCATIONS
- POSSIBLE OWTS ALTERNATE LOCATIONS
- POSSIBLE HOUSE LOCATIONS

APPENDIX A: Site Photographs

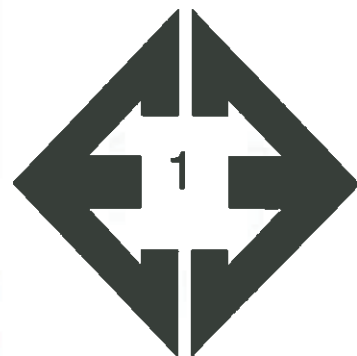


**Looking east from the
western portion of the
site.**

April 23, 2019




**Looking north from the
western portion of the
site.**

April 23, 2019

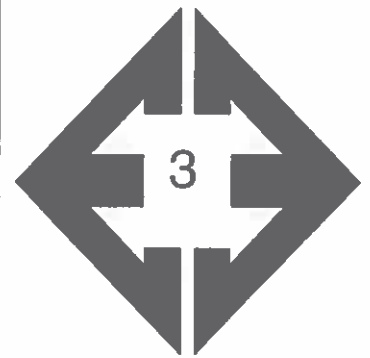

**Looking south from
the western portion of
the site.**

April 23, 2019

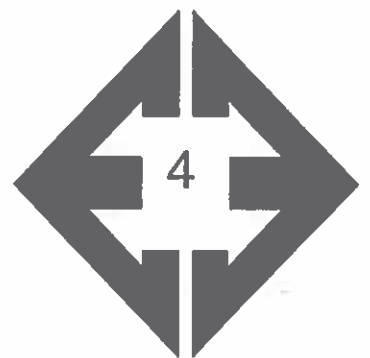

**Looking southeast
from the western
portion of the site.**

April 23, 2019

APPENDIX B: Test Pit Logs

TEST PIT NO. 1
 DATE EXCAVATED 4/23/2019
 Job # 190411

CLIENT LOCATION JIM MARTENS
 8190 POCO ROAD

REMARKS	Depth (ft)	Symbol	Samples	Soil Structure Shape	Soil Structure Grade	USDA Soil Type	REMARKS	Depth (ft)	Symbol	Samples	Soil Structure Shape	Soil Structure Grade	USDA Soil Type
topsoil sandy loam, brown	1	*						1					
gravelly sandy loam, fine to coarse grained, light brown	2			gr	m	2		2					
	3							3					
weathered to formational silty sandstone, fine to coarse grained, tan	4			ma		3A		4					
	5							5					
	6							6					
	7							7					
	8							8					
	9							9					
	10							10					

Soil Structure Shape

granular - gr
 platy - pl
 blocky - bl
 prismatic - pr
 single grain - sg
 massive - ma

Soil Structure Grade

weak - w
 moderate - m
 strong - s
 loose - l



**ENTECH
 ENGINEERING, INC.**

505 ELKTON DRIVE
 COLORADO SPRINGS, COLORADO 80907

TEST PIT LOG

DRAWN:

DATE:

CHECKED:

LL

DATE:

5/16/19

JOB NO.:

190411

FIG NO.:


APPENDIX C: Laboratory Test Results

BORING NO. TP-1
 DEPTH(ft) 0-2
 CLIENT JIM MARTENS
 PROJECT 8190 POCO ROAD

UNIFIED CLASSIFICATION SM
 AASHTO CLASSIFICATION

TEST BY BL
 JOB NO. 190411

Sieve Analysis Grain Size Distribution

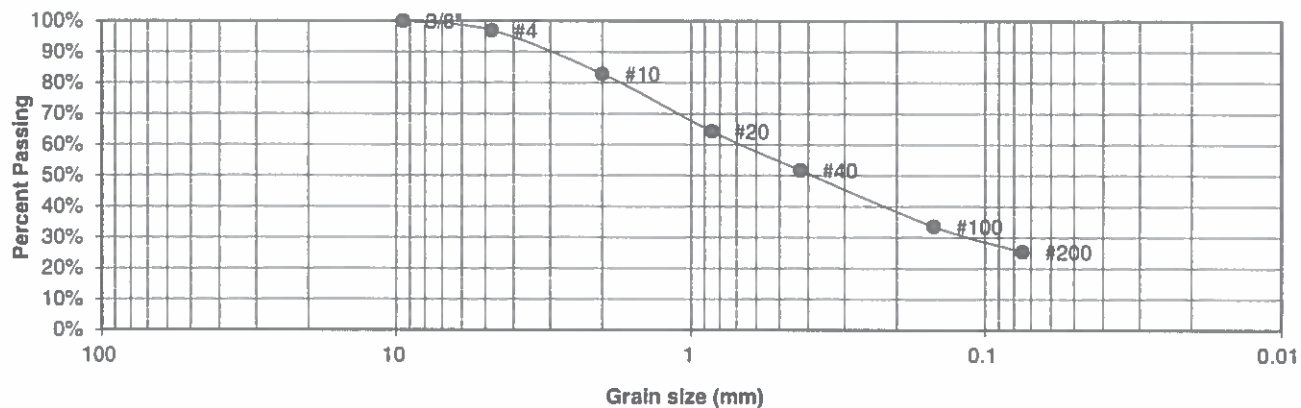

U.S. Sieve #	Percent Finer
3"	
1 1/2"	
3/4"	
1/2"	
3/8"	100.0%
4	96.9%
10	82.9%
20	64.3%
40	51.7%
100	33.6%
200	25.4%

Atterberg
Limits
 Plastic Limit
 Liquid Limit
 Plastic Index

Swell
 Moisture at start
 Moisture at finish
 Moisture increase
 Initial dry density (pcf)
 Swell (psf)



**ENTECH
ENGINEERING, INC.**

505 ELKTON DRIVE
 COLORADO SPRINGS, COLORADO 80907

LABORATORY TEST RESULTS

DRAWN:

DATE:

CHECKED:

DATE:

LLL

5/18/19

JOB NO.:
190411


FIG NO.:

BORING NO. TP-1
 DEPTH(ft) 5-6
 CLIENT JIM MARTENS
 PROJECT 8190 POCO ROAD

UNIFIED CLASSIFICATION SM
 AASHTO CLASSIFICATION

TEST BY BL
 JOB NO. 190411

Sieve Analysis
 Grain Size Distribution

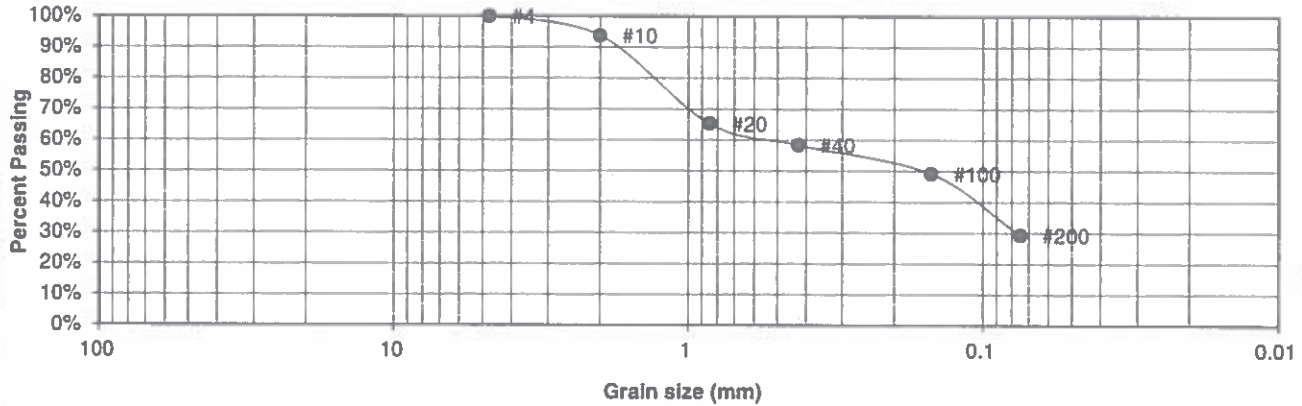

U.S. Sieve #	Percent Finer
3"	
1 1/2"	
3/4"	
1/2"	
3/8"	
4	100.0%
10	93.8%
20	65.3%
40	58.4%
100	49.2%
200	29.3%

Atterberg
Limits
 Plastic Limit NP
 Liquid Limit NV
 Plastic Index NP

Swell
 Moisture at start 13.0%
 Moisture at finish 24.2%
 Moisture increase 11.2%
 Initial dry density (pcf) 93
 Swell (psf) 280



ENTECH
ENGINEERING, INC.

505 ELKTON DRIVE
 COLORADO SPRINGS, COLORADO 80907

LABORATORY TEST
 RESULTS

DRAWN:	DATE:	CHECKED: LL	DATE: 5/16/19
--------	-------	----------------	------------------

JOB NO.:
 190411

FIG NO.:

APPENDIX D: Soil Survey Descriptions

71—Pring coarse sandy loam, 3 to 8 percent slopes. This deep, noncalcareous, well drained soil formed in sandy sediment derived from arkosic sedimentary rock on valley side slopes and on uplands. Elevation ranges from 6,800 to 7,600 feet. The average annual precipitation is about 17 inches, the average annual air temperature is about 43 degrees F, and the average frost-free period is about 120 days.

Typically, the surface layer is dark grayish brown coarse sandy loam about 4 inches thick. The substratum is dark grayish brown coarse sandy loam about 10 inches thick over pale brown gravelly sandy loam that extends to a depth of 60 inches or more.

Included with this soil in mapping are small areas of Alamosa loam, 1 to 3 percent slopes, along drainageways; Cruickton sandy loam, 1 to 9 percent slopes; Peyton sandy loam, 1 to 5 percent slopes; Peyton sandy loam, 5 to 9 percent slopes; and Tomah-Crowfoot loamy sands, 3 to 8 percent slopes. In some places arkose beds of sandstone and shale are at a depth of 0 to 40 inches.

Permeability of this Pring soil is rapid. Effective rooting depth is 60 inches or more. Available water capacity is moderate. Surface runoff is medium, and the hazard of erosion is moderate.

Almost all areas of this soil are used as rangeland. Some areas previously cultivated have been reseeded to grass. This soil is also used for wildlife habitat and homesites.

This soil is well suited to the production of native vegetation suitable for grazing by cattle and sheep. Rangeland vegetation is mainly mountain muhly, little bluestem, needleandthread, Parry oatgrass, and junegrass.

Deferment of grazing in spring helps to maintain vigor and production of the cool-season bunchgrasses. Fencing and properly locating livestock watering facilities help to control grazing.

Windbreaks and environmental plantings generally are suited to this soil. The hazard of soil blowing is the main limitation to the establishment of trees and shrubs. This limitation can be overcome by cultivating only in the tree rows and leaving a strip of vegetation between the rows. Supplemental irrigation may be needed when planting and during dry periods. Trees that are best suited and have good survival are Rocky Mountain juniper, eastern redcedar, ponderosa pine, Siberian elm, Russian-olive, and hackberry. Shrubs that are best suited are skunkbush sumac, lilac, and Siberian peashrub.

This soil is suited to habitat for openland and rangeland wildlife. Rangeland wildlife, such as pronghorn antelope, can be encouraged by developing livestock watering facilities, properly managing livestock grazing, and reseeding range where needed.

This soil is well suited for use as homesites. Erosion control practices are needed to control soil blowing and water erosion on construction sites where the ground cover has been removed. Capability subclass IVe.



ENTECH
ENGINEERING, INC.

SCS SOIL DESCRIPTION

Drawn	Date	Checked	Date
		L.L.L.	5/24/19

Job No.

190911

Fig. No.

D-1

**APPENDIX E: El Paso County Health Department
Septic Records**

EL PASO COUNTY DEPARTMENT OF HEALTH AND ENVIRONMENT
INDIVIDUAL SEWAGE DISPOSAL SYSTEM INSPECTION FORM

960
Permit # 12908
Date 05/20/99

P

APPROVED: YES ☒ NO ☐ #5228000011

ENVIRONMENTALIST J. CHRISTENSEN

Address 8190 POCO ROAD. Owner JIM AND KAREN MARTENS

Legal Description W 2/3, S2, SE4, NW4 SEC: 28-12-65

Residence ☒, # of bedrooms 4; Commercial ☐; System Installer KUNAU

SEPTIC TANK:

Commercial ☒; Noncommercial ☐, L ☐, W ☐, WD ☐
Construction Material CONCRETE, capacity 1500 gallons.

DISPOSAL FIELD:

Rock Systems:

Trench: depth ☐, width ☐, total length ☐, sq. feet ☐

Bed: depth ☐, length ☐, width ☐, sq. feet ☐

Rock type ☐, depth ☐, under PVC ☐, over PVC ☐

Seepage Pits: # of pits ☐, total # of rings ☐, working depth(s) ☐

size of pit(s) L X W ☐, lining material ☐, total sq. feet ☐

Rockless Systems:

Chamber: Type INFILTRATOR, number of chambers 39, bed ☐, trench ☒

sq. ft./section 15.5, reduction allowed 40%, sq. ft. required 998

total sq. ft. installed 1008, depth of installation 12"-17"

Engineer Design Y or (N), Designing Engineer


Approval letter provided? Y or (N)

Well 50 feet from tank Y or N 100 feet from leach field Y or N

Well installed at time of septic system inspection (Y) or N Public Water

*Approval will be revoked if in the future the well is found to be within 50 feet of the septic tank and/or 100 feet of the disposal field.

NOTES: 6" schedule 40 pipe sleeved over 4" SD1335 sewer pipe from building sewer to septic tank inlet. 05/26/99 field is backfilled. Builders have left water running & runoff has eroded & exposed chamber in first trench. Need to divert H2O around field.

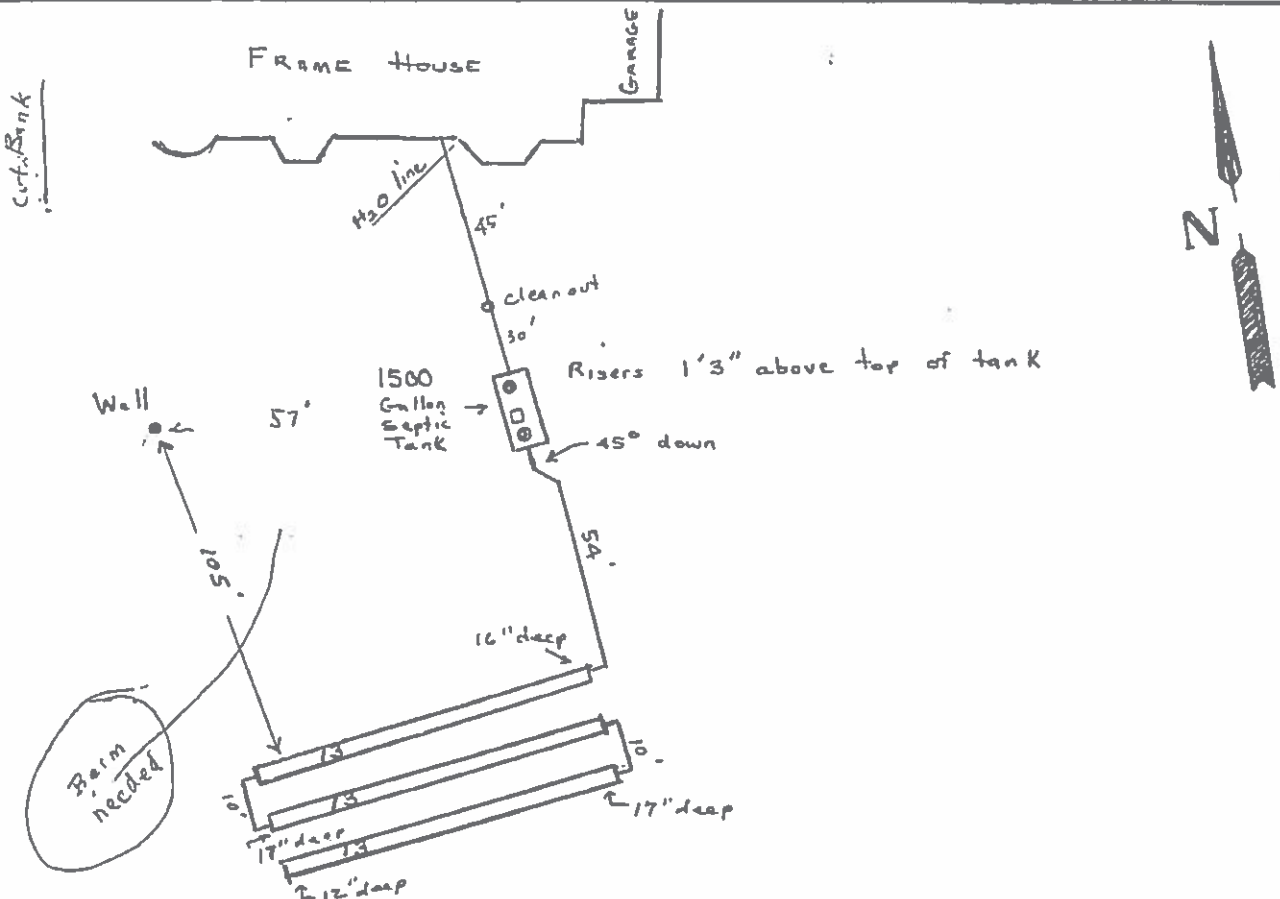

Poco Rd ↓

Acres 1.2
Water Supply WELL

EL PASO COUNTY • DEPARTMENT OF HEALTH AND ENVIRONMENT
301 South Union Blvd. • Colorado Springs, Colorado • 578-3125

Permit _____

PERMIT

TO CONSTRUCT, ALTER, REPAIR OR MODIFY ANY INDIVIDUAL SEWAGE DISPOSAL SYSTEM

Issued to JILL AND KAREN EATLES Date 11-30-93 Receipt No. 11-30-93

Address of Property 8120 POCO ROAD, WY. S2, SEC. 13A, SEC. 20-12-65 Phone 599-8091
(Permit valid at this address only)

Sewage-Disposal System work to be performed by KUNAU Phone 683-3720
This Permit is issued in accordance with 25-10-106 Colorado Revised Statutes 1973, as amended. PERMIT EXPIRES upon completion of installation of sewage-disposal system or at the end of twelve (12) months from date of issue—whichever occurs first—(unless work is in progress). This permit is revokable if all stated requirements are not met.

-THIS PERMIT DOES NOT DENOTE APPROVAL OF ZONING AND ACREAGE REQUIREMENTS-

\$205.00

PERMIT FEE (NOT REFUNDABLE)

11-30-99

DATE OF EXPIRATION

NOTE: LEAVE ENTIRE SEWAGE-DISPOSAL SYSTEM UNCOVERED FOR FINAL INSPECTION. 48 HOUR ADVANCE NOTICE REQUIRED.

SEPTIC TANK:	TRENCH SYSTEM:	BED SYSTEM:	SEEPAGE PIT SYSTEM:
1500	total square feet _____ ft. of trench _____ ft. of trench _____	total square feet _____ rings or _____ diam.x _____ w/d _____	total square feet _____

NOTES: INSTALL ABSORPTION SYSTEM IN THE AREA OF THE PERCOLATION TEST. ACCORDING TO AREA SHALL BE NO DEEPER THAN 18 INCHES BELOW THE EXISTING GROUND SURFACE.

The Health Office shall assume no responsibility in case of failure or inadequacy of a sewage-disposal system, beyond consulting in good faith with the property owner or representative. Free access to the property shall be authorized at reasonable time for the purpose of making such inspections as are necessary to determine compliance with requirements of this law.

Steven J. Englander, MD
DIRECTOR, DEPARTMENT OF HEALTH AND ENVIRONMENT

David Christensen
ENVIRONMENTALIST 578-3141

EL PASO COUNTY ENVIRONMENTAL HEALTH SERVICES
301 South Union Boulevard Colorado Springs, CO 80910-3123

APPLICATION FOR A NEW, REMODEL, REPAIR, OR ADDITION
TO AN INDIVIDUAL SEWAGE DISPOSAL SYSTEM

mark Lindt
495-4705

Owner Jim & Karen Martens Phone 599-8091
Address of Property 8190 Dico Road 80908 Lot Size 12 AC Water Supply Well
Tax Sch # 52280-00-011 Septic Contractor & Phone # _____
Legal Description W 2/3 of S2, SE4, NW4, Sec 28-12-65
Type of Building frame Single Family Home Owner's Mailing Address 4910 Ramblewood 80920

MAXIMUM POTENTIAL BEDROOMS

4

Basement ☒ N Percolation Test Attached ☒ N Garbage Disposal ☒ N Clothes Washer ☒ N

I have supplied a plot plan as described on the back of this form. I acknowledge the completeness of the application is conditional upon such further mandatory and additional tests and reports as may be required by the Department to be made and furnished by a applicant for purposes of evaluating the application, and issuance of the permit is subject to such terms and conditions as deemed necessary to ensure compliance with rules and regulations adopted pursuant to C.R.S. 10-25-101 et. seq. I hereby certify all represented to be true and correct to the best of my knowledge and belief, and are designed to be relied on by the El Paso County Department of Health and Environment in evaluating the same for purposes of issuing the permit applied for herein. I further understand any falsification or misrepresentation may result in the denial of the application or revocation of any permit granted based upon said application and in legal action for perjury as provided by law.

OWNER'S SIGNATURE

Jim Martens

Date

11/17/98

DEPARTMENT OF HEALTH USE ONLY

998 ft² 1500 GALLONS 11/19/98
Absorption Area Tank Capacity Date of Site Inspection

REMARKS:

Install absorption system in the area of the percolation
test. Absorption area shall be no deeper than 18
inches below the existing ground surface.

EHS INSPECTOR

Janet Christensen

Date 11/19/98

☒ APPROVED

☐ DENIED

PERMIT #

12908

☒ FEE

☐ NO FEE

DATE TO EPC PLANNING DEPT

11-19-98

pd 12-1-98
check 1100

attached

We require the ORIGINAL of your percolation (PERC) TEST.
The following information must be on your PLOT PLAN.

Property lines
Proposed septic system site
Well(s)
Building(s)
Water line
Subsoil drain(s)


Property dimensions
Designated alternate septic system site
Adjacent property well(s)
Proposed building(s)
Cistern

If any of these are within 100 feet of your proposed septic system
include on your plot plan

Spring(s)
Pond(s)
Dry Gulch(s)

Lake(s)
Stream(s)
Natural drainage course(s)

PROPERTY AND PERC HOLES MUST BE CLEARLY MARKED OR POSTED

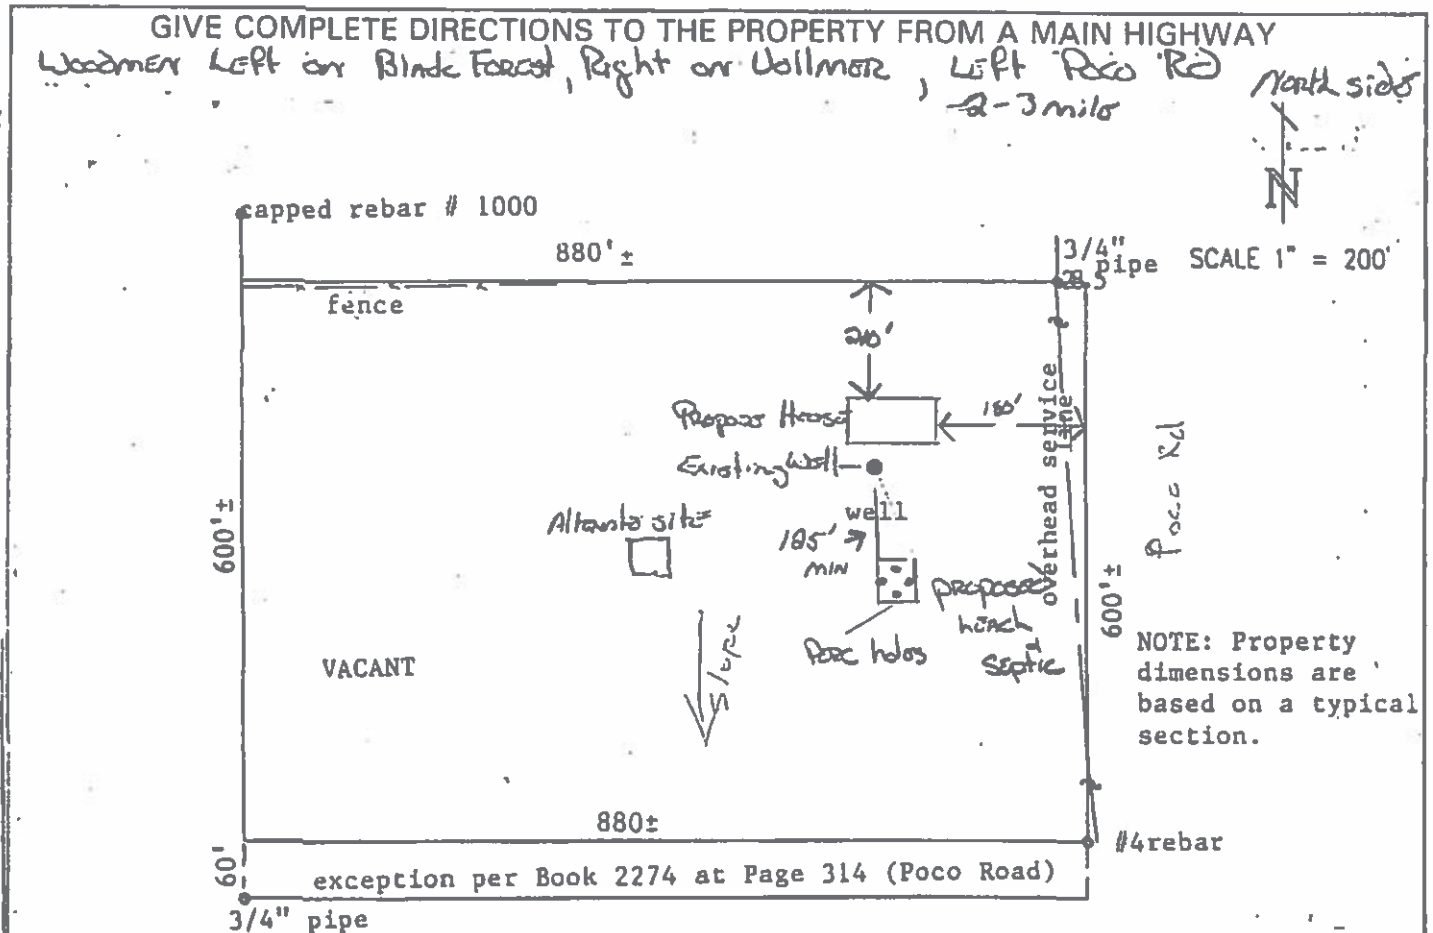

LEGAL DESCRIPTION

The West two-thirds (2/3) of the South half of the Southeast Quarter of the Northwest Quarter of Section 28 in Township 12 South Range 65 West of the 6th P.M., except the South 60 feet thereof conveyed to El Paso County for road purposes by Deed recorded in Book 2274 at Page 314, El Paso County, Colorado.