



**ENTECH**  
ENGINEERING, INC.

505 ELKTON DRIVE  
COLORADO SPRINGS, CO 80907  
PHONE (719) 531-5599  
FAX (719) 531-5238

February 17, 2015

Land First, Inc.  
154 Del Oro Circle  
Colorado Springs, Colorado 80919

Attn: Ronald Waldthausen

Re: Asphalt Testing - Roadway  
Meridian Road and Bent Grass Meadows Drive  
Report No. 1, Tests 1 – 10

Dear Mr. Waldthausen:

As requested, personnel of Entech Engineering, Inc. have performed asphalt testing at the above referenced site.

Asphalt testing on this site was performed on February 13, 2015. The tests indicate that the materials have been properly compacted at the depths and locations noted. Results of the asphalt tests are attached with this letter.

We trust that this has provided you with the information you required. Should you have any questions or need further information, please do not hesitate to contact us.

Respectfully submitted,

ENTECH ENGINEERING, INC.


  
Joseph C. Goode, Jr., P.E.  
President

JCG/jr

Encl.

Entech Job No. 141422  
3MSW/Asphalt/2014/141422.ac

No Mail  
Email: Distribution List

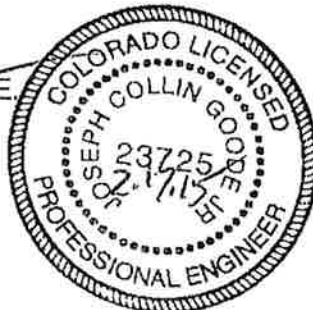

Client: Land First, Inc.	Entech Job #: 141422.6	Maximum Density Key: M = Marshall Value R = Rice Value
Project: Meridian Road and Bent Grass Meadows Drive	Tested By: C. Redwine	
Subject: Asphalt Roadway	Report Date: 02-18-2015	

Test Test #	Location	Testing Date	Percent Compaction	Percent Required	Field Density	Maximum Density	Pass/Fail
1	8036 Meridian Park, longitudinal joint, 15' east and 14' south of southeast corner of property line, first lift.	2/13/15	93	90	140.8	R - 151.7	<input type="checkbox"/>
2	8036 Meridian Park, 15' east and 8' north of southeast corner of property line, first lift.	2/13/15	93	92-96	141.2	R - 151.7	<input type="checkbox"/>
3	8036 Meridian Park, 20' east and 40' south of southeast corner of property line, first lift.	2/13/15	94	92-96	142.5	R - 151.7	<input type="checkbox"/>
4	8036 Meridian Park, 7' east and 50' south of southeast corner of property line, first lift.	2/13/15	92	92-96	140.4	R - 151.7	<input type="checkbox"/>
5	8036 Meridian Park, 15' east and 50' north of northeast corner of property line, first lift.	2/13/15	93	92-96	140.2	R - 151.7	<input type="checkbox"/>
6	8036 Meridian Park, longitudinal joint, 10' east and 15' north of northeast corner of property line, second lift.	2/13/15	94	90	142.0	R - 151.7	<input type="checkbox"/>
7	8036 Meridian Park, 10' east and 20' north of northeast corner of property line, second lift.	2/13/15	93	92-96	140.5	R - 151.7	<input type="checkbox"/>
8	8036 Meridian Park, 20' east and 40' north of northeast corner of property line, second lift.	2/13/15	93	92-96	140.8	R - 151.7	<input type="checkbox"/>
9	8036 Meridian Park, 20' east and 15' south of southeast corner of property line, second lift.	2/13/15	93	92-96	141.3	R - 151.7	<input type="checkbox"/>
10	8036 Meridian Park, 8' east and 40' south of southeast corner of property line, second lift.	2/13/15	92	92-96	140.3	R - 151.7	<input type="checkbox"/>

All dimensions are approximate. Cl. = Centerline



**ENTECH**  
ENGINEERING, INC.  
505 Elkton Drive  
Colorado Springs, CO 80907  
(719) 531-5598 • (719) 531-5238 (fax)

### ASPHALT TESTING RESULTS

Joseph C. Goode, Jr., P.E.

[illegible]