

PRIVATE DETENTION BASIN /  
STORMWATER QUALITY BEST MANAGEMENT PRACTICE  
MAINTENANCE AGREEMENT AND EASEMENT

This PRIVATE DETENTION BASIN / STORMWATER QUALITY BEST MANAGEMENT PRACTICE MAINTENANCE AGREEMENT AND EASEMENT (Agreement) is made by and between EL PASO COUNTY by and through THE BOARD OF COUNTY COMMISSIONERS OF EL PASO COUNTY, COLORADO (Board or County) and PIKES PEAK HABITAT FOR HUMANITY, INC. (Developer) and RISING MOON COMMUNITY LAND TRUST, LLC (Homeowners Association or Association), a Colorado limited liability company. The above may occasionally be referred to herein singularly as "Party" and collectively as "Parties."

**Recitals**

A. WHEREAS, Developer is the owner of certain real estate (the Property) in El Paso County, Colorado, which Property is legally described in Exhibit A attached hereto and incorporated herein by this reference; and

B. WHEREAS, Developer desires to plat and develop on the Property a Subdivision to be known as RISING MOON FILING NO. 1; and

C. WHEREAS, the development of this Property will substantially increase the volume of water runoff and will decrease the quality of the stormwater runoff from the Property, and, therefore, it is in the best interest of public health, safety and welfare for the County to condition approval of this subdivision on Developer's promise to construct adequate drainage, water runoff control facilities, and stormwater quality structural Best Management Practices ("BMPs") for the subdivision; and

D. WHEREAS, Chapter 8, Section 8.4.5 of the El Paso County Land Development Code, as periodically amended, promulgated pursuant to Section 30-28-133(1), Colorado Revised Statutes (C.R.S.), requires the County to condition approval of all subdivisions on a developer's promise to so construct adequate drainage, water runoff control facilities, and BMPs in subdivisions; and

E. WHEREAS, the Drainage Criteria Manual, Volume 2, as amended by Appendix I of the El Paso County Engineering Criteria Manual (ECM), as each may be periodically amended, promulgated pursuant to the County's Colorado Discharge Permit System General Permit (MS4 Permit) as required by Phase II of the National Pollutant Discharge Elimination System (NPDES), which MS4 Permit requires that the County take measures to protect the quality of stormwater from sediment and other contaminants, requires subdividers, developers, landowners, and owners of facilities located in the County's rights-of-way or easements to provide adequate permanent stormwater quality BMPs with new development or significant redevelopment; and

F. WHEREAS, Section 2.9 of the El Paso County Drainage Criteria Manual provides for a developer's promise to maintain a subdivision's drainage facilities in the event the County does not assume such responsibility; and

G. WHEREAS, developers in El Paso County have historically chosen water runoff detention basins as a means to provide adequate drainage and water runoff control in subdivisions, which basins, while effective, are less expensive for developers to construct than other methods of providing drainage and water runoff control; and

H. WHEREAS, Developer desires to construct for the Subdivision one detention basin/stormwater quality BMP(s) ("detention basin/BMP(s)") as the means for providing adequate drainage and stormwater runoff control and to meet requirements of the County's MS4 Permit, and to provide for operating, cleaning, maintaining and repairing such detention basin/BMP(s); and

I. WHEREAS, Developer desires to construct the detention basin/BMP(s) on property that will be platted as Tract A, as indicated on the final plat of the Subdivision, and as set forth on Exhibit B attached hereto; and

J. WHEREAS, Developer shall be charged with the duty of constructing the detention basin/BMP(s) and the Association shall be charged in the Subdivision's Covenants with the duties of operating, maintaining and repairing all common areas and common structures within the Subdivision, including the detention basin/BMP(s) on the portion of the Property described in Exhibit B; and

K. WHEREAS, it is the County's experience that subdivision developers and homeowners' associations historically have not properly cleaned and otherwise not properly maintained and repaired these detention basins/BMPs, and that these detention basins/BMPs, when not so properly cleaned, maintained, and repaired, threaten the public health, safety and welfare; and

L. WHEREAS, the County, in order to protect the public health, safety and welfare, has historically expended valuable and limited public resources to so properly clean, maintain, and repair these detention basins/BMPs when developers and homeowners' associations have failed in their responsibilities, and therefore, the County desires the means to recover its costs incurred in the event the burden falls on the County to so clean, maintain and repair the detention basin/BMP(s) serving this Subdivision due to the Developer's or the Association's failure to meet its obligations to do the same; and

M. WHEREAS, the County conditions approval of this Subdivision on the Developer's promise to so construct the detention basin/BMP(s), and further conditions approval on the Association's promise to reimburse the County in the event the burden falls upon the County to so clean, maintain and/or repair the detention basin/BMP(s) serving this Subdivision; and

N. WHEREAS, the County could condition subdivision approval on the Developer's promise to construct a different and more expensive drainage, water runoff control system and BMPs than those proposed herein, which more expensive system would not create the possibility of the burden of cleaning, maintenance and repair expenses falling on the County; however, the County is willing to forego such right upon the performance of Developer's and the Association's promises contained herein; and

O. WHEREAS, the County, in order to secure performance of the promises contained herein, conditions approval of this Subdivision upon the Developer's grant herein of a perpetual Easement over a portion of the Property for the purpose of allowing the County to periodically access, inspect, and, when so necessary, to clean, maintain and/or repair the detention basin/BMP(s); and

P. WHEREAS, given that the Association could potentially avoid liability hereunder by dissolving and reforming as a different entity, and given the difficulties inherent in collecting an unsecured promise, the County, in order to secure performance of the promises contained herein, conditions approval of this Subdivision upon the Developer's creation, by and through this Agreement, of a covenant running with the land upon each and every lot in the Subdivision.

#### Agreement

NOW, THEREFORE, in consideration of the mutual Promises contained herein, the sufficiency of which are hereby acknowledged, the Parties agree as follows:

1. Incorporation of Recitals: The Parties incorporate the Recitals above into this Agreement.

2. Covenants Running with the Land and Pro Rata Liability upon Individual Lot Owners: Developer and the Association agree that this entire Agreement and the performance thereof shall become a covenant running with the land, which land is legally described in Exhibit A attached hereto, and that this entire Agreement and the performance thereof shall be binding upon themselves and their respective successors and assigns, including individual lot owners within the Subdivision.

However, any liability imposed under this Agreement against an individual lot owner shall not be joint and several with the Developer and the Association, but shall be pro-rated on a per-lot basis as determined by the following formula and illustration: each individual lot owner shall be liable for no more than the total monetary amount of liability multiplied by a fraction in which the numerator is the number of lots in the Subdivision owned by a particular lot owner, and the denominator is the total number of lots in the Subdivision. As to any lots owned by more than one person or entity, the liability among co-owners shall be joint and several for the pro-rata obligation of that lot. The application of this Paragraph is best illustrated by the following example. Assume the following parameters: total liability is \$10,000; total number of lots in the Subdivision is 100; Lot 1 is owned by persons A and B; person B also owns Lot 2. Liability is as follows: the Developer, \$10,000; the Association, \$10,000; Lot 1 is \$100.00, joint and several as to A and B, Lot 2 is \$100.00 owed solely by B. Thus, person A's total liability is \$100.00 and person B's is \$200.00. Applying the principle that the County cannot collect more than it is owed, and assuming that the County cannot collect anything from the Developer and the Association, if the County collected the whole \$200.00 from B, then it could not collect the \$100.00 from A. Likewise, if the County collected the \$100.00 from A, then it could only collect \$100.00 from B.

3. Construction: Developer shall construct on that portion of the Property described in Exhibit B attached hereto and incorporated herein by this reference, one detention basin/BMP(s). Developer shall not commence construction of the detention basin/BMP(s) until the El Paso County Planning and Community Development Department (PCD) has approved in writing the plans and specifications for the detention basin/BMP(s) and this Agreement has been signed by all Parties and returned to the PCD. Developer shall complete construction of the detention basin/BMP(s) in substantial compliance with the County-approved plans and specifications for the detention

basin/BMP(s). Failure to meet these requirements shall be a material breach of this Agreement and shall entitle the County to pursue any remedies available to it at law or in equity to enforce the same. Construction of the detention basin/BMP(s) shall be substantially completed within one (1) year (defined as 365 days), which one year period will commence to run on the date the approved plat of this Subdivision is recorded in the records of the El Paso County Clerk and Recorder. Rough grading of the detention basin/BMP(s) must be completed and inspected by the PCD prior to commencing road construction.

In the event construction is not substantially completed within the one (1) year period, then the County may exercise its discretion to complete the project and shall have the right to seek reimbursement from the Developer and the Association and their respective successors and assigns, including individual lot owners in the Subdivision, for its actual costs and expenses incurred in the process of completing construction. The term actual costs and expenses shall be liberally construed in favor of the County, and shall include, but shall not be limited to, labor costs, tool and equipment costs, supply costs, and engineering and design costs, regardless of whether the County uses its own personnel, tools, equipment and supplies, etc. to correct the matter. In the event the County initiates any litigation or engages the services of legal counsel in order to enforce the Provisions arising herein, the County shall be entitled to its damages and costs, including reasonable attorney fees, regardless of whether the County contracts with outside legal counsel or utilizes in-house legal counsel for the same. The scope of liability therefor of the Developer, the Association, and the individual lot owners shall be as set forth in Paragraph Two (2) above.

4. Maintenance: The Developer and the Association agree for themselves and their respective successors and assigns, including individual lot owners within the Subdivision, that they will regularly and routinely inspect, clean and maintain the detention basin/BMP(s) in compliance with the County-reviewed Operation and Maintenance Manual, attached hereto as Exhibit C and incorporated herein by reference, and otherwise keep the same in good repair, all at their own cost and expense. No trees or shrubs that will impair the structural integrity of the detention basin/BMP(s) shall be planted or allowed to grow on the detention basin/BMP(s).

5. Creation of Easement: Developer and the Association hereby grant the County a non-exclusive perpetual easement upon and across that portion of the Property described in Exhibit B. The purpose of the easement is to allow the County to access, inspect, clean, repair and maintain the detention basin/BMP(s); however, the creation of the easement does not expressly or implicitly impose on the County a duty to so inspect, clean, repair or maintain the detention basin/BMP(s).

6. County's Rights and Obligations: Any time the County determines, in the sole exercise of its discretion, that the detention basin/BMP(s) is not properly cleaned, maintained and/or otherwise kept in good repair, the County shall give reasonable notice to the Developer, the Association, and their respective successors and assigns, including the individual lot owners within the Subdivision, that the detention basin/BMP(s) needs to be cleaned, maintained and/or otherwise repaired. The notice shall provide a reasonable time to correct the problems. Should the responsible parties fail to correct the specified problems, the County may enter upon the Property to so correct the specified problems. Notice shall be effective to the above by the County's deposit of the same into the regular United States mail, postage pre-paid. Notwithstanding the foregoing, this Agreement does not expressly or implicitly impose on the County a duty to so inspect, clean, repair or maintain the detention basin/BMP(s).

7. Reimbursement of County's Costs / Covenant Running With the Land: The Developer and the Association agree and covenant, for themselves and their respective successors

and assigns, including individual lot owners within the Subdivision, that they will reimburse the County for its costs and expenses incurred in the process of completing construction of, cleaning, maintaining, and/or repairing the detention basin/BMP(s) pursuant to the provisions of this Agreement; however, the obligation and liability of the Developer hereunder shall only continue until such time as the Developer transfers the entire management and operation of the Association to the individual lot owners within the Subdivision. Notwithstanding the previous sentence, the Association and the individual lot owners within the Subdivision shall always remain obligated and liable hereunder, as per the provisions of Paragraph Two (2) above.

The term “actual costs and expenses” shall be liberally construed in favor of the County, and shall include, but shall not be limited to, labor costs, tools and equipment costs, supply costs, and engineering and design costs, regardless of whether the County uses its own personnel, tools, equipment and supplies, etc. to correct the matter. In the event the County initiates any litigation or engages the services of legal counsel in order to enforce the provisions arising herein, the County shall be entitled to its damages and costs, including reasonable attorney’s fees, regardless of whether the County contracts with outside legal counsel or utilizes in-house legal counsel for the same. The scope of liability therefor of the Developer, the Association, and the individual lot owners shall be as set forth in Paragraph Two (2) above.

8. Contingencies of Subdivision Approval: Developer’s and the Association’s execution of this Agreement is a condition of subdivision approval. Additional conditions of this Agreement include, but are not limited to, the following:

- a. The County’s receipt of a copy of the Articles of Incorporation for the Association, as filed with the Colorado Secretary of State; receipt of the Certificate of Incorporation or other comparable proof for the same from the Colorado Secretary of State; a copy of the Bylaws of the Association; a copy of the organizational minutes or other appropriate document of the Association, properly executed and attested, establishing that the Association has adopted this Agreement as an obligation of the Association; and
- b. A copy of the Covenants of the Subdivision establishing that the Association is obligated to inspect, clean, maintain, and repair the detention basin/BMP(s); that the Association has adopted this Agreement as an obligation of the Association; and that a funding mechanism is in place whereby individual lot owners within the Subdivision pay a regular fee to the Association for, among other matters, the inspection, cleaning, maintenance, and repair of the detention basin/BMP(s); and
- c. A copy of the Covenants of the Subdivision establishing that this Agreement is incorporated into the Covenants, and that such Agreement touches and concerns each and every lot within the Subdivision.

The County shall have the right, in the sole exercise of its discretion, to approve or disapprove any documentation submitted to it under the conditions of this Paragraph, including but not limited to, any separate agreement or amendment, if applicable, identifying any specific maintenance responsibilities not addressed herein. The County’s rejection of any documentation submitted hereunder shall mean that the appropriate condition of this Agreement has not been fulfilled.

9. Distribution to Lot Purchasers: Upon the initial sale of any lot within the Subdivision, prior to closing on such sale, the Developer shall give a copy of this Agreement to the potential Buyer.

10. Agreement Monitored by El Paso County Planning and Community Development Department and/or El Paso County Department of Public Works: Any and all actions and decisions to be made hereunder by the County shall be made by the Director of the El Paso County Planning and Community Development Department and/or the Director of the El Paso County Department of Public Works. Accordingly, any and all documents, submissions, plan approvals, inspections, etc. shall be submitted to and shall be made by the Director of the Planning and Community Development Department and/or the Director of the El Paso County Department of Public Works.

11. Indemnification and Hold Harmless: Developer and the Association agree, for themselves and their respective successors and assigns, including the individual lot owners in the Subdivision, that they will indemnify, defend, and hold the County harmless from any and all loss, costs, damage, injury, liability, claim, lien, demand, action and causes of action whatsoever, whether at law or in equity, arising from or related to their respective intentional or negligent acts, errors or omissions or that of their agents, officers, servants, employees, invitees and licensees in the construction, operation, inspection, cleaning (including analyzing and disposing of any solid or hazardous wastes as defined by State and/or Federal environmental laws and regulations), maintenance, and repair of the detention basin/BMP(s), and such obligation arising under this Paragraph shall be joint and several. Nothing in this Paragraph shall be deemed to waive or otherwise limit the defense available to the County pursuant to the Colorado Governmental Immunity Act, Sections 24-10-101, *et seq.* C.R.S., or as otherwise provided by law. However, the obligation and liability of the Developer hereunder shall only continue until such time as the Developer transfers the entire management and operation of the Association to the individual lot owners within the Subdivision.

12. Severability: In the event any Court of competent jurisdiction declares any part of this Agreement to be unenforceable, such declaration shall not affect the enforceability of the remaining parts of this Agreement.

13. Third Parties: This Agreement does not and shall not be deemed to confer upon or grant to any third party any right to claim damages or to bring any lawsuit, action or other proceeding against either the County, the Developer, the Association, or their respective successors and assigns, including any individual lot owners in the Subdivision, because of any breach hereof or because of any terms, covenants, agreements or conditions contained herein.

14. Solid Waste or Hazardous Materials: Should any refuse from the detention basin/BMP(s) be suspected or identified as solid waste or petroleum products, hazardous substances or hazardous materials (collectively referred to herein as "hazardous materials"), the Developer and the Association shall take all necessary and proper steps to characterize the solid waste or hazardous materials and properly dispose of it in accordance with applicable State and/or Federal environmental laws and regulations, including, but not limited to, the following: Solid Wastes Disposal Sites and Facilities Acts, §§ 30-20-100.5 – 30-20-119, C.R.S., Colorado Regulations Pertaining to Solid Waste Disposal Sites and Facilities, 6 C.C.R. 1007-2, *et seq.*, Solid Waste Disposal Act, 42 U.S.C. §§ 6901-6992k, and Federal Solid Waste Regulations 40 CFR Ch. I. The County shall not be responsible or liable for identifying, characterizing, cleaning up, or disposing of such solid waste or hazardous materials. Notwithstanding the previous sentence, should any refuse cleaned up and disposed of by

the County be determined to be solid waste or hazardous materials, the Developer and the Association, but not the County, shall be responsible and liable as the owner, generator, and/or transporter of said solid waste or hazardous materials.

15. Applicable Law and Venue: The laws, rules, and regulations of the State of Colorado and El Paso County shall be applicable in the enforcement, interpretation, and execution of this Agreement, except that Federal law may be applicable regarding solid waste or hazardous materials. Venue shall be in the El Paso County District Court.

IN WITNESS WHEREOF, the Parties affix their signatures below.


Executed this 04 day of August, 2020, by:  
PIKES PEAK HABITAT FOR HUMANITY, INC.

By: [Signature]  
Joseph DesJardin, President

The foregoing instrument was acknowledged before me this 4<sup>th</sup> day of August, 2020, by Joseph DesJardin, President, PIKES PEAK HABITAT FOR HUMANITY, INC.

Witness my hand and official seal.

My commission expires: 02/22/2030

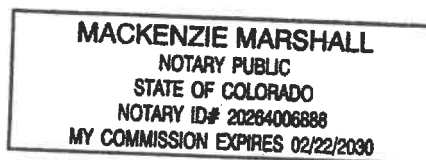

[Signature]  
Notary Public


Executed this 04 day of August, 2020, by:  
RISING MOON COMMUNITY LAND TRUST, LLC, a Colorado limited liability company.

By: [Signature]  
Joe DesJardin, President

The foregoing instrument was acknowledged before me this 4<sup>th</sup> day of August, 2020, by Joe DesJardin, President, RISING MOON COMMUNITY LAND TRUST, LLC, a Colorado limited liability company.

Witness my hand and official seal.

My commission expires: 02/22/2030

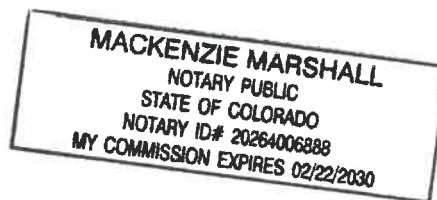

[Signature]  
Notary Public

Executed this \_\_\_\_\_ day of \_\_\_\_\_, 20\_\_\_\_, by:

BOARD OF COUNTY COMMISSIONERS  
OF EL PASO COUNTY, COLORADO

By: \_\_\_\_\_

Christina Prete, Stormwater Operations & Compliance Manager  
Engineering Division, Department of Public Works  
Designee of Joshua Palmer, County Engineer  
Authorized signatory pursuant to Resolution No. 24-145

The foregoing instrument was acknowledged before me this \_\_\_\_\_ day of \_\_\_\_\_, 20\_\_\_\_, by \_\_\_\_\_, Stormwater Operations & Compliance Manager, El Paso County Department of Public Works.

Witness my hand and official seal.

My commission expires: \_\_\_\_\_

\_\_\_\_\_  
Notary Public

Approved as to Content and Form:

Erika Keesch  
Assistant County Attorney

EXHIBIT A

EXHIBIT B

EXHIBIT C

## EXHIBIT A


### **RISING MOON FILING NO. 1**

BASIS OF BEARINGS: ALL BEARING ARE RELATIVE TO THE NORTH LINE OF SECTION 3, TOWNSHIP 15 SOUTH, RANGE 65 WEST OF THE SIXTH PRINCIPAL MERIDIAN, EL PASO COUNTY, COLORADO, IS ASSUMED TO BEAR S89°53'55"W.

A REPLAT OF TRACT B OF MORING SUN I RECORDED IN PLAT BOOK A-4 AT PAGE 179 BEING LOCATED IN THE EAST ½ OF SECTION 3, TOWNSHIP 15 SOUTH, RANGE 65 WEST OF THE SIXTH PRINCIPAL MERIDIAN, COUNTY OF EL PASO, STATE OF COLORADO.

CONTAINING A CALCULATED AREA OF 9.000 ACRES.

**TRACT A, RISING MOON FILING NO. 1**

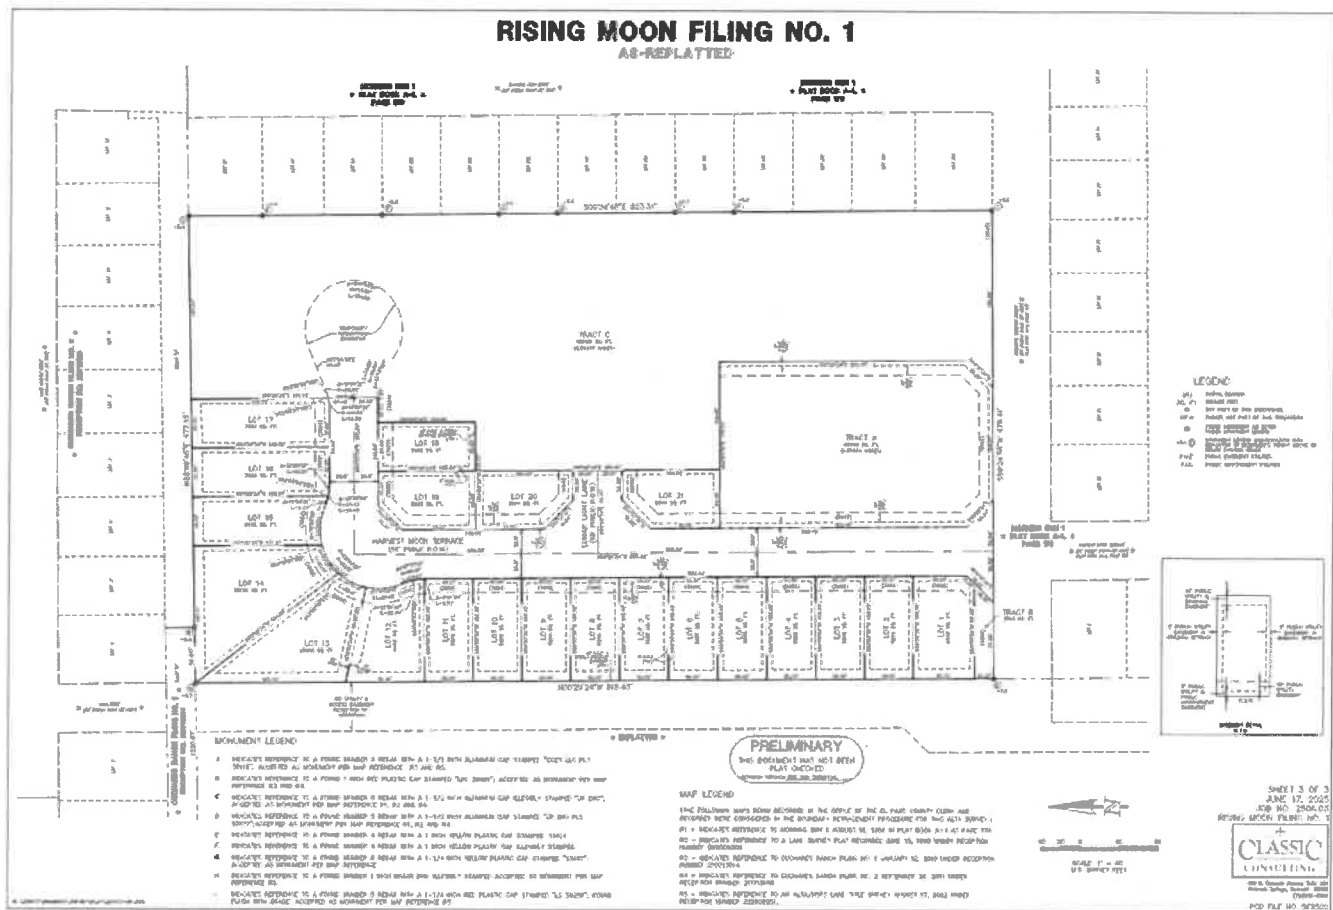

## EXHIBIT C



INNOVATIVE DESIGN. CLASSIC RESULTS.

**Stormwater Best Management Practices  
Inspection and Maintenance Plan (IM Plan)**

**for:**

***RISING MOON  
FILING NO. 1***

***SF2522***

**Prepared for:**

***Pikes Peak Habitat for Humanity, Inc.  
2802 N. Prospect Street  
Colorado Springs, CO 80907  
719-728-0605***

**Prepared by:**

***Classic Consulting Engineers & Surveyors, LLC  
619 N. Cascade Avenue, Suite 200  
Colorado Springs CO 80903***



**Appendix A**  
**General Location and Description of**  
**Stormwater Best Management Practices**

**A. General Site Description**

The overall Rising Moon Filing No. 1 development is a 9.00-acre residential community within a portion of Section 3, Township 15 South, Range 65 West of the 6<sup>th</sup> Principal Meridian in El Paso County, Colorado. The site is generally located west of Shining Star Drive just north of Peaceful Meadow Street. The proposed City of Colorado Springs Meadowworks Residential Community sits directly west of the site. The site is within the Jimmy Camp Creek drainage basin. The overall development includes a total of 41 single-family residences that will be developed as two filings for the Pikes Peak Habitat for Humanity. Filing No. 1 proposes 21 units, public roads, open space and a detention/SWQ pond. Public roadway access will be from Peaceful Meadow Street.

The average soil condition of the entire site and tributary area to the proposed ponds reflects Hydrologic Group "B" (Ustic Torrifluvents) as determined by the "Soil Survey of El Paso County Area," prepared by the National Cooperative Soil Survey (see map in Appendix).

**B. General Stormwater Management Description**

Nearly this entire property is tributary to the proposed on-site Pond which will be constructed with this subdivision.

**C. Stormwater Facilities Site Plan**

Inspection or maintenance personnel may utilize the documents in Appendix F for locating the stormwater facilities within this development.

**D. On-Site/Off-Site Stormwater Management Facilities**

**Permanent Detention / Retention / Storm Water Quality Facilities**

With the construction of this site, the proposed pond will be provided as a permanent private Extended Detention Basin (EDB) PCM Pond 1

**Source Control Best Management Practices**

This site does not include any nonstructural BMPs at this time.

**Stormwater Best Management Practices  
Inspection and Maintenance Plan (IM Plan) Procedures/Forms**

**for:**

***Extended Detention Basin (EDBs)***

Reference:

**This plan is adapted from various maintenance manuals developed in the Colorado Front Range**

**Stormwater Best Management Practices  
Inspection and Maintenance Plan Procedures/Forms for  
Extended Detention Basins (EDBs)**

**Table of Contents**

- I. Compliance with Stormwater Best Management Practices Maintenance Requirements**
- II. Inspection & Maintenance- Annual Reporting**
- III. Preventative Measures to Reduce Maintenance Costs**
- IV. Access and Easements**
- V. Safety**
- VI. Field Inspection Equipment**
- VII. Inspecting Stormwater Best Management Practices**
  - A. Inspection Procedures
  - B. Inspection Report
  - C. Verification of Inspection and Form Submittal
- VIII. Maintaining Stormwater Best Management Practices**
  - A. Maintenance Categories
  - B. Maintenance Personnel
  - C. Maintenance Forms

**Maintenance Agreement** (not included at this time)

**Appendices**

- Appendix A** - Description of Stormwater Best Management Practices (included in IM Plan submittal to County)
- Appendix B** - Standard Operation Procedures (SOP)
- Appendix C** - Inspection Form
- Appendix D** - Maintenance Form
- Appendix E** - Annual Inspection and Maintenance Submittal Form
- Appendix F** - PE Certification (included in IM Plan submittal to County)

**Stormwater Best Management Practices  
Inspection and Maintenance Plan Procedures/Forms for  
Extended Detention Basins (EDBs)**

**I. Compliance with Stormwater Best Management Practices Maintenance Requirements**

All property owners are responsible for ensuring that stormwater best management practices (BMPs) or facilities installed on their property are properly maintained and that they function as designed. In some cases, this maintenance responsibility may be assigned to others through special agreements. The maintenance responsibility for a stormwater facility may be designated on the subdivision plat, the site development plan, and/or within a maintenance agreement for the property. Property owners should be aware of their responsibilities regarding stormwater facility maintenance and need to be familiar with the contents of this Inspection and Maintenance Plan (IM Plan). Maintenance agreement(s) associated with this property are provided.

**II. Inspection & Maintenance – Annual Reporting**

Requirements for the inspection and maintenance of stormwater facilities, as well as reporting requirements are included in this Stormwater Best Management Practices Inspection and Maintenance Plan.

**Verification that the stormwater BMPs have been properly inspected and maintained and submittal of the required Inspection and Maintenance Forms shall be provided to the County on an annual basis. The annual reporting form shall be provided to the County prior to May 31st of each year.**

Copies of the Inspection and Maintenance forms for each of the stormwater BMPs are located in Appendix C and D. A standard annual reporting form is provided in Appendix E. Each form shall be reviewed and submitted by the property owner or property manager to the county Stormwater Team.

**III. Preventative Measures to Reduce Maintenance Costs**

The most effective way to maintain your water quality facility is to prevent the pollutants from entering the facility. Common pollutants include sediment, trash & debris, chemicals, pet wastes, runoff from stored materials, illicit discharges into the storm drainage system and many others. A thoughtful maintenance program will include measures to address these potential contaminants and will save money and time in the long run. Key points to consider in your maintenance program include:

- Educate property owners/residents to be aware of how their actions affect water quality and how they can help reduce maintenance costs.
- Keep properties, streets and gutters, and parking lots free of trash, debris, and lawn clippings.
- Ensure the proper use, storage, and disposal of hazardous wastes and chemicals. Promptly clean up any spilled materials and dispose of properly.

- Plan lawn care to minimize and properly use chemicals and pesticides.
- Sweep paved surfaces and put the sweepings back on the lawn.
- Be aware of automobiles leaking fluids. Use absorbents such as cat litter to soak up drippings – dispose of properly.
- Encourage pet owners to clean up pet wastes.
- Re-vegetate disturbed and bare areas to maintain vegetative stabilization.
- Clean any private storm drainage system components, including inlets, storm sewers, and outfalls.
- Do not store materials outdoors (including landscaping materials) unless properly protected from runoff.

#### **IV. Access and Right to Enter**

All stormwater management facilities located on the site should have both a designated access location and the County has the right to enter for the purpose of inspecting and for maintaining BMPs where the owner has failed to do so.

#### **V. Safety**

Keep safety considerations at the forefront of inspection procedures at all times. Likely hazards should be anticipated and avoided. Never enter a confined space (outlet structure, manhole, etc) without proper training, number of personal, and equipment.

Potentially dangerous (e.g., fuel, chemicals, hazardous materials) substances found in the areas must be referred to emergency services at 911 (non-emergency number is 444-7000). If a toxic or flammable substance is discovered, leave the immediate area and contact the local emergency services at 911.

Vertical drops may be encountered in areas located within and around the facility. Avoid walking on top of retaining walls or other structures that have a significant vertical drop. If a vertical drop is greater than 48" in height, make the appropriate note/comment on the maintenance inspection form.

**If any hazard is found within the facility area that poses an immediate threat to public safety, contact emergency services at 911 immediately.**

#### **VI. Field Inspection Equipment**

It is imperative that the appropriate equipment is taken to the field with the inspector(s). This is to ensure the safety of the inspector and allow the inspections to be performed as efficiently as possible. Below is a list of the equipment that may be necessary to perform the inspections of all Stormwater BMPs:

- Protective clothing and boots.
- Safety equipment (vest, hard hat, confined space entry equipment [if certified to perform confined space entry]).
- Communication equipment.
- IM Plan for the site.

- Clipboard.
- Stormwater BMP Inspection Forms (See Appendix C).
- Manhole Lid Remover
- Shovel.

Some of the items identified above need not be carried by the inspector (manhole lid remover, shovel, and confined space entry equipment), but should be available in the vehicle driven to the site. Specialized equipment may require specific training related to that equipment and should only be used by trained individuals.

## **VII. Inspecting Stormwater BMPs**

The quality of stormwater entering the waters of the state relies heavily on the proper operation and maintenance of permanent BMPs. Stormwater BMPs must be periodically inspected to ensure that they function as designed. The inspection will determine the appropriate maintenance that is required for the facility.

### A. Inspection Procedures

All Stormwater BMPs are required to be inspected a minimum of once per year. Inspections should follow the inspection guidance found in the SOP for the specific type of facility. (Appendix B of this manual).

### B. Inspection Report

The person(s) conducting the inspection activities shall complete the appropriate inspection report for the specific facility. Inspection reports are located in Appendix C. A copy of each inspection form shall be kept by the owner a minimum of 5 years.

The following information explains how to fill out the Inspection Forms:

### General Information

This section identifies the facility location, person conducting the inspection, the date and time the facility was inspected, and approximate days since the last rainfall. Property classification is identified as single-family residential, multi-family residential, commercial, or other.

The reason for the inspection is also identified on the form depending on the nature of the inspection. All facilities must be inspected on an annual basis at a minimum. In addition, all facilities should be inspected after a significant precipitation event to ensure the facility is draining appropriately and to identify any damage that occurred as a result of the increased runoff.

### Inspection Scoring

For each inspection item, a score must be given to identify the urgency of required maintenance. The scoring is as follows:

0 = No deficiencies identified.

- 1 = Monitor – Although maintenance may not be required at this time, a potential problem exists that will most likely need to be addressed in the future. This can include items like minor erosion, concrete cracks/spalling, or minor sediment accumulation. This item should be revisited at the next inspection.
  - 2 = Routine Maintenance Required – Some inspection items can be addressed through the routine maintenance program. This can include items like vegetation management or debris/trash removal.
  - 3 = Immediate Repair Necessary – This item needs immediate attention because failure is imminent or has already occurred. This could include items such as structural failure of a feature (outlet works, forebay, etc), significant erosion, or significant sediment accumulation. This score should be given to an item that can significantly affect the function of the facility.
- N/A This is checked by an item that may not exist in a facility. Not all facilities have all of the features identified on the form (forebay, micro-pool, etc.).

#### Inspection Summary/Additional Comments

Additional explanations to inspection items, and observations about the facility not covered by the form, are recorded in this section.

#### Overall Facility Rating

An overall rating must be given for each facility inspected. The overall facility rating should correspond with the highest score (0, 1, 2, 3) given to any feature on the inspection form.

#### C. Verification of Inspection and Form Submittal

The Stormwater BMP Inspection Form provides a record of inspection of the facility. Inspection Forms for each facility type are provided in Appendix C. Verification of the inspection of the stormwater facilities and the facility inspection form(s) shall be provided to the County Stormwater Team on an annual basis. The verification and the inspection form(s) shall be reviewed and submitted by the property owner or property manager on behalf of the property owner.

Refer to Section II of this Manual regarding the annual reporting of inspections.

### **VIII. Maintaining Stormwater BMPs**

Stormwater BMPs must be properly maintained to ensure that they operate correctly and provide the water quality treatment for which they were designed. Routine maintenance performed on a frequently scheduled basis, can help avoid more costly rehabilitative maintenance that results when facilities are not adequately maintained.

A. Maintenance Categories

Stormwater BMP maintenance programs are separated into three broad categories of work. The categories are separated based upon the magnitude and type of the maintenance activities performed. A description of each category follows:

Routine Work

The majority of this work consists of scheduled mowings and trash and debris pickups for stormwater management facilities during the growing season. This includes items such as the removal of debris/material that may be clogging the outlet structure well screens and trash racks. It also includes activities such as weed control, mosquito treatment, and algae treatment. These activities normally will be performed numerous times during the year. These items can be completed without any prior correspondence with the County Stormwater Team; however, inspection and maintenance forms shall be completed with the information also being reported on the annual report forms that are submitted to the County.

Restoration Work

This work consists of a variety of isolated or small-scale maintenance and work needed to address operational problems. Most of this work can be completed by a small crew, with minor tools, and small equipment. These items do not require prior correspondence with County Stormwater Team, but do require that completed maintenance forms be submitted to County Stormwater Team with the annual report forms.

Rehabilitation Work

This work consists of large-scale maintenance and major improvements needed to address failures within the stormwater BMP. This work requires consultation with County Stormwater Team and may require an engineering design with construction plans to be prepared for review and approval by the County. This work may also require more specialized maintenance equipment, surveying, construction permits or assistance through private contractors and consultants. These items require prior correspondence with County Stormwater Team and require that completed maintenance forms be submitted to County Stormwater Team with the annual report forms.

B. Maintenance Personnel

Maintenance personnel should be qualified to properly maintain stormwater BMPs, especially for restoration or rehabilitation work. Inadequately trained personnel can cause additional problems resulting in additional maintenance costs. Periodic training will be offered by the County Stormwater Team (fees apply).

C. Maintenance Forms

The Stormwater BMP Maintenance Form provides a record of maintenance activities and includes general cost information to assist property owners in budgeting for future maintenance.

Maintenance Forms for each facility type are provided in Appendix D. Maintenance Forms shall be completed by the property owner, management company, or contractor completing the required maintenance items. The form shall then be reviewed by the property owner or an authorized agent of the property owner and submitted on an annual basis by May 31<sup>st</sup>.

Refer to Section II of this Manual regarding the annual reporting of inspections and maintenance activities performed

## Appendix B

# Standard Operation Procedures for Inspection and Maintenance

## Extended Detention Basins (EDBs)

November 2016

## **TABLE OF CONTENTS**

### **EDB-1 Background.**

### **EDB-2 INSPECTING EXTENDED DETENTION BASINS (EDBs)**

#### **EDB-2.1 ACCESS AND EASEMENTS**

#### **EDB-2.2 STORMWATER BEST MANAGEMENT PRACTICE (BMP) LOCATIONS**

#### **EDB-2.3 EXTENDED DETENTION BASIN (EDB) FEATURES**

##### **EDB-2.3.1 Inflow Points**

##### **EDB-2.3.2 Forebay**

##### **EDB-2.3.3 Trickle Channel (Low-Flow)**

##### **EDB-2.3.4 Bottom Stage**

##### **EDB-2.3.5 Micropool**

##### **EDB-2.3.6 Outlet Works**

##### **EDB-2.3.7 Emergency Spillway**

##### **EDB-2.3.8 Upper Stage (Dry Storage)**

##### **EDB-2.3.9 Miscellaneous**

#### **EDB-2.4 INSPECTION FORMS**

### **EDB-3 MAINTAINING EXTENDED DETENTION BASINS (EDBs)**

#### **EDB-3.1 MAINTENANCE PERSONNEL**

#### **EDB-3.2 EQUIPMENT**

#### **EDB-3.3 SAFETY**

#### **EDB-3.4 MAINTENANCE FORMS**

#### **EDB-3.5 MAINTENANCE CATEGORIES AND ACTIVITIES**

#### **EDB-3.6 ROUTINE MAINTENANCE ACTIVITIES**

##### **EDB-3.6.1 Mowing**

##### **EDB-3.6.2 Trash/Debris Removal**

##### **EDB-3.6.3 Outlet Works Cleaning**

##### **EDB-3.6.4 Weed Control**

##### **EDB-3.6.5 Mosquito/Algae Treatment**

#### **EDB-3.7 RESTORATION MAINTENANCE TIES**

##### **EDB-3.7.1 Sediment Removal**

##### **EDB-3.7.2 Erosion Repair**

##### **EDB-3.7.3 Vegetation Removal/Tree Thinning**

##### **EDB-3.7.4 Clearing Drains/Jet-Vac**

#### **EDB-3.8 REHABILITATION MAINTENANCE ACTIVITIES**

##### **EDB-3.8.1 Major Sediment Removal**

##### **EDB-3.8.2 Major Erosion Repair**

##### **EDB-3.8.3 Structural Repair**

## **EDB-1 BACKGROUND**

Extended Detention Basins (EDBs) are one of the most common types of Stormwater BMPs utilized within the Front Range of Colorado. An EDB is a sedimentation basin designed to “extend” the runoff detention time, but to drain completely dry sometime after stormwater runoff ends. The EDB’s drain time for the water quality portion of the facility is typically 40 hours. The basins are considered to be “dry” because the majority of the basin is designed not to have a significant permanent pool of water remaining between runoff events.

EDBs are an adaptation of a detention basin used for flood control, with the primary difference is the addition of forebays, micropools and a slow-release outlet design. Forebays are shallow concrete “pans” located at the inflow point to the basin and are provided to facilitate sediment removal within a contained area prior to releasing into the pond. These forebays collect and briefly hold stormwater runoff resulting in a process called sedimentation, dropping sediment out of the stormwater. The stormwater is then routed from the forebay into the concrete trickle channel and upper basin, the large grassy portion of the basin. The EDB uses a much smaller outlet that extends the emptying time of the more frequently occurring runoff events to facilitate pollutant removal. An EDB should have a small micropool just upstream of the outlet. This micropool is designed to hold a small amount of water to keep sediment and floatables from blocking the outlet orifices.

### **EDB-2 INSPECTING EXTENDED DETENTION BASINS (EDBs) EDB-2.1**

#### **Access and Easements**

Inspection or maintenance personnel may utilize the figures located in Appendix E containing the location(s) of the access points and potential maintenance easements of the EDB(s) within this development.

#### **EDB-2.2 Stormwater Best Management Practice (BMP) Locations**

Inspection or maintenance personnel may utilize the figures located in Appendix E containing the location(s) of the EDB(s) within this development.

#### **EDB-2.3 Extended Detention Basin (EDB) Features**

EDBs have a number of features that are designed to serve a particular function. Many times the proper function of one feature depends on another. For example, if a forebay is not properly maintained, it could negatively affect the performance of a feature downstream (trickle channel, micropool, etc.). Therefore, it is critical that each feature of the EDB is properly inspected and maintained to ensure that the overall facility functions as it was intended. Below is a list and description of the most common features within an EDB and the corresponding maintenance inspection items that can be anticipated:

**Table EDB-1**  
**Typical Inspection & Maintenance Requirements Matrix**

| EDB Features             | Sediment Removal | Mowing/ Weed control | Trash & Debris Removal | Erosion | Overgrown Vegetation Removal | Standing Water (mosquito/ algae control) | Structure Repair |
|--------------------------|------------------|----------------------|------------------------|---------|------------------------------|------------------------------------------|------------------|
| Inflow Points (outfalls) | X                |                      | X                      | X       | X                            |                                          | X                |
| Forebay                  | X                |                      | X                      |         |                              | X                                        | X                |
| Low-flow channel         | X                |                      | X                      | X       | X                            |                                          | X                |
| Bottom Stage             | X                | X                    | X                      | X       | X                            | X                                        |                  |
| Micropool                | X                |                      | X                      |         | X                            | X                                        | X                |
| Outlet Works             | X                |                      | X                      |         |                              | X                                        | X                |
| Emergency Spillway       |                  |                      | X                      | X       | X                            |                                          | X                |
| Upper Stage              |                  | X                    | X                      | X       | X                            |                                          |                  |
| Embankment               |                  | X                    | X                      | X       | X                            |                                          |                  |

#### EDB-2.3.1 Inflow Points

Inflow Points or Outfalls into EDBs are the point source of the stormwater discharge into the facility. An inflow point is commonly a storm sewer pipe with a flared end section that discharges into the EDB. In some instances, an inflow point could be a drainage channel or ditch that flows into the facility.

An energy dissipater (riprap or hard armor protection) is typically immediately downstream of the discharge point into the EDB to protect from erosion. In some cases, the storm sewer outfall can have a toe-wall or cut-off wall immediately below the structure to prevent undercutting of the outfall from erosion.

*The typical maintenance items that are found with inflow points are as follows:*

*a. Riprap Displaced* – Many times, because the repeated impact/force of water, the riprap can shift and settle. If any portion of the riprap apron appears to have settled, soil is present between the riprap, or the riprap has shifted, maintenance may be required to ensure future erosion is prevented.

*b. Erosion Present/Outfall Undercut* – In some situations, the energy dissipater may not have been sized, constructed, or maintained appropriately and erosion has occurred. Any erosion within the vicinity of the inflow point will require maintenance to prevent damage to the structure(s) and sediment transport within the facility.

*c. Sediment Accumulation* – Because of the turbulence in the water created by the energy dissipater, sediment often deposits immediately downstream of the inflow point. To prevent a loss in hydraulic performance of the upstream infrastructure, sediment that accumulates in this area must be removed in a timely manner.

*d. Structural Damage* – Structural damage can occur at any time during the life of the facility. Typically, for an inflow, the structural damage occurs to the pipe flared end section (concrete or steel). Structural damage can lead to additional operating problems with the facility, including loss of hydraulic performance.

*e. Woody Growth/Weeds Present* – Undesirable vegetation can grow in and around the inflow area to an EDB that can significantly affect the performance of the drainage facilities discharging into the facility. This type of vegetation includes trees (typically cottonwoods) and dense areas of shrubs (willows). If woody vegetation is not routinely mowed/removed, the growth can cause debris/sediment to accumulate, resulting in blockage of the discharge. Also, tree roots can cause damage to the structural components of the inflow. Routine maintenance is essential for trees (removing a small tree/sapling is much cheaper and “quieter” than a mature tree). In addition, noxious weeds growing in the facility can result in the loss of desirable native vegetation and impact adjacent open spaces/land.

#### EDB-2.3.2 Forebay

A forebay is a solid surface (pad), typically constructed of concrete, immediately downstream of the inflow point. The forebay is designed to capture larger particles and trash to prevent them from entering the main portion of the EDB. The solid surface is designed to facilitate mechanical sediment removal (skid steer). The forebay typically includes a small diameter discharge pipe or v-notch weir on the downstream end and designed to drain the forebay in a specified period of time to promote sedimentation. The forebays vary in size and depth depending on the design and site constraints.

*The typical maintenance items that are found with forebays are as follows:*

*a. Sediment/Debris Accumulation* – Because this feature of the EDB is designed to provide the initial sedimentation, debris and sediment frequently accumulate in this area. If the sediment and debris is not removed from the forebay on a regular basis, it can significantly affect the function of other features within the EDB. Routine sediment removal from the forebay can **significantly** reduce the need for dredging of the main portion of the EDB using specialized equipment (long reach excavators). Routine removal of sediment from the forebay can **substantially** decrease the long-term sediment removal costs of an EDB.

*b. Concrete Cracking/Failing* – The forebay is primarily constructed of concrete, which cracks, spalls, and settles. Damage to the forebay can result in decreased performance and impact maintenance efforts.

*c. Drain Pipe/Weir Clogged* – Many times the drainpipe or weir can be clogged with debris, and prevent the forebay from draining properly. If standing water is present in the forebay (and there is not a base flow), the forebay is most likely not draining properly. This can result in a decrease in performance and create potential nuisances with stagnant water (mosquitoes).

*d. Weir/Drain Pipe Damaged* – Routine maintenance activities, vandalism, or age may cause the weir or drain pipe in the forebay to become damaged. Weirs are typically constructed of concrete, which cracks and spalls. The drainpipe is typically smaller in diameter and constructed with plastic, which can fracture.

#### EDB-2.3.3 Trickle Channel (Low-Flow)

The trickle channel conveys stormwater from the forebay to the micro-pool of the EDB. The trickle channel is typically made of concrete. However, grass lined (riprap sides protected) is also common and can provide for an additional means of water quality within the EDB. The trickle channel is typically 6-9 inches in depth and can vary in width.

*The typical maintenance items that are found with trickle channels are as follows:*

- a. Sediment/Debris Accumulation* – Trickle channels are typically designed with a relatively flat slope that can promote sedimentation and the collection of debris. Also, if a trickle channel is grass lined it can accumulate sediment and debris at a much quicker rate. Routine removal of accumulated sediment and debris is essential in preventing flows from circumventing the trickle channel and affecting the dry storage portion of the pond.
- b. Concrete/Riprap Damage* – Concrete can crack, spall, and settle and must be repaired to ensure proper function of the trickle channel. Riprap can also shift over time and must be replaced/repared as necessary.
- c. Woody Growth/Weeds Present* – Because of the constant moisture in the area surrounding the trickle channel, woody growth (cottonwoods/willows) can become a problem. Trees and dense shrub type vegetation can affect the capacity of the trickle channel and can allow flows to circumvent the feature.
- d. Erosion Outside of Channel* – In larger precipitation events, the trickle channel capacity will likely be exceeded. This can result in erosion immediately adjacent to the trickle channel and must be repaired to prevent further damage to the structural components of the EDB.

#### EDB-2.3.4 Bottom Stage

The bottom stage is at least 1.0 to 2.0 feet deeper than the upper stage and is located in front of the outlet works structure. The bottom stage is designed to store the smaller runoff events, assists in keeping the majority of the basin bottom dry resulting in easier maintenance operations, and enhances the facilities pollutant removal capabilities. This area of the EDB may develop wetland vegetation.

*The typical maintenance items that are found with the bottom stage are as follows:*

- a. Sediment/Debris Accumulation* – The micro-pool can frequently accumulate sediment and debris. This material must be removed to maintain pond volume and proper function of the outlet structure.
- b. Woody Growth/Weeds Present* - Because of the constant moisture in the soil surrounding the micro-pool, woody growth (cottonwoods/willows) can create operational problems for the EDB. If woody vegetation is not routinely mowed/removed, the growth can cause debris/sediment to accumulate outside of the micro-pool, which can cause problems with other EDB features. Also, tree roots can cause damage to the structural components of the outlet works. Routine management is essential for trees (removing a small tree/sapling is much cheaper and “quieter” than a mature tree).
- c. Bank Erosion* – The micro-pool is usually a couple feet deeper than the other areas of the ponds. Erosion can be caused by water dropping into the micro-pool if adequate protection/armor is not present. Erosion in this area must be mitigated to prevent sediment transport and other EDB feature damage.
- d. Mosquitoes/Algae Treatment* – Nuisance created by stagnant water can result from improper maintenance/treatment of the micro-pool. Mosquito larvae can be laid by adult mosquitoes within the permanent pool. Also, aquatic vegetation that grows in shallow pools of water can

decompose causing foul odors. Chemical/mechanical treatment of the micro-pool may be necessary to reduce these impacts to adjacent homeowners.

*e. Petroleum/Chemical Sheen* – Many indicators of illicit discharges into the storm sewer systems will be present in the micro-pool area of the EDB. These indicators can include sheens, odors, discolored soil, and dead vegetation. If it is suspected that an illicit discharge has occurred, contact the supervisor immediately. Proper removal/mitigation of contaminated soils and water in the EDB is necessary to minimize any environmental impacts downstream.

#### EDB-2.3.5 Micro-pool

The micro-pool is a concrete or grouted boulder walled structure directly in front of the outlet works. At a minimum, the micropool is 2.5 feet deep and is designed to hold water. The micro-pool is critical in the proper function of the EDB; it allows suspended sediment to be deposited at the bottom of the micro-pool and prevents these sediments from being deposited in front of the outlet works causing clogging of the outlet structure, which results in marshy areas within the top and bottom stages.

*The typical maintenance items that are found with micro-pools are as follows:*

*a. Sediment/Debris Accumulation* – The micro-pool can frequently accumulate sediment and debris. This material must be removed to maintain pond volume and proper function of the outlet structure.

*b. Woody Growth/Weeds Present* - Because of the constant moisture in the soil surrounding the micro-pool, woody growth (cottonwoods/willows) can create operational problems for the EDB. If woody vegetation is not routinely mowed/removed, the growth can cause debris/sediment to accumulate outside of the micro-pool, which can cause problems with other EDB features. Also, tree roots can cause damage to the structural components of

the outlet works. Routine management is essential for trees (removing a small tree/sapling is much cheaper and “quieter” than a mature tree).

*c. Mosquitoes/Algae Treatment* – Nuisance created by stagnant water can result from improper maintenance/treatment of the micro-pool. Mosquito larvae can be laid by adult mosquitoes within the permanent pool. Also, aquatic vegetation that grows in shallow pools of water can decompose causing foul odors. Chemical/mechanical treatment of the micro-pool may be necessary to reduce these impacts to adjacent homeowners.

*d. Petroleum/Chemical Sheen* – Many indicators of illicit discharges into the storm sewer systems will be present in the micro-pool area of the EDB. These indicators can include sheens, odors, discolored soil, and dead vegetation. If it is suspected that an illicit discharge has occurred, contact the supervisor immediately. Proper removal/mitigation of contaminated soils and water in the EDB is necessary to minimize any environmental impacts downstream.

#### EDB-2.3.6 Outlet Works

The outlet works is the feature that drains the EDB in specified quantities and periods of time. The outlet works is typically constructed of reinforced concrete into the embankment of the EDB. The

concrete structure typically has steel orifice plates anchored/embedded into it to control stormwater release rates. The larger openings (flood control) on the outlet structure typically have trash racks over them to prevent clogging. The water quality orifice plate (smaller diameter holes) will typically have a well screen covering it to prevent smaller materials from clogging it. The outlet structure is the single most important feature in the EDB operation. Proper inspection and maintenance of the outlet works is essential in ensuring the long-term operation of the EDB.

*The typical maintenance items that are found with the outlet works are as follows:*

*a. Trash Rack/Well Screen Clogged* – Floatable material that enters the EDB will most likely make its way to the outlet structure. This material is trapped against the trash racks and well screens on the outlet structure (which is why they are there). This material must be removed on a routine basis to ensure the outlet structure drains in the specified design period.

*b. Structural Damage* - The outlet structure is primarily constructed of concrete, which can crack, spall, and settle. The steel trash racks and well screens are also susceptible to damage.

*c. Orifice Plate Missing/Not Secure* – Many times residents, property owners, or maintenance personnel will remove or loosen orifice plates if they believe the pond is not draining properly. Any modification to the orifice plate(s) will significantly affect the designed discharge rates for water quality and/or flood control. Modification of the orifice plates is not allowed without approval from the City.

*d. Manhole Access* – Access to the outlet structure is necessary to properly inspect and maintain the facility. If access is difficult or not available to inspect the structure, chances are it will be difficult to maintain as well.

*e. Woody Growth/Weeds Present* - Because of the constant moisture in the soil surrounding the outlet works, woody growth (cottonwoods/willows) can create operational problems for the EDB. If woody vegetation is not routinely mowed/removed, the growth can cause debris/sediment to accumulate around the outlet works, which can cause problems with other EDB features. Also, tree roots can cause damage to the structural components of the outlet works. Routine management is essential for trees (removing a small tree/sapling is much cheaper and “quieter” than a mature tree).

#### EDB-2.3.7 Emergency Spillway

An emergency spillway is typical of all EDBs and designed to serve as the overflow in the event the volume of the pond is exceeded. The emergency spillway is typically armored with riprap (or other hard armor) and is sometimes buried with soil. The emergency spillway is typically a weir (notch) in the pond embankment. Proper function of the emergency spillway is essential to ensure flooding does not affect adjacent properties.

*The typical maintenance items that are found with emergency spillways are as follows:*

*a. Riprap Displaced* – As mentioned before, the emergency spillway is typically armored with riprap to provide erosion protection. Over the life of an EDB, the riprap may shift or dislodge due to flow.

*b. Erosion Present* – Although the spillway is typically armored, stormwater flowing through the spillway can cause erosion damage. Erosion must be repaired to ensure the integrity of the basin embankment, and proper function of the spillway.

*c. Woody Growth/Weeds Present* – Management of woody vegetation is essential in the proper long-term function of the spillway. Larger trees or dense shrubs can capture larger debris entering the EDB and reduce the capacity of the spillway.

*d. Obstruction Debris* – The spillway must be cleared of any obstruction (manmade or natural) to ensure the proper design capacity.

#### EDB-2.3.8 Upper Stage (Dry Storage)

The upper stage of the EDB provides the majority of the water quality flood detention volume. This area of the EDB is higher than the micro-pool and typically stays dry, except during storm events. The upper stage is the largest feature/area of the basin. Sometimes, the upper stage can be utilized for park space and other uses in larger EDBs. With proper maintenance of the micro-pool and forebay(s), the upper stage should not experience much sedimentation; however, bottom elevations should be monitored to ensure adequate volume.

*The typical maintenance items that are found with upper stages are as follows:*

*a. Vegetation Sparse* – The upper basin is the most visible part of the EDB, and therefore aesthetics is important. Adequate and properly maintained vegetation can greatly increase the overall appearance and acceptance of the EDB by the public. In addition, vegetation can reduce the potential for erosion and subsequent sediment transport to the other areas of the pond.

*b. Woody Growth/Undesirable Vegetation* – Although some trees and woody vegetation may be acceptable in the upper basin, some thinning of cottonwoods and willows may be necessary. Remember, the basin will have to be dredged to ensure volume, and large trees and shrubs will be difficult to protect during that operation.

*c. Standing Water/Boggy Areas* – Standing water or boggy areas in the upper stage is typically a sign that some other feature in the pond is not functioning properly. Routine maintenance (mowing, trash removal, etc) can be

extremely difficult for the upper stage if the ground is saturated. If this inspection item is checked, make sure you have identified the root cause of the problem.

*d. Sediment Accumulation* – Although other features within the EDB are designed to capture sediment, the upper storage area will collect sediment over time. Excessive amounts of sedimentation will result in a loss of storage volume. It may be more difficult to determine if this area has accumulated sediment without conducting a field survey.

Below is a list of indicators:

1. Ground adjacent to the trickle channel appears to be several inches higher than concrete/riprap
2. Standing water or boggy areas in upper stage
3. Uneven grades or mounds
4. Micro-pool or Forebay has excessive amounts of sediment

*e. Erosion (banks and bottom)* – The bottom grades of the dry storage are typically flat enough that erosion should not occur. However, inadequate vegetative cover may result in erosion of the upper stage. Erosion that occurs in the upper stage can result in increased dredging/maintenance of the micro-pool.

*f. Trash/Debris* – Trash and debris can accumulate in the upper area after large events, or from illegal dumping. Over time, this material can accumulate and clog the EDB outlet works.

*g. Maintenance Access* – Most EDBs typically have a gravel/concrete maintenance access path to either the upper stage or forebay. This access path should be inspected to ensure the surface is still drivable. Some of the smaller EDBs may have 12' wide gravel maintenance access paths with adequate linear and 2% cross slope.

#### EDB-2.3.9 Miscellaneous

There are a variety of inspection/maintenance issues that may not be attributed to a single feature within the EDB. This category on the inspection form is for maintenance items that are commonly found in the EDB, but may not be attributed to an individual feature.

*a. Access* – Access needs to be maintained.

*b. Graffiti/Vandalism* – Damage to the EDB infrastructure can be caused by vandals. If criminal mischief is evident, the inspector should forward this information to the local enforcement agency.

*c. Public Hazards* – Public hazards include items such as vertical drops of greater than 4-feet, containers of unknown/suspicious substances, exposed metal/jagged concrete on structures. **If any hazard is found within the facility area that poses an immediate threat to public safety, contact the local emergency services at 911 immediately!**

*d. Burrowing Animals/Pests* – Prairie dogs and other burrowing rodents may cause damage to the EDB features and negatively affect the vegetation within the EDB.

*e. Other* – Any miscellaneous inspection/maintenance items not contained on the form should be entered here.

#### EDB-2.4 **Inspection Forms**

EDB Inspection forms are located in Appendix C. Inspection forms shall be completed by the person(s) conducting the inspection activities. Each form shall be reviewed and submitted by the property owner or property manager to the El Paso County Stormwater Inspections Team per the requirements of the Inspection and Maintenance Plan. These inspection forms shall be kept a minimum of 5 years and made available to the El Paso County Stormwater Team upon request.

## **EDB-3 MAINTAINING EXTENDED DETENTION BASINS (EDBs) EDB-3.1**

### **Maintenance Personnel**

Maintenance personnel must be qualified to properly maintain EDBs. Inadequately trained personnel can cause additional problems resulting in additional maintenance costs.

### **EDB-3.2 Equipment**

It is imperative that the appropriate equipment and tools are taken to the field with the operations crew. The types of equipment/tools will vary depending on the task at hand. Below is a list of tools, equipment, and material(s) that may be necessary to perform maintenance on an EDB:

- 1.) Loppers/Tree Trimming Tools
- 2.) Mowing Tractors
- 3.) Trimmers (extra string)
- 4.) Shovels
- 5.) Rakes
- 6.) All Surface Vehicle (ASVs)
- 7.) Skid Steer
- 8.) Back Hoe
- 9.) Track Hoe/Long Reach Excavator
- 10.) Dump Truck
- 11.) Jet-Vac Machine
- 12.) Engineers Level (laser)
- 13.) Riprap (Minimum - Type M)
- 14.) Filter Fabric
- 15.) Erosion Control Blanket(s)
- 16.) Seed Mix (Native Mix)
- 17.) Illicit Discharge Cleanup Kits
- 18.) Trash Bags
- 19.) Tools (wrenches, screw drivers, hammers, etc)
- 20.) Chain Saw
- 21.) Confined Space Entry Equipment
- 22.) Approved Inspection and Maintenance Plan

Some of the items identified above may not be needed for every maintenance operation. However, this equipment should be available to the maintenance operations crews should the need arise.

### **EDB-3.3 Safety**

Vertical drops may be encountered in areas located within and around the facility. Avoid walking on top of retaining walls or other structures that have a significant vertical drop. If a vertical drop is identified within the EDB that is greater than 48" in height, make the appropriate note/comment on the maintenance inspection form.

### **EDB-3.4 Maintenance Forms**

The EDB Maintenance Form provides a record of each maintenance operation performed by maintenance contractors. The EDB Maintenance Form shall be filled out in the field after the completion of the maintenance operation. Each form shall be reviewed and submitted by the property owner or property manager to the El Paso County Stormwater Team per the requirements of the Inspection and Maintenance Plan. The EDB Maintenance form is located in Appendix D.

### **EDB-3.5 Maintenance Categories and Activities**

A typical EDB Maintenance Program will consist of three broad categories of work: Routine, Restoration (minor), and Rehabilitation (major). Within each category of work, a variety of maintenance activities can be performed on an EDB. A maintenance activity can be specific to each feature within the EDB, or general to the overall facility. This section of the SOP explains each of the categories and briefly describes the typical maintenance activities for an EDB.

A variety of maintenance activities are typical of EDBs. The maintenance activities range in magnitude from routine trash pickup to the reconstruction of drainage infrastructure. Below is a description of each maintenance activity, the objectives, and frequency of actions:

### **EDB-3.6 Routine Maintenance Activities**

The majority of this work consists of regularly scheduled mowing and trash and debris pickups for stormwater management facilities during the growing season. This includes items such as the removal of debris/material that may be clogging the outlet structure well screens and trash racks. It also includes activities such as weed control, mosquito treatment, and algae treatment. These activities normally will be performed numerous times during the year. These items can be completed without any prior correspondence with the El Paso County Stormwater Team; however, completed inspection and maintenance forms shall be submitted to the El Paso County Stormwater Team for each inspection and maintenance activity.

The Maintenance Activities are summarized below, and further described in the following sections.

**TABLE – EDB-2****Summary of Routine Maintenance Activities**

| <b>Maintenance Activity</b>  | <b>Minimum Frequency</b>                                        | <b>Look for:</b>                         | <b>Maintenance Action</b>                                                        |
|------------------------------|-----------------------------------------------------------------|------------------------------------------|----------------------------------------------------------------------------------|
| <b>Mowing</b>                | Twice annually                                                  | Excessive grass height/aesthetics        | Mow grass to a height of 4" to 6"                                                |
| <b>Trash/Debris Removal</b>  | Twice annually                                                  | Trash & debris in EDB                    | Remove and dispose of trash and debris                                           |
| <b>Outlet Works Cleaning</b> | As needed - after significant rain events – twice annually min. | Clogged outlet structure; ponding water  | Remove and dispose of debris/trash/sediment to allow outlet to function properly |
| <b>Weed control</b>          | Minimum twice annually                                          | Noxious weeds; Unwanted vegetation       | Treat w/ herbicide or hand pull; Consult the local weed specialist               |
| <b>Mosquito Treatment</b>    | As needed                                                       | Standing water/mosquito habitat          | Treat w/ EPA approved chemicals                                                  |
| <b>Algae Treatment</b>       | As needed                                                       | Standing water/ Algal growth/green color | Treat w/ EPA approved chemicals                                                  |

**EDB-3.6.1 Mowing**

Occasional mowing is necessary to limit unwanted vegetation and to improve the overall appearance of the EDB. Native vegetation should be mowed to a height of 4-to-6 inches tall. Grass clippings should be collected and disposed of properly.

*Frequency* – Routine - Minimum of twice annually or depending on aesthetics.

**EDB-3.6.2 Trash/Debris Removal**

Trash and debris must be removed from the entire EDB area to minimize outlet clogging and to improve aesthetics. This activity must be performed prior to mowing operations.

*Frequency* – Routine – Prior to mowing operations and minimum of twice annually.

**EDB-3.6.3 Outlet Works Cleaning**

Debris and other materials can clog the outlet work's well screen, orifice plate(s) and trash rack. This activity must be performed anytime other maintenance activities are conducted to ensure proper operation.

*Frequency* - Routine – After significant rainfall event or concurrently with other maintenance activities.

**EDB-3.6.4 Weed Control**

Noxious weeds and other unwanted vegetation must be treated as needed throughout the EDB. This activity can be performed either through mechanical means (mowing/pulling) or with herbicide. Consultation with the local Weed Inspector is highly recommended prior to the use of herbicide.

*Frequency* – Routine – As needed based on inspection.

#### EDB-3.6.5 Mosquito/Algae Treatment

Treatment of permanent pools is necessary to control mosquitoes and undesirable aquatic vegetation that can create nuisances. Only EPA approved chemicals/materials can be used in areas that are warranted.

*Frequency* – As needed.

### EDB- 3.7 Restoration Maintenance Activities

This work consists of a variety of isolated or small-scale maintenance or operational problems. Most of this work can be completed by a small crew, tools, and small equipment. These items do not require prior correspondence with El Paso County Stormwater Team and require completed inspection and maintenance forms to be submitted to El Paso County Stormwater Team for each inspection and maintenance activity.

**Table – EDB-3**  
**Summary of Restoration Maintenance Activities**

| Maintenance Activity                    | Minimum Frequency                     | Look for:                                                          | Maintenance Action                                           |
|-----------------------------------------|---------------------------------------|--------------------------------------------------------------------|--------------------------------------------------------------|
| <b>Sediment Removal</b>                 | As needed; typically every 1 –2 years | Sediment build-up; decrease in pond volume                         | Remove and dispose of sediment                               |
| <b>Erosion Repair</b>                   | As needed, based upon inspection      | Rills/gullies forming on side slopes, trickle channel, other areas | Repair eroded areas<br>Revegetate; address source of erosion |
| <b>Vegetation Removal/Tree Thinning</b> | As needed, based upon inspection      | Large trees/wood vegetation in lower chamber of pond               | Remove vegetation; restore grade and surface                 |
| <b>Drain Cleaning/Jet Vac</b>           | As needed, based upon inspection      | Sediment build-up /non draining system                             | Clean drains; Jet Vac if needed                              |

#### EDB-3.7.1 Sediment Removal

Sediment removal is necessary to maintain the original design volume of the EDB and to ensure proper function of the infrastructure. Regular sediment removal (minor) from the forebay, inflow(s), and trickle channel can significantly reduce the frequency of major sediment removal activities (dredging) in the upper and lower stages. The minor sediment removal activities can typically be addressed with shovels and smaller equipment. Major sediment removal activities will require larger and more specialized equipment. The major sediment activities will also require surveying with an engineer's level, and consultation with the County's Engineering staff to ensure design volumes/grades are achieved.

Stormwater sediments removed from EDBs do not meet the criteria of "hazardous waste". However, these sediments are contaminated with a wide array of organic and inorganic pollutants and handling must be done with care. Sediments from permanent pools must be carefully removed to minimize turbidity, further sedimentation, or other adverse water quality impacts. Sediments should be

transported by motor vehicle only after they are dewatered. All sediments must be taken to a landfill for proper disposal.

Prompt and thorough cleanup is important should a spill occur during transportation.

*Frequency – Nonroutine – As necessary based upon inspections. Sediment removal in the forebay and trickle channel may be necessary as frequently as every 1-2 years.*

#### **EDB-3.7.2 Erosion Repair**

The repair of eroded areas is necessary to ensure the proper function of the EDB, minimize sediment transport, and to reduce potential impacts to other features. Erosion can vary in magnitude from minor repairs to trickle channels, energy dissipaters, and rilling to major gullies in the embankments and spillways. The repair of eroded areas may require the use of excavators, earthmoving equipment, riprap, concrete, erosion control blankets, and turf reinforcement mats. Major erosion repair to the pond embankments, spillways, and adjacent to structures will require consultation with the County's Engineering staff.

*Frequency – Nonroutine – As necessary based upon inspections.*

#### **EDB-3.7.3 Vegetation Removal/Tree Thinning**

Dense stands of woody vegetation (willows, shrubs, etc) or trees can create maintenance problems for the infrastructure within an EDB. Tree roots can damage structures and invade pipes/channels thereby blocking flows. Also, trees growing in the upper and lower stages of the EDB will most likely have to be removed when sediment/dredging operations occur. A small tree is easier to remove than a large tree, therefore, regular removal/thinning is imperative. All trees and woody vegetation that is growing in the bottom of the EDB or near structures (inflows, trickle channels, outlet works, emergency spillways, etc) should be removed. Any trees or woody vegetation in the EDB should be limited to the upper portions of the pond banks.

*Frequency – Nonroutine – As necessary based upon inspections.*

#### **EDB-3.7.4 Clearing Drains/Jet-Vac**

An EDB contains many structures, openings, and pipes that can be frequently clogged with debris. These blockages can result in a decrease of hydraulic capacity and create standing water in areas outside of the micro-pool. Many times the blockage to this infrastructure can be difficult to access and/or clean. Specialized equipment (jet-vac machines) may be necessary to clear debris from these difficult areas.

*Frequency – Nonroutine – As necessary based upon inspections.*

### **EDB-3.8 Rehabilitation Maintenance Activities**

This work consists of larger maintenance/operational problems and failures within the stormwater management facilities. All of this work requires consultation with County's Engineering staff to ensure the proper maintenance is performed. This work requires that the engineering staff review the original design and construction drawings to assess the situation and assign the necessary maintenance. This

work may also require more specialized maintenance equipment, design/details, surveying, or assistance through private contractors and consultants. Any proper permits required for this activity must be obtained.

**Table – EDB-4**  
**Summary of Rehabilitation Maintenance Activities**

| Maintenance Activity          | Minimum Frequency                            | Look for:                                                                                           | Maintenance Action                                                         |
|-------------------------------|----------------------------------------------|-----------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------|
| <b>Major Sediment Removal</b> | As needed – based upon scheduled inspections | Large quantities of sediment; reduced pond capacity                                                 | Remove and dispose of sediment. Repair vegetation as needed                |
| <b>Major Erosion Repair</b>   | As needed – based upon scheduled inspections | Severe erosion including gullies, excessive soil displacement, areas of settlement, holes           | Repair erosion – find cause of problem and address to avoid future erosion |
| <b>Structural Repair</b>      | As needed – based upon scheduled inspections | Deterioration and/or damage to structural components – broken concrete, damaged pipes, outlet works | Structural repair to restore the structure to its original design          |

#### EDB-3.8.1 Major Sediment Removal

Major sediment removal consists of removal of large quantities of sediment or removal of sediment from vegetated areas. Care shall be given when removing large quantities of sediment and sediment deposited in vegetated areas. Large quantities of sediment need to be carefully removed, transported and disposed of. Vegetated areas need special care to ensure design volumes and grades are preserved.

*Frequency – Nonroutine – Repair as needed based upon inspections.*

#### EDB-3.8.2 Major Erosion Repair

Major erosion repair consist of filling and revegetating areas of severe erosion. Determining the cause of the erosion as well as correcting the condition that caused the erosion should also be part of the erosion repair. Care should be given to ensure design grades and volumes are preserved.

*Frequency – Nonroutine – Repair as needed based upon inspections.*

#### EDB-3.8.3 Structural Repair

An EDB includes a variety of structures that can deteriorate or be damaged during the course of routine maintenance. These structures are constructed of steel and concrete that can degrade or be damaged and may need to be repaired or re-constructed from time to time. These structures include items like outlet works, trickle channels, forebays, inflows and other features. In- house operations staff can perform some of the minor structural repairs. Major repairs to structures may require input from a

structural engineer and specialized contractors. Consultation with the County's Engineering staff should take place prior to all structural repairs.

*Frequency* – Nonroutine – Repair as needed based upon inspections.

## Appendix C: Inspection Form

|                                                                                                                                                                                                                                                                                  |                                             |                                       |                               |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------|---------------------------------------|-------------------------------|
|                                                                                                                                                                                                                                                                                  |                                             | <b>EXTENDED DETENTION BASIN (EDB)</b> |                               |
|                                                                                                                                                                                                                                                                                  |                                             | <b>INSPECTION FORM</b>                |                               |
|                                                                                                                                                                                                                                                                                  |                                             | Date: _____                           |                               |
| Subdivision/Business Name: _____                                                                                                                                                                                                                                                 |                                             | Inspector: _____                      |                               |
| Subdivision/Business Address: _____                                                                                                                                                                                                                                              |                                             |                                       |                               |
| Weather: _____                                                                                                                                                                                                                                                                   |                                             |                                       |                               |
| Date of Last Rainfall: _____                                                                                                                                                                                                                                                     |                                             | Amount: _____ Inches                  |                               |
|                                                                                                                                                                                                                                                                                  |                                             |                                       |                               |
| <b>Property Classification:</b> Residential    Multi Family    Commercial    Other: _____<br>(Circle One)                                                                                                                                                                        |                                             |                                       |                               |
| <b>Reason for Inspection:</b> Routine    Complaint    After Significant Rainfall Event<br>(Circle One)                                                                                                                                                                           |                                             |                                       |                               |
| <b>INSPECTION SCORING</b> - For each facility inspection item, insert one of the following scores:<br>0 = No deficiencies identified    2 = Routine maintenance required<br>1 = Monitor (potential for future problem)    3 = Immediate repair necessary<br>N/A = Not applicable |                                             |                                       |                               |
| <b>FEATURES</b>                                                                                                                                                                                                                                                                  |                                             |                                       |                               |
| 1.)                                                                                                                                                                                                                                                                              | <b>Inflow Points</b>                        | 3.)                                   | <b>Emergency Spillway</b>     |
|                                                                                                                                                                                                                                                                                  | Riprap Displaced                            |                                       | Riprap Displaced              |
|                                                                                                                                                                                                                                                                                  | Erosion Present/Outfall Undercut            |                                       | Erosion Present               |
|                                                                                                                                                                                                                                                                                  | Sediment Accumulation                       |                                       | Woody Growth/Weeds Present    |
|                                                                                                                                                                                                                                                                                  | Structural Damage (pipe, end-section, etc.) |                                       | Obstruction/Debris            |
|                                                                                                                                                                                                                                                                                  | Woody Growth/Weeds Present                  |                                       |                               |
|                                                                                                                                                                                                                                                                                  |                                             |                                       |                               |
| 2.)                                                                                                                                                                                                                                                                              | <b>Outlet Works</b>                         | 4.)                                   | <b>Miscellaneous</b>          |
|                                                                                                                                                                                                                                                                                  | Trash Rack Clogged                          |                                       | Encroachment in Easement Area |
|                                                                                                                                                                                                                                                                                  | Structural Damage                           |                                       | Graffiti/Vandalism            |
|                                                                                                                                                                                                                                                                                  | Orifice Holes Missing/Clogged               |                                       | Public Hazards                |
|                                                                                                                                                                                                                                                                                  |                                             |                                       | Burrowing Animals/Pests       |
|                                                                                                                                                                                                                                                                                  |                                             |                                       | Woody Growth/Weeds Present    |
|                                                                                                                                                                                                                                                                                  |                                             |                                       | Other                         |
|                                                                                                                                                                                                                                                                                  |                                             |                                       |                               |
|                                                                                                                                                                                                                                                                                  |                                             |                                       |                               |
| Inspection Summary / Additional Comments: _____                                                                                                                                                                                                                                  |                                             |                                       |                               |
|                                                                                                                                                                                                                                                                                  |                                             |                                       |                               |
| <b>OVERALL FACILITY RATING (Circle One)</b><br>0 = No Deficiencies Identified    2 = Routine Maintenance Required<br>1 = Monitor (potential for future problem exists)    3 = Immediate Repair Necessary                                                                         |                                             |                                       |                               |
| This inspection form shall be kept a minimum of 5 years and made available to the County upon request.                                                                                                                                                                           |                                             |                                       |                               |

## Appendix D: Maintenance Form

|                                                                                                                  |  |                                                |                            |                             |  |
|------------------------------------------------------------------------------------------------------------------|--|------------------------------------------------|----------------------------|-----------------------------|--|
|                                                                                                                  |  | <b>EXTENDED DETENTION BASIN (EDB)</b>          |                            |                             |  |
|                                                                                                                  |  | <b>MAINTENANCE FORM</b>                        |                            |                             |  |
| Subdivision/Business Name:                                                                                       |  |                                                | Completion Date:           |                             |  |
| Subdivision/Business Address:                                                                                    |  |                                                | Contact Name:              |                             |  |
|                                                                                                                  |  |                                                |                            |                             |  |
| <b>Maintenance Category:</b>                                                                                     |  | Routine                                        | Restoration                | Rehabilitation              |  |
| (Circle All That Apply)                                                                                          |  |                                                |                            |                             |  |
|                                                                                                                  |  |                                                |                            |                             |  |
| <b>MAINTENANCE ACTIVITIES PERFORMED</b>                                                                          |  |                                                |                            |                             |  |
|                                                                                                                  |  |                                                |                            |                             |  |
| <b>ROUTINE WORK</b>                                                                                              |  |                                                |                            |                             |  |
|                                                                                                                  |  | MOWING                                         |                            |                             |  |
|                                                                                                                  |  | TRASH/DEBRIS REMOVAL                           |                            |                             |  |
|                                                                                                                  |  | OUTLET WORKS CLEANING (TRASH RACK/WELL SCREEN) |                            |                             |  |
|                                                                                                                  |  | WEED CONTROL (HERBICIDE APPLICATION)           |                            |                             |  |
|                                                                                                                  |  | MOSQUITO TREATMENT                             |                            |                             |  |
|                                                                                                                  |  | ALGAE TREATMENT                                |                            |                             |  |
|                                                                                                                  |  |                                                |                            |                             |  |
| <b>RESTORATION WORK</b>                                                                                          |  |                                                | <b>REHABILITATION WORK</b> |                             |  |
|                                                                                                                  |  |                                                |                            |                             |  |
|                                                                                                                  |  | SEDIMENT REMOVAL                               |                            | SEDIMENT REMOVAL (DREDGING) |  |
|                                                                                                                  |  | FOREBAY                                        |                            | BOTTOM STAGE                |  |
|                                                                                                                  |  | TRICKLE CHANNEL                                |                            | UPPER STAGE                 |  |
|                                                                                                                  |  | INFLOW                                         |                            |                             |  |
|                                                                                                                  |  | EROSION REPAIR                                 |                            | EROSION REPAIR              |  |
|                                                                                                                  |  | INFLOW POINT                                   |                            | OUTLET WORKS                |  |
|                                                                                                                  |  | TRICKLE CHANNEL                                |                            | UPPER STAGE                 |  |
|                                                                                                                  |  | VEGETATION REMOVAL/TREE THINNING               |                            | BOTTOM STAGE                |  |
|                                                                                                                  |  | INFLOW(S)                                      |                            | SPILLWAY                    |  |
|                                                                                                                  |  | TRICKLE CHANNEL                                |                            | STRUCTURAL REPAIR           |  |
|                                                                                                                  |  | UPPER STAGE                                    |                            | INFLOW                      |  |
|                                                                                                                  |  | BOTTOM STAGE                                   |                            | OUTLET WORKS                |  |
|                                                                                                                  |  | REVEGETATION                                   |                            | FOREBAY                     |  |
|                                                                                                                  |  | JET-VAC/CLEARING DRAINS                        |                            | TRICKLE CHANNEL             |  |
|                                                                                                                  |  | FOREBAY                                        |                            |                             |  |
|                                                                                                                  |  | OUTLET WORKS                                   |                            | OTHER                       |  |
|                                                                                                                  |  | INFLOWS                                        |                            |                             |  |
|                                                                                                                  |  |                                                |                            |                             |  |
| ESTIMATED TOTAL MANHOURS:                                                                                        |  |                                                |                            |                             |  |
|                                                                                                                  |  |                                                |                            |                             |  |
| COSTS INCURRED (include description of costs):                                                                   |  |                                                |                            |                             |  |
|                                                                                                                  |  |                                                |                            |                             |  |
| EQUIPMENT/MATERIAL USED (include hours of equipment usage and quantity of material used):                        |  |                                                |                            |                             |  |
|                                                                                                                  |  |                                                |                            |                             |  |
| COMMENTS/ADDITIONAL INFO:                                                                                        |  |                                                |                            |                             |  |
| This Maintenance Activity Form shall be kept a minimum of 5 years and made available to the County upon request. |  |                                                |                            |                             |  |

## Appendix E: Annual Inspection and Maintenance Submittal Form

### Annual Inspection and Maintenance Reporting Form for Stormwater BMPs

Date: \_\_\_\_\_

Re: **Certification of Inspection and Maintenance; Submittal of forms**

Property/Subdivision Name: \_\_\_\_\_

Property Address: \_\_\_\_\_

Contact Name: \_\_\_\_\_

Contact Phone #: \_\_\_\_\_

Contact Email Address: \_\_\_\_\_

I verify that the required stormwater facility inspections and required maintenance have been completed in accordance with the Stormwater BMP Maintenance Agreement and the Inspection and Maintenance Manual associated with the above referenced property.

The required Stormwater Facility Inspection and Maintenance forms are attached to this form.

\_\_\_\_\_  
Name of Party Responsible for Inspection  
& Maintenance

\_\_\_\_\_  
Property Owner

\_\_\_\_\_  
Authorized Signature

\_\_\_\_\_  
Signature

## Appendix F

### Civil Engineer Stormwater Best Management Practice (permanent) Certification Letter

(date)

Attn.:

Gentlemen:

The permanent stormwater Best Management Practices (BMPs) for *(Name of project & Subdivision Name (required) & address)* consist of *(description of the BMPs, e.g., type, WQCV, drainage area, etc.)*. *(Name of Civil Engineering Firm)* has reviewed the attached letter(s) from *(Name of Geotechnical Engineering Firm)* and from *(Name(s) Landscape Architect Firm and/or Other Involved Firms)*, as appropriate. Based upon this information and information gathered during periodic site visits to the project during significant/key phases of the stormwater BMP installation, *(Name of Engineering Firm)* is of the opinion that the stormwater BMPs have been constructed in general compliance with the approved Erosion and Stormwater Quality Control Plan, Construction Plans, and Specifications as filed with the County.

#### **Statement Of Engineer In Responsible Charge:**

I, \_\_\_\_\_ *(print name)*, a registered Professional Engineer in the State of Colorado, in accordance with Sections 5.2 and 5.3 of the Bylaws and Rules of the State Board of Registration for Professional Engineers and Professional Land Surveyors, do hereby certify that I or a person under my responsible charge periodically observed the construction of the above mentioned project. Based on the on-site field observations and review of pertinent documentation, it is my professional opinion that the required permanent BMPs have been installed and are in general compliance with the approved Erosion and Stormwater Quality Control Plan, Construction Plans, and Specifications as filed with the of County. For BMPs with a Water Quality Capture Volume (WQCV), I have attached the post-construction As-Built drawings. The As-Built drawings accurately depict the final installation of the stormwater BMPs and verify the WQCV.

*(Name of Engineer, P.E.)*  
Colorado No. XXXXX  
Here

Seal & Signature of P.E. Goes