

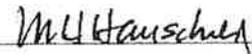
Client: Classic Communities	Entech Job #: 152314.1	Proctor Value Key: M = modified, ASTM D-1557 S = standard, ASTM D-698 T = AASHTO, T-180
Project: Forest Lakes, Filing 2, Phase 2B	Tested By: S. Reardanz	
Subject: Overlot	Report Date: 10-05-2016	

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail <input checked="" type="checkbox"/> = Fail
89	Blue Pearl Court, 400' west and 150' south of northwest corner of lot 34, 6' below grade.	9/20/16	97	95	8.4	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
90	Blue Pearl Court, 300' west and 100' south of northwest corner of lot 34, 5' below grade.	9/20/16	96	95	7.6	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
91	Blue Pearl Court, 250' west and 50' south of northwest corner of lot 34, 5' below grade.	9/20/16	99	95	7.9	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
92	Blue Pearl Court, 150' west and 100' south of northwest corner of lot 34, 4' below grade.	9/21/16	96	95	8.4	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
93	Blue Pearl Court, 200' west and 30' south of northwest corner of lot 34, 3' below grade.	9/21/16	98	95	8.1	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
94	Blue Pearl Court, 350' west and 75' south of northwest corner of lot 34, 3' below grade.	9/21/16	97	95	7.3	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
95	Blue Pearl Court, 450' west and 50' south of northwest corner of lot 34, 4' below grade.	9/21/16	96	95	7.8	SM	M - 130.9 @ 8.2	<input type="checkbox"/>

Comments:

Scope of Observation: PERIODIC; CONTRACTOR'S OR CLIENT'S REPRESENTATIVE ADVISED

All dimensions are approximate. Cl. = Centerline

 <p>ENTECH ENGINEERING, INC. 505 Elkton Drive Colorado Springs, CO 80907 (719) 531-5599 • (719) 531-5238 (fax)</p>	<p>FIELD DENSITY RESULTS</p>	 <p>Mark H. Hauschild, P.E.</p>
--	------------------------------	---

Client: Classic Communities	Entech Job #: 152314.1	Proctor Value Key: M = modified, ASTM D-1557 S = standard, ASTM D-698 T = AASHTO, T-180
Project: Forest Lakes, Filing 2, Phase 2B	Tested By: S. Reardanz	
Subject: Overlot	Report Date: 10-12-2016	

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail <input checked="" type="checkbox"/> = Fail
96	Blue Pearl Court, 200' west and 40' south of northwest corner of lot 34, at grade.	9/27/16	96	95	8.6	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
97	Blue Pearl Court, 300' west and 60' south of northwest corner of lot 34, at grade.	9/27/16	97	95	7.4	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
98	Blue Pearl Court, 400' west and 100' south of northwest corner of lot 34, at grade.	9/27/16	97	95	7.2	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
99	Lake Mist Drive, southeast side of lot 65, 2' below grade.	9/28/16	99	95	8.2	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
100	Lake Mist Drive, eastside of lot 64, 2' below grade.	9/28/16	97	95	7.9	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
101	Lake Mist Drive, eastside of lot 63, 2' below grade.	9/28/16	97	95	7.0	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
102	Lake Mist Drive, northeast side of lot 62, 2' below grade.	9/28/16	96	95	7.1	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
103	Blue Pearl Court, center of lot 32, 3' below grade.	9/29/16	96	95	6.9	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
104	Blue Pearl Court, south center of lot 31, 4' below grade.	9/29/16	97	95	7.3	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
105	Blue Pearl Court, center of lot 30, 4' below grade.	9/29/16	95	95	7.4	SM	M - 130.9 @ 8.2	<input type="checkbox"/>

Comments:

Scope of Observation: PERIODIC; CONTRACTOR'S OR CLIENT'S REPRESENTATIVE ADVISED

All dimensions are approximate. Cl. = Centerline

 <p>ENTECH ENGINEERING, INC. 505 Elkton Drive Colorado Springs, CO 80907 (719) 531-5599 • (719) 531-5238 (fax)</p>	<p>FIELD DENSITY RESULTS</p>	 <p>Mark H. Hauschild, P.E.</p>
--	------------------------------	---

Client: Classic Communities	Entech Job #: 152314.1	Proctor Value Key: M = modified, ASTM D-1557 S = standard, ASTM D-698 T = AASHTO, T-180
Project: Forest Lakes, Filing 2, Phase 2B	Tested By: S. Reardanz	
Subject: Overlot	Report Date: 10-12-2016	

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail <input checked="" type="checkbox"/> = Fail
106	Blue Pearl Court, west central portion of lot 33, 2' below grade.	9/30/16	96	95	8.9	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
107	Blue Pearl Court, center of lot 29, 2' below grade.	9/30/16	97	95	7.1	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
108	Blue Pearl Court, center of lot 30, 2' below grade.	9/30/16	98	95	7.2	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
109	Lake Mist Drive, southeast side of lot 65, at grade.	10/3/16	96	95	6.9	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
110	Lake Mist Drive, eastside of lot 64, at grade.	10/3/16	97	95	7.8	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
111	Lake Mist Drive, eastside of lot 63, at grade.	10/3/16	97	95	7.6	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
112	Lake Mist Drive, northeast side of lot 62, at grade.	10/3/16	96	95	8.0	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
113	Blue Pearl Court, center of lot 32, at grade.	10/5/16	98	95	7.7	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
114	Blue Pearl Court, south central portion of lot 31, at grade.	10/5/16	98	95	8.1	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
115	Blue Pearl Court, center of lot 29, at grade.	10/5/16	96	95	8.2	SM	M - 130.9 @ 8.2	<input type="checkbox"/>

Comments:

Scope of Observation: PERIODIC; CONTRACTOR'S OR CLIENT'S REPRESENTATIVE ADVISED

All dimensions are approximate. Cl. = Centerline

 <p>ENTECH ENGINEERING, INC. 505 Elkton Drive Colorado Springs, CO 80907 (719) 531-5599 • (719) 531-5238 (fax)</p>	<p>FIELD DENSITY RESULTS</p>	 <p>Mark H. Hauschild, P.E.</p>
--	------------------------------	---

Client: Classic Communities	Entech Job #: 152314.1	Proctor Value Key: M = modified, ASTM D-1557 S = standard, ASTM D-698 T = AASHTO, T-180
Project: Forest Lakes, Filing 2, Phase 2B	Tested By: S. Reardanz	
Subject: Overlot	Report Date: 10-12-2016	

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail <input checked="" type="checkbox"/> = Fail
116	Lake Mist Drive, southside of lot 6, 3' below grade.	10/6/16	95	95	6.9	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
117	Lake Mist Drive, southside of lot 9, 3' below grade.	10/6/16	95	95	7.1	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
118	Lake Mist Drive, southside of lot 12, 3' below grade.	10/6/16	97	95	6.5	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
119	Lake Mist Drive, southside of lot 7, 3' below grade.	10/7/16	96	95	7.9	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
120	Lake Mist Drive, southside of lot 8, 3' below grade.	10/7/16	96	95	7.3	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
121	Lake Mist Drive, center of lot 10, 3' below grade.	10/7/16	98	95	8.1	SM	M - 130.9 @ 8.2	<input type="checkbox"/>
122	Lake Mist Drive, center of lot 11, 3' below grade.	10/7/16	99	95	7.5	SM	M - 130.9 @ 8.2	<input type="checkbox"/>

Comments:

Scope of Observation: PERIODIC; CONTRACTOR'S OR CLIENT'S REPRESENTATIVE ADVISED

All dimensions are approximate. Cl. = Centerline

 <p>ENTECH ENGINEERING, INC. 505 Elkton Drive Colorado Springs, CO 80907 (719) 531-5599 • (719) 531-5238 (fax)</p>	<p>FIELD DENSITY RESULTS</p>	 <p>Mark H. Hauschild, P.E.</p>
--	------------------------------	---