

Job No. 181479

May 2, 2022

Landhuis Company
212 N. Wahsatch Ave. Ste 301
Colorado Springs, CO

Re: Cement Treated Subgrade Test Results (Set 80)
The Hills at Lorson Ranch – Areas "E" and "G"
El Paso County, Colorado

Dear Landhuis Company:

RMG – Rocky Mountain Group sampled cement treated subgrade (CTS) soils during placement and compaction during construction of the streets in the above referenced subdivision. Our sampling and testing consisted of preparation of four (4) CTS “pucks” for each sample location. Pucks were prepared by compacting sampled CTS materials in the Standard Proctor mold utilizing Standard Proctor compactive effort (ASTM D-698). The puck below was extruded from the mold and moist-cured in the laboratory five (5) days prior to testing for compressive strength. The remaining pucks will be tested at seven (7) days after placement.

The compressive strength for the puck was determined at five (5) days after placement to verify that the minimum required compressive strength of 125 psi was obtained prior to placement of hot-mix bituminous pavements. The results of our testing are presented in the table below:


| Sample Location | Date Prepared | Puck # | 5-Day Compressive Strength | |
|--|---------------|--------|----------------------------|---|
| | | | Tested Strength, psi | Average 5-Day Compressive Strength, psi |
| Kit Fox Ct., STA 2+50 (Westernmost lane) | 4/26/2022 | 80A | 320 | 320 |

Based upon our test results, the cement treated subgrade that was placed and compacted at the locations tested on April 26, 2022 met the minimum design strength requirements as recommended in *RMG's Pavement Design Report, The Hills at Lorson Ranch – Areas "E" and "G", El Paso County, Colorado, Job No. 181479, last dated November 6, 2021.*

I hope this provides the information you have requested. Should you have questions, please feel free to contact our office.

Cordially,

RMG – Rocky Mountain Group

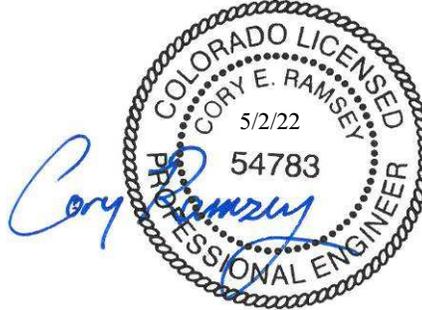

Cory Ramsey, P.E.
Geotechnical Project Manager