



ENTECH
ENGINEERING, INC.

505 ELKTON DRIVE
COLORADO SPRINGS, CO 80907
PHONE (719) 531-5599

**TESTING SUMMARY
HOMESTEAD NORTH AT STERLING RANCH, FILING NO. 2
EL PASO COUNTY, COLORADO**

Prepared for:
SR Land, LLC
20 Boulder Crescent, 1st Floor, Suite 100
Colorado Springs, CO 80903

Attn: Chaz Collins

May 30, 2025

Respectfully Submitted,

ENTECH ENGINEERING, INC.


Joseph C. Goode III, P.E.
Sr. Engineer

Entech Job No. 230423

CW:JCG/

Utility Trench Backfill

Wastewater

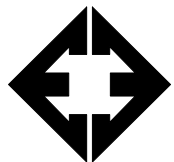


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
1	Main, Station # 11 + 75 on Willey Picket Drive, 6' below grade.	4/19/2023	97	95	7.9	SM	M - 127.1 @ 8.1	☐
2	Main, Station # 11 + 50 on Willey Picket Drive, 4' below grade.	4/19/2023	96	95	8.3	SM	M - 127.1 @ 8.1	☐
3	Main, Station # 11 + 25 on Willey Picket Drive, 2' below grade.	4/19/2023	98	95	8.1	SM	M - 127.1 @ 8.1	☐
4	Main, Station # 11 + 00 on Willey Picket Drive, at grade.	4/20/2023	97	95	7.6	SM	M - 127.1 @ 8.1	☐
5	Manhole 7-1, Station # 12 + 75.05 on Willey Picket Drive, 10' below grade.	4/20/2023	99	95	8.3	SM	M - 127.1 @ 8.1	☐
6	Manhole 7-1, Station # 12 + 75.05 on Willey Picket Drive, 8' below grade.	4/21/2023	98	95	8.1	SM	M - 127.1 @ 8.1	☐
7	Manhole 7-1, Station # 12 + 75.05 on Willey Picket Drive, 6' below grade.	4/21/2023	98	95	7.7	SM	M - 127.1 @ 8.1	☐
8	Main, Station # 14 + 00 on Willey Picket Drive, 10' below grade.	4/21/2023	97	95	7.9	SM	M - 127.1 @ 8.1	☐
9	Main, Station # 13 + 75 on Willey Picket Drive, 8' below grade.	4/21/2023	98	95	8.0	SM	M - 127.1 @ 8.1	☐
10	Manhole 7-1, Station # 12 + 75.05 on Willey Picket Drive, 4' below grade.	4/21/2023	97	95	7.7	SM	M - 127.1 @ 8.1	☐
11	Main, Station # 14 + 25 On Willey Picket Drive, 6' below grade.	4/21/2023	97	95	7.6	SM	M - 127.1 @ 8.1	☐
12	Manhole 7-1, Station # 12 + 75.05 on Willey Picket Drive, 2' below grade.	4/21/2023	96	95	8.3	SM	M - 127.1 @ 8.1	☐

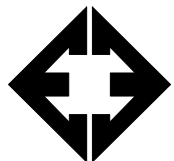


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
13	Manhole 7-1, Station # 12 + 75.05 on Willey Picket Drive, at grade.	4/21/2023	98	95	8.1	SM	M - 127.1 @ 8.1	☐
14	Main, Station # 14 + 50 on Willey Picket Drive, 4' below grade.	4/24/2023	98	95	8.2	SM	M - 127.1 @ 8.1	☐
15	Main, Station # 14 + 25 on Willey Picket Drive, 2' below grade.	4/24/2023	98	95	7.6	SM	M - 127.1 @ 8.1	☐
16	Main, Station # 14 + 00 on Willey Picket Drive, at grade.	4/24/2023	97	95	7.7	SM	M - 127.1 @ 8.1	☐
17	Manhole 7-2, Station # 15 + 83.97 on Willey Picket Drive, 10' below grade.	4/24/2023	99	98	7.1	SM	M - 127.1 @ 8.1	☐
18	Manhole 7-2, Station # 15 + 83.97 on Willey Picket Drive, 8' below grade.	4/24/2023	97	95	8.3	SM	M - 127.1 @ 8.1	☐
19	Manhole 7-2, Station # 15 + 83.97 on Willey Picket Drive, 6' below grade.	4/25/2023	97	95	8.8	SM	M - 127.1 @ 8.1	☐
20	Manhole 7-2, Station # 15 + 83.97 on Willey Picket Drive, 4' below grade.	4/25/2023	98	95	7.6	SM	M - 127.1 @ 8.1	☐
21	Manhole 7-2, Station # 15 + 83.97 on Willey Picket Drive, 2' below grade.	4/25/2023	96	95	8.7	SM	M - 127.1 @ 8.1	☐
22	Manhole 7-2, Station # 15 + 83.97 on Willey Picket Drive, at grade.	4/25/2023	96	95	8.3	SM	M - 127.1 @ 8.1	☐
23	Service, Lot # 11 on Texas Jack Drive, 4' below grade.	4/25/2023	97	95	9.3	SM	M - 127.1 @ 8.1	☐
24	Service, Lot # 15 on Willey Picket Drive, 6' below grade.	4/25/2023	96	95	8.5	SM	M - 127.1 @ 8.1	☐

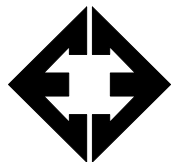


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
25	Service, Lot # 11 on Texas Jack Drive, 2' below grade.	4/25/2023	96	95	9.2	SM	M - 127.1 @ 8.1	☐
26	Service, Lot # 15 on Willey Picket Drive, 4' below grade.	4/25/2023	96	95	7.9	SM	M - 127.1 @ 8.1	☐
27	Service, Lot # 11 on Texas Jack Drive, at grade.	4/25/2023	98	95	9.1	SM	M - 127.1 @ 8.1	☐
28	Service, Lot # 15 on Willey Picket Drive, 2' below grade.	4/25/2023	97	95	8.8	SM	M - 127.1 @ 8.1	☐
29	Service, Lot # 15 on Willey Picket Drive, at grade.	4/25/2023	96	95	8.5	SM	M - 127.1 @ 8.1	☐
30	Service, Lot # 8 on Willey Picket Drive, 4' below grade.	4/25/2023	97	95	7.9	SM	M - 127.1 @ 8.1	☐
31	Service, Lot # 18 on Willey Picket Drive, 4' below grade.	4/25/2023	96	95	7.5	SM	M - 127.1 @ 8.1	☐
32	Service, Lot # 8 on Willey Picket Drive, 2' below grade.	4/25/2023	97	95	7.7	SM	M - 127.1 @ 8.1	☐
33	Service, Lot # 18 on Willey Picket Drive, 2' below grade.	4/25/2023	97	95	7.6	SM	M - 127.1 @ 8.1	☐
34	Service, Lot # 13 on Texas Jack Drive, 4' below grade.	4/27/2023	95	95	9.8	SM	M - 127.1 @ 8.1	☐
35	Service, Lot # 13 on Texas Jack Drive, 2' below grade.	4/27/2023	95	95	10.0	SM	M - 127.1 @ 8.1	☐
36	Service, Lot # 13 on Texas Jack Drive, at grade.	4/27/2023	96	95	9.5	SM	M - 127.1 @ 8.1	☐

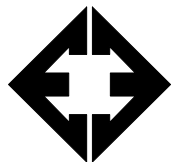


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
37	Service, Lot # 12 on Texas Jack Drive, 4' below grade.	4/27/2023	97	95	9.3	SM	M - 127.1 @ 8.1	☐
38	Service, Lot # 12 on Texas Jack Drive, 2' below grade.	4/27/2023	95	95	8.8	SM	M - 127.1 @ 8.1	☐
39	Service, Lot # 12 on Texas Jack Drive, at grade.	4/27/2023	96	95	8.5	SM	M - 127.1 @ 8.1	☐
40	Service, Lot # 16 on Willey Picket Drive, 4' below grade.	4/28/2023	96	95	9.6	SM	M - 127.1 @ 8.1	☐
41	Service, Lot # 10 on Willey Picket Drive, 4' below grade.	4/28/2023	95	95	9.2	SM	M - 127.1 @ 8.1	☐
42	Service, Lot # 16 on Willey Picket Drive, 2' below grade.	4/28/2023	95	95	9.5	SM	M - 127.1 @ 8.1	☐
43	Service, Lot # 10 on Willey Picket Drive, 2' below grade.	4/28/2023	96	95	9.9	SM	M - 127.1 @ 8.1	☐
44	Service, Lot # 16 on Willey Picket Drive, at grade.	4/28/2023	95	95	9.3	SM	M - 127.1 @ 8.1	☐
45	Service, Lot # 10 on Willey Picket Drive, at grade.	4/28/2023	95	95	9.6	SM	M - 127.1 @ 8.1	☐
46	Service, Lot # 17 on Willey Picket Drive, 6' below grade.	4/28/2023	96	95	9.3	SM	M - 127.1 @ 8.1	☐
47	Service, Lot # 7 on Willey Picket Drive, 6' below grade.	4/28/2023	97	95	8.7	SM	M - 127.1 @ 8.1	☐
48	Service, Lot # 7 on Willey Picket Drive, 4' below grade.	4/28/2023	97	95	9.0	SM	M - 127.1 @ 8.1	☐

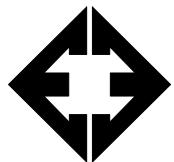


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
49	Service, Lot # 17 on Willey Picket Drive, 4' below grade.	4/28/2023	96	95	8.8	SM	M - 127.1 @ 8.1	☐
50	Service, Lot # 17 on Willey Picket Drive, 2' below grade.	5/1/2023	96	95	8.3	SM	M - 127.1 @ 8.1	☐
51	Service, Lot # 7 on Willey Picket Drive, 2' below grade.	5/1/2023	96	95	7.5	SM	M - 127.1 @ 8.1	☐
52	Service, Lot # 22 on Willey Picket Drive, 6' below grade.	5/1/2023	97	95	7.3	SM	M - 127.1 @ 8.1	☐
53	Service, Lot # 3 on Willey Picket Drive, 6' below grade.	5/1/2023	98	95	8.6	SM	M - 127.1 @ 8.1	☐
54	Service, Lot # 22 on Willey Picket Drive, 4' below grade.	5/1/2023	98	95	8.0	SM	M - 127.1 @ 8.1	☐
55	Service, Lot # 7 on Willey Picket Drive, at grade.	5/1/2023	97	95	7.5	SM	M - 127.1 @ 8.1	☐
56	Service, Lot # 17 on Willey Picket Drive, at grade.	5/1/2023	97	95	7.7	SM	M - 127.1 @ 8.1	☐
57	Service, Lot # 22 on Willey Picket Drive, 2' below grade.	5/1/2023	96	95	7.6	SM	M - 127.1 @ 8.1	☐
58	Service, Lot # 3 on Willey Picket Drive, 4' below grade.	5/1/2023	96	95	8.1	SM	M - 127.1 @ 8.1	☐
59	Service, Lot # 3 on Willey Picket Drive, 2' below grade.	5/1/2023	98	95	7.5	SM	M - 127.1 @ 8.1	☐
60	Main, Station # 25 + 50 on Wheatland Drive, 8' below grade.	5/1/2023	98	95	11.1	SM	M - 122.3 @ 10.4	☐

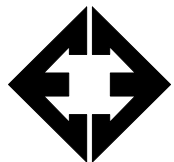


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
61	Main, Station # 25 + 25 on Wheatland Drive, 6' below grade.	5/1/2023	99	95	10.5	SM	M - 122.3 @ 10.4	☐
62	Service, Lot # 24 on Willey Pickett Drive, 6' below grade.	5/2/2023	97	95	7.4	SM	M - 127.1 @ 8.1	☐
63	Service, Lot # 1 on Willey Pickett Drive, 6' below grade.	5/2/2023	96	95	8.0	SM	M - 127.1 @ 8.1	☐
64	Service, Lot # 3 on Willey Pickett Drive, at grade.	5/2/2023	96	95	8.3	SM	M - 127.1 @ 8.1	☐
65	Service, Lot # 22 on Willey Pickett Drive, at grade.	5/2/2023	96	95	7.5	SM	M - 127.1 @ 8.1	☐
66	Service, Lot # 24 on Willey Pickett Drive, 4' below grade.	5/2/2023	96	95	7.6	SM	M - 127.1 @ 8.1	☐
67	Service, Lot # 1 on Willey Pickett Drive, 4' below grade.	5/2/2023	98	95	8.1	SM	M - 127.1 @ 8.1	☐
68	Service, Lot # 20 on Willey Pickett Drive, 6' below grade.	5/2/2023	96	95	7.9	SM	M - 127.1 @ 8.1	☐
69	Service, Lot # 20 on Willey Pickett Drive, 4' below grade.	5/2/2023	97	95	8.2	SM	M - 127.1 @ 8.1	☐
70	Service, Lot # 24 on Willey Pickett Drive, 2' below grade.	5/2/2023	97	95	8.1	SM	M - 127.1 @ 8.1	☐
71	Service, Lot # 1 on Willey Pickett Drive, 2' below grade.	5/2/2023	96	95	8.3	SM	M - 127.1 @ 8.1	☐
72	Service, Lot # 20 on Willey Pickett Drive, 2' below grade.	5/2/2023	97	95	7.9	SM	M - 127.1 @ 8.1	☐

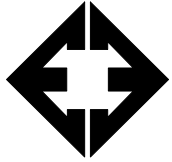


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
73	Main, Station # 25 + 75 on Wheatland Drive, 4' below grade.	5/2/2023	96	95	11.1	SM	M - 122.3 @ 10.4	☐
74	Main, Station # 25 + 35 on Wheatland Drive, 2' below grade.	5/2/2023	98	95	10.6	SM	M - 122.3 @ 10.4	☐
75	Service, Lot # 19 on Willey Pickett Drive, 6' below grade.	5/2/2023	98	95	7.9	SM	M - 127.1 @ 8.1	☐
76	Service, Lot # 19 on Willey Pickett Drive, 4' below grade.	5/2/2023	97	95	8.3	SM	M - 127.1 @ 8.1	☐
77	Service, Lot # 9 on Willey Pickett Drive, 6' below grade.	5/3/2023	95	95	7.6	SM	M - 127.1 @ 8.1	☐
78	Service, Lot # 24 on Willey Pickett Drive, at grade.	5/3/2023	97	95	8.2	SM	M - 127.1 @ 8.1	☐
79	Service, Lot # 1 on Willey Pickett Drive, at grade.	5/3/2023	96	95	7.7	SM	M - 127.1 @ 8.1	☐
80	Service, Lot # 20 on Willey Pickett Drive, at grade.	5/3/2023	97	95	7.9	SM	M - 127.1 @ 8.1	☐
81	Service, Lot # 9 on Willey Pickett Drive, 4' below grade.	5/3/2023	98	95	8.3	SM	M - 127.1 @ 8.1	☐
82	Service, Lot # 19 on Willey Pickett Drive, 2' below grade.	5/3/2023	95	95	8.6	SM	M - 127.1 @ 8.1	☐
83	Service, Lot # 14 on Willey Pickett Drive, 6' below grade.	5/3/2023	97	95	8.4	SM	M - 127.1 @ 8.1	☐
84	Service, Lot # 9 on Willey Pickett Drive, 2' below grade.	5/3/2023	96	95	9.1	SM	M - 127.1 @ 8.1	☐

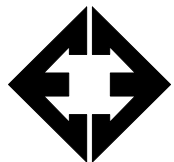


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
85	Service, Lot # 19 on Willey Pickett Drive, at grade.	5/3/2023	97	95	8.7	SM	M - 127.1 @ 8.1	☐
86	Service, Lot # 9 on Willey Pickett Drive, at grade.	5/3/2023	95	95	8.5	SM	M - 127.1 @ 8.1	☐
87	Service, Lot # 14 on Willey Pickett Drive, 4' below grade.	5/3/2023	96	95	9.2	SM	M - 127.1 @ 8.1	☐
88	Service, Lot # 14 on Willey Pickett Drive, 2' below grade.	5/3/2023	96	95	9.3	SM	M - 127.1 @ 8.1	☐
89	Service, Lot # 21 on Willey Pickett Drive, 6' below grade.	5/3/2023	95	95	8.8	SM	M - 127.1 @ 8.1	☐
90	Main, Station # 26 + 00 on Wheatland Drive, at grade.	5/4/2023	96	95	8.7	SM	M - 127.1 @ 8.1	☐
91	Service, Lot # 14 on Willey Pickett Drive, at grade.	5/4/2023	97	95	7.9	SM	M - 127.1 @ 8.1	☐
92	Service, Lot # 21 on Willey Pickett Drive, 4' below grade.	5/4/2023	97	95	7.5	SM	M - 127.1 @ 8.1	☐
93	Service, Lot # 21 on Willey Pickett Drive, 2' below grade.	5/4/2023	99	95	8.8	SM	M - 127.1 @ 8.1	☐
94	Manhole 1-7, Station # 26 + 51.93 on Wheatland Drive, 10' below grade.	5/4/2023	98	95	10.9	SM	M - 122.3 @ 10.4	☐
95	Manhole 1-7, Station # 26 + 51.93 on Wheatland Drive, 8' below grade.	5/4/2023	100	95	11.6	SM	M - 122.3 @ 10.4	☐
96	Service, Lot # 23 on Willey Picket Drive, 6' below grade.	5/4/2023	96	95	8.3	SM	M - 127.1 @ 8.1	☐

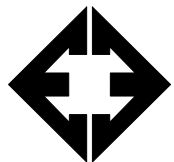


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
97	Service, Lot # 2 on Willey Picket Drive, 6' below grade.	5/4/2023	97	95	8.5	SM	M - 127.1 @ 8.1	☐
98	Service, Lot # 23 on Willey Picket Drive, 4' below grade.	5/4/2023	96	95	8.4	SM	M - 127.1 @ 8.1	☐
99	Service, Lot # 2 on Willey Picket Drive, 4' below grade.	5/4/2023	96	95	9.0	SM	M - 127.1 @ 8.1	☐
100	Service, Lot # 4 on Willey Picket Drive, 7' below grade.	5/4/2023	96	95	7.5	SM	M - 127.1 @ 8.1	☐
101	Service, Lot # 2 on Willey Picket Drive, 2' below grade.	5/4/2023	96	95	8.4	SM	M - 127.1 @ 8.1	☐
102	Service, Lot # 23 on Willey Picket Drive, 2' below grade.	5/4/2023	95	95	7.9	SM	M - 127.1 @ 8.1	☐
103	Service, Lot # 2 on Willey Picket Drive, at grade.	5/4/2023	96	95	7.3	SM	M - 127.1 @ 8.1	☐
104	Service, Lot # 23 on Willey Picket Drive, at grade.	5/4/2023	96	95	8.2	SM	M - 127.1 @ 8.1	☐
105	Service, Lot # 4 on Willey Picket Drive, 5' below grade.	5/4/2023	98	95	7.6	SM	M - 127.1 @ 8.1	☐
106	Service, Lot # 4 on Willey Picket Drive, 3' below grade.	5/4/2023	96	95	7.5	SM	M - 127.1 @ 8.1	☐
107	Service, Lot # 4 on Willey Picket Drive, 1' below grade.	5/5/2023	95	95	7.3	SM	M - 127.1 @ 8.1	☐
108	Service, Lot # 4 on Willey Picket Drive, at grade.	5/5/2023	96	95	7.6	SM	M - 127.1 @ 8.1	☐

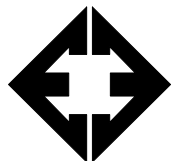


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
109	Manhole 1-7, Station # 26 + 51.93 on Wheatland Drive, 6' below grade.	5/5/2023	96	95	9.6	SM	M - 122.3 @ 10.4	☐
110	Manhole 1-7, Station # 26 + 51.93 on Wheatland Drive, 4' below grade.	5/5/2023	95	95	9.8	SM	M - 122.3 @ 10.4	☐
111	Manhole 1-7, Station # 26 + 51.93 on Wheatland Drive, 2' below grade.	5/5/2023	98	95	9.3	SM	M - 122.3 @ 10.4	☐
112	Manhole 9-1, Station # 1 + 77.11 on Perry Owens Drive, 10' below grade.	5/5/2023	97	95	7.6	SM	M - 127.1 @ 8.1	☐
113	Manhole 9-1, Station # 1 + 77.11 on Perry Owens Drive, 8' below grade.	5/5/2023	96	95	8.0	SM	M - 127.1 @ 8.1	☐
114	Manhole 1-7, Station # 26 + 51.93 on Wheatland Drive, at grade.	5/5/2023	97	95	10.1	SM	M - 122.3 @ 10.4	☐
115	Service, Lot # 26 on Sam Bass Drive, 8' below grade.	5/5/2023	96	95	7.8	SM	M - 127.1 @ 8.1	☐
116	Service, Lot # 31 on Sam Bass Drive, 8' below grade.	5/5/2023	97	95	8.1	SM	M - 127.1 @ 8.1	☐
117	Service, Lot # 26 on Sam Bass Drive, 6' below grade.	5/5/2023	98	95	7.1	SM	M - 127.1 @ 8.1	☐
118	Service, Lot # 31 on Sam Bass Drive, 6' below grade.	5/5/2023	97	95	7.3	SM	M - 127.1 @ 8.1	☐
119	Manhole 9-1, Station # 1 + 77.11 on Perry Owens Drive, 6' below grade.	5/8/2023	97	95	7.6	SM	M - 127.1 @ 8.1	☐
120	Manhole 9-1, Station # 1 + 77.11 on Perry Owens Drive, 4' below grade.	5/8/2023	97	95	7.9	SM	M - 127.1 @ 8.1	☐

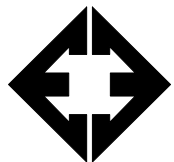


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
121	Service, Lot #26 on Sam Bass Drive, 4' below grade.	5/8/2023	99	95	7.4	SM	M - 127.1 @ 8.1	☐
122	Service, Lot # 31 on Sam Bass Drive, 4' below grade.	5/8/2023	97	95	8.0	SM	M - 127.1 @ 8.1	☐
123	Service, Lot # 26 on Sam Bass Drive, 2' below grade.	5/8/2023	97	95	7.1	SM	M - 127.1 @ 8.1	☐
124	Service, Lot # 31 on Sam Bass Drive, 2' below grade.	5/8/2023	95	95	7.3	SM	M - 127.1 @ 8.1	☐
125	Manhole 9-1, Station # 1 + 71.11 on Perry Owens Drive, 2' below grade.	5/8/2023	95	95	6.7	SM	M - 127.1 @ 8.1	☐
126	Service, Lot # 28 on Sam Bass Drive, 6' below grade.	5/8/2023	97	95	7.8	SM	M - 127.1 @ 8.1	☐
127	Service, Lot # 28 on Sam Bass Drive, 4' below grade.	5/8/2023	98	95	8.3	SM	M - 127.1 @ 8.1	☐
128	Service, Lot # 28 on Sam Bass Drive, 2' below grade.	5/8/2023	98	95	8.3	SM	M - 127.1 @ 8.1	☐
129	Manhole 9-2, Station # 2 + 43.90 on Perry Owens Drive, 10' below grade.	5/8/2023	95	95	7.5	SM	M - 127.1 @ 8.1	☐
130	Manhole 9-2, Station # 2 + 43.90 on Perry Owens Drive, 8' below grade.	5/8/2023	97	95	7.4	SM	M - 127.1 @ 8.1	☐
131	Service, Lot # 26 on Sam Bass Drive, at grade.	5/8/2023	96	95	8.3	SM	M - 127.1 @ 8.1	☐
132	Service, Lot # 31 on Sam Bass Drive, at grade.	5/8/2023	97	95	7.6	SM	M - 127.1 @ 8.1	☐

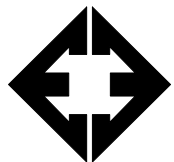


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
133	Service, Lot # 28 on Sam Bass Drive, at grade.	5/8/2023	97	95	8.1	SM	M - 127.1 @ 8.1	☐
134	Manhole 9-1, Station # 1 + 71.11 on Perry Owens Drive, at grade.	5/8/2023	96	95	7.5	SM	M - 127.1 @ 8.1	☐
135	Service, Lot # 25 on Sam Bass Drive, 6' below grade.	5/8/2023	97	95	9.9	SM	M - 122.3 @ 10.4	☐
136	Service, Lot # 32 on Sam Bass Drive, 6' below grade.	5/8/2023	96	95	9.5	SM	M - 122.3 @ 10.4	☐
137	Main, Station # 3 + 75 on Perry Owens Drive, 10' below grade.	5/9/2023	98	95	8.0	SM	M - 127.1 @ 8.1	☐
138	Manhole 9-2, Station # 2 + 43.90 on Perry Owens Drive, 6' below grade.	5/9/2023	96	95	6.8	SM	M - 127.1 @ 8.1	☐
139	Manhole 9-2, Station # 2 + 43.90 on Perry Owens Drive, 4' below grade.	5/9/2023	97	95	7.7	SM	M - 127.1 @ 8.1	☐
140	Manhole 9-2, Station # 2 + 43.90 on Perry Owens Drive, 2' below grade.	5/9/2023	96	95	8.3	SM	M - 127.1 @ 8.1	☐
141	Service, Lot # 25 on Sam Bass Drive, 4' below grade.	5/9/2023	97	95	10.0	SM	M - 122.3 @ 10.4	☐
142	Service, Lot # 32 on Sam Bass Drive, 4' below grade.	5/9/2023	98	95	9.5	SM	M - 122.3 @ 10.4	☐
143	Service, Lot # 25 on Sam Bass Drive, 2' below grade.	5/9/2023	99	95	9.1	SM	M - 122.3 @ 10.4	☐
144	Service, Lot # 32 on Sam Bass Drive, 2' below grade.	5/9/2023	96	95	10.1	SM	M - 122.3 @ 10.4	☐

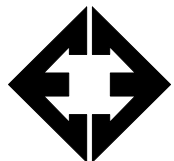


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
145	Main, Station # 3 + 50 on Perry Owens Drive, 8' below grade.	5/9/2023	97	95	8.3	SM	M - 127.1 @ 8.1	☐
146	Main, Station # 3 + 25 on Perry Owens Drive, 6' below grade.	5/9/2023	96	95	7.6	SM	M - 127.1 @ 8.1	☐
147	Service, Lot # 29 on Sam Bass Drive, 7' below grade.	5/9/2023	97	95	9.5	SM	M - 122.3 @ 10.4	☐
148	Service, Lot # 30 on Sam Bass Drive, 7' below grade.	5/9/2023	96	95	9.9	SM	M - 122.3 @ 10.4	☐
149	Manhole 9-2, Station # 2 + 43.90 on Perry Owens Drive, at grade.	5/9/2023	96	95	6.9	SM	M - 127.1 @ 8.1	☐
150	Service, Lot # 25 on Sam Bass Drive, at grade.	5/9/2023	97	95	9.5	SM	M - 122.3 @ 10.4	☐
151	Service, Lot # 32 on Sam Bass Drive, at grade.	5/9/2023	98	95	9.2	SM	M - 122.3 @ 10.4	☐
152	Service, Lot # 29 on Sam Bass Drive, 5' below grade.	5/9/2023	96	95	10.1	SM	M - 122.3 @ 10.4	☐
153	Service, Lot # 30 on Sam Bass Drive, 5' below grade.	5/9/2023	97	95	9.6	SM	M - 122.3 @ 10.4	☐
154	Main, Station # 3 + 50 on Perry Owens Drive, 4' below grade.	5/9/2023	99	95	8.0	SM	M - 127.1 @ 8.1	☐
155	Main, Station # 3 + 00 on Perry Owens Drive, 2' below grade.	5/9/2023	97	95	7.5	SM	M - 127.1 @ 8.1	☐
156	Service, Lot # 29 on Sam Bass Drive, 3' below grade.	5/10/2023	98	95	10.3	SM	M - 122.3 @ 10.4	☐

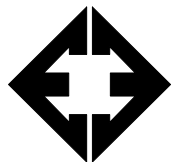


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
157	Service, Lot # 30 on Sam Bass Drive, 3' below grade.	5/10/2023	97	95	10.1	SM	M - 122.3 @ 10.4	☐
158	Main, Station # 3 + 25 on Perry Owens Drive, at grade.	5/10/2023	95	95	7.5	SM	M - 127.1 @ 8.1	☐
159	Manhole 9-3, Station # 4 + 74.20 on Perry Owens Drive, 10' below grade.	5/10/2023	98	95	8.1	SM	M - 127.1 @ 8.1	☐
160	Manhole 9-3, Station # 4 + 74.20 on Perry Owens Drive, 8' below grade.	5/10/2023	97	95	9.2	SM	M - 127.1 @ 8.1	☐
161	Manhole 9-3, Station # 4 + 74.20 on Perry Owens Drive, 6' below grade.	5/10/2023	97	95	8.5	SM	M - 127.1 @ 8.1	☐
162	Service, Lot # 29 on Sam Bass Drive, at grade.	5/10/2023	97	95	11.6	SM	M - 122.3 @ 10.4	☐
163	Service, Lot # 30 on Sam Bass Drive, at grade.	5/10/2023	98	95	10.2	SM	M - 122.3 @ 10.4	☐
164	Service, Lot # 49 on Sam Bass Drive, 6' below grade.	5/10/2023	97	95	8.2	SM	M - 127.1 @ 8.1	☐
165	Service, Lot # 33 on Sam Bass Drive, 6' below grade.	5/10/2023	97	95	9.4	SM	M - 127.1 @ 8.1	☐
166	Service, Lot # 49 on Sam Bass Drive, 4' below grade.	5/10/2023	97	95	8.1	SM	M - 127.1 @ 8.1	☐
167	Service, Lot # 33 on Sam Bass Drive, 4' below grade.	5/10/2023	97	95	8.6	SM	M - 127.1 @ 8.1	☐
168	Service, Lot # 48 on Sam Bass Drive, 6' below grade.	5/10/2023	99	95	8.3	SM	M - 127.1 @ 8.1	☐

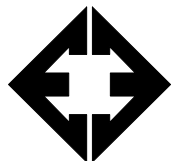


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
169	Service, Lot # 49 on Sam Bass Drive, 2' below grade.	5/10/2023	97	95	8.3	SM	M - 127.1 @ 8.1	☐
170	Service, Lot # 33 on Sam Bass Drive, 2' below grade.	5/10/2023	96	95	9.1	SM	M - 127.1 @ 8.1	☐
171	Service, Lot # 48 on Sam Bass Drive, 4' below grade.	5/10/2023	97	95	8.6	SM	M - 127.1 @ 8.1	☐
172	Service, Lot # 48 on Sam Bass Drive, 2' below grade.	5/10/2023	98	95	8.4	SM	M - 127.1 @ 8.1	☐
173	Service, Lot # 49 on Perry Owens Drive, at grade.	5/15/2023	96	95	7.9	SM	M - 127.1 @ 8.1	☐
174	Service, Lot # 33 on Perry Owens Drive, at grade.	5/15/2023	97	95	8.5	SM	M - 127.1 @ 8.1	☐
175	Service, Lot # 48 on Perry Owens Drive, at grade.	5/18/2023	97	95	8.2	SM	M - 127.1 @ 8.1	☐
176	Manhole 9-3, Station #4 + 74.20 on Perry Owens Drive, at 4' below grade.	5/15/2023	99	95	9.1	SM	M - 127.1 @ 8.1	☐
177	Manhole 9-3, Station #4 + 74.20 on Perry Owens Drive, at 2' below grade.	5/15/2023	97	95	8.6	SM	M - 127.1 @ 8.1	☐
178	Service, Lot #37 on Perry Owens Drive, 6' below grade.	5/15/2023	96	95	8.3	SM	M - 127.1 @ 8.1	☐
179	Service, Lot #46 on Perry Owens Drive, 6' below grade.	5/15/2023	96	95	9.5	SM	M - 127.1 @ 8.1	☐
180	Service, Lot #34 on Perry Owens Drive, 6' below grade.	5/15/2023	97	95	9.2	SM	M - 127.1 @ 8.1	☐

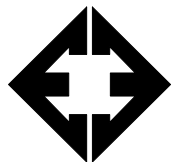


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
181	Service, Lot #37 on Perry Owens Drive, 4' below grade.	5/15/2023	96	95	8.8	SM	M - 127.1 @ 8.1	☐
182	Service, Lot #46 on Perry Owens Drive, 4' below grade.	5/15/2023	98	95	9.4	SM	M - 127.1 @ 8.1	☐
183	Service, Lot #34 on Perry Owens Drive, 4' below grade.	5/15/2023	96	95	9.6	SM	M - 127.1 @ 8.1	☐
184	Service, Lot #37 on Perry Owens Drive, 2' below grade.	5/16/2023	97	95	8.9	SM	M - 127.1 @ 8.1	☐
185	Service, Lot #46 on Perry Owens Drive, 2' below grade.	5/16/2023	96	95	9.9	SM	M - 127.1 @ 8.1	☐
186	Service, Lot #34 on Perry Owens Drive, 2' below grade.	5/16/2023	97	95	9.5	SM	M - 127.1 @ 8.1	☐
187	Service, Lot #37 on Perry Owens Drive, at grade.	5/16/2023	96	95	8.6	SM	M - 127.1 @ 8.1	☐
188	Service, Lot #34 on Perry Owens Drive, at grade.	5/16/2023	96	95	9.2	SM	M - 127.1 @ 8.1	☐
189	Service, Lot #46 on Perry Owens Drive, at grade.	5/16/2023	97	95	8.3	SM	M - 127.1 @ 8.1	☐
190	Main, Station #7 + 00 on Perry Owens Drive, at 10' below grade.	5/17/2023	97	95	7.9	SM	M - 127.1 @ 8.1	☐
191	Main, Station #6 + 80 on Perry Owens Drive, at 8' below grade.	5/17/2023	97	95	8.5	SM	M - 127.1 @ 8.1	☐
192	Main, Station #6 + 50 on Perry Owens Drive, at 6' below grade.	5/17/2023	98	95	8.3	SM	M - 127.1 @ 8.1	☐

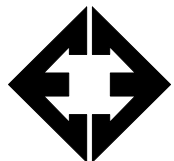


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
193	Manhole 9-4, Station #7 + 43.27 on Perry Owens Drive, 10' below grade.	5/17/2023	97	95	8.7	SM	M - 127.1 @ 8.1	☐
194	Manhole 9-4, Station #7 + 43.27 on Perry Owens Drive, 8' below grade.	5/17/2023	96	95	9.8	SM	M - 127.1 @ 8.1	☐
195	Manhole 9-4, Station #7 + 43.27 on Perry Owens Drive, 6' below grade.	5/17/2023	96	95	9.5	SM	M - 127.1 @ 8.1	☐
196	Main, Station #6 + 75 on Perry Owens Drive, 4' below grade.	5/17/2023	97	95	8.7	SM	M - 127.1 @ 8.1	☐
197	Main, Station #6 + 50 on Perry Owens Drive, 2' below grade.	5/17/2023	98	95	8.3	SM	M - 127.1 @ 8.1	☐
198	Manhole 9-4, Station #7 + 43.27 on Perry Owens Drive, 4' below grade.	5/17/2023	97	95	8.8	SM	M - 127.1 @ 8.1	☐
199	Manhole 9-4, Station #7 + 43.27 on Perry Owens Drive, 2' below grade.	5/17/2023	98	95	9.4	SM	M - 127.1 @ 8.1	☐
200	Manhole 9-5, Station #8 + 13.43 on Perry Owens Drive, 10' below grade.	5/17/2023	97	95	8.6	SM	M - 127.1 @ 8.1	☐
201	Manhole 9-5, Station #8 + 13.43 on Perry Owens Drive, 8' below grade.	5/17/2023	96	95	8.9	SM	M - 127.1 @ 8.1	☐
202	Manhole 9-5, Station #8 + 13.43 on Perry Owens Drive, 6' below grade.	5/17/2023	98	95	8.5	SM	M - 127.1 @ 8.1	☐
203	Manhole 9-5, Station #8 + 13.43 on Perry Owens Drive, 4' below grade.	5/17/2023	96	95	8.4	SM	M - 127.1 @ 8.1	☐
204	Main, Station #6 + 50 on Perry Owens Drive, at grade.	5/17/2023	99	95	9.2	SM	M - 127.1 @ 8.1	☐

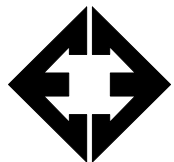


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
205	Manhole 9-5, Station #8 + 13.43 on Perry Owens Drive, 2' below grade.	5/17/2023	97	95	9.1	SM	M - 127.1 @ 8.1	☐
206	Manhole 9-4, Station #7 + 43.27 on Perry Owens Drive, at grade.	5/17/2023	97	95	8.7	SM	M - 127.1 @ 8.1	☐
207	Manhole 9-5, Station #8 + 13.43 on Perry Owens Drive, at grade.	5/17/2023	100	95	9.3	SM	M - 127.1 @ 8.1	☐
208	Main Station #2 + 75 at Briargate Parkway, 7' below grade.	5/18/2023	99	95	10.6	SM	M - 122.3 @ 10.4	☐
209	Main Station #3 + 00 at Briargate Parkway, 5' below grade.	5/18/2023	98	95	10.9	SM	M - 122.3 @ 10.4	☐
210	Manhole 10-1, Station #0 + 96.59 at Aspen Valley Road, 8' below grade.	5/18/2023	98	95	7.1	SM	M - 127.1 @ 8.1	☐
211	Manhole 10-1, Station #0 + 96.59 at Aspen Valley Road, 6' below grade.	5/18/2023	96	95	6.7	SM	M - 127.1 @ 8.1	☐
212	Manhole 10-1, Station #0 + 96.59 at Aspen Valley Road, 4' below grade.	5/18/2023	98	95	7.3	SM	M - 127.1 @ 8.1	☐
213	Main, Station #2 + 50 at Briargate Parkway, 3' below grade.	5/18/2023	99	95	11.1	SM	M - 122.3 @ 10.4	☐
214	Manhole 10-1, Station #0 + 96.59 on Aspen Valley Road, 2' below grade.	5/18/2023	96	95	7.5	SM	M - 127.1 @ 8.1	☐
215	Main, Station #3 + 00 at Briargate Parkway, 1' below grade.	5/18/2023	98	95	10.5	SM	M - 122.3 @ 10.4	☐
216	Manhole 10-2, Station #0 + 69.96 on Aspen Valley Road, 8' below grade.	5/18/2023	99	95	8.6	SM	M - 127.1 @ 8.1	☐

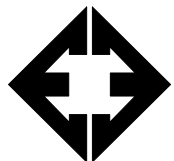


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
217	Manhole 10-2, Station #0 + 69.96 on Aspen Valley Road, 6' below grade.	5/18/2023	97	95	9.3	SM	M - 127.1 @ 8.1	☐
218	Manhole 10-2, Station #0 + 69.96 on Aspen Valley Road, 4' below grade.	5/18/2023	97	95	9.1	SM	M - 127.1 @ 8.1	☐
219	Main, Station #2 + 75 on Briargate Parkway, 1' below grade.	5/19/2023	93	95	13.8	SM	M - 122.3 @ 10.4	☒
219a	(Retest), Main, Station #2 + 75 on Briargate Parkway, 1' below grade.	5/19/2023	95	95	12.1	SM	M - 122.3 @ 10.4	☐
220	Service, Lot # 43 on Perry Owens Drive, 8' below grade.	5/22/2023	96	95	7.7	SM	M - 127.1 @ 8.1	☐
221	Service, Lot # 43 on Perry Owens Drive, 6' below grade.	5/22/2023	96	95	8.1	SM	M - 127.1 @ 8.1	☐
222	Service, Lot # 43 on Perry Owens Drive, 4' below grade.	5/22/2023	97	95	8.4	SM	M - 127.1 @ 8.1	☐
223	Service, Lot # 41 on Perry Owens Drive, 9' below grade.	5/22/2023	96	95	8.7	SM	M - 127.1 @ 8.1	☐
224	Service, Lot # 41 on Perry Owens Drive, 7' below grade.	5/22/2023	97	95	8.5	SM	M - 127.1 @ 8.1	☐
225	Service, Lot # 43 on Perry Owens Drive, 2' below grade.	5/22/2023	98	95	9.2	SM	M - 127.1 @ 8.1	☐
226	Service, Lot # 41 on Perry Owens Drive, 5' below grade.	5/22/2023	96	95	8.3	SM	M - 127.1 @ 8.1	☐
227	Service, Lot # 41 on Perry Owens Drive, 3' below grade.	5/22/2023	96	95	9.1	SM	M - 127.1 @ 8.1	☐

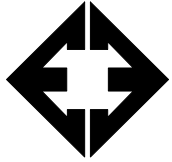


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
228	Service, Lot # 43 on Perry Owens Drive, at grade.	5/22/2023	98	95	8.6	SM	M - 127.1 @ 8.1	☐
229	Service, Lot # 41 on Perry Owens Drive, 1' below grade.	5/22/2023	98	95	8.5	SM	M - 127.1 @ 8.1	☐
230	Service, Lot # 44 on Perry Owens Drive, 6' below grade.	5/22/2023	99	95	8.7	SM	M - 127.1 @ 8.1	☐
231	Service, Lot # 39 on Perry Owens Drive, 6' below grade.	5/22/2023	97	95	8.2	SM	M - 127.1 @ 8.1	☐
232	Service, Lot # 41 on Perry Owens Drive, at grade.	5/23/2023	96	95	9.6	SM	M - 127.1 @ 8.1	☐
233	Service, Lot #44 on Perry Owens Drive, 4' below grade.	5/23/2023	97	95	8.3	SM	M - 127.1 @ 8.1	☐
234	Service, Lot #39 on Perry Owens Drive, 4' below grade.	5/23/2023	99	95	9.4	SM	M - 127.1 @ 8.1	☐
235	Service, Lot #44 on Perry Owens Drive, 2' below grade.	5/23/2023	97	95	9.5	SM	M - 127.1 @ 8.1	☐
236	Service, Lot #39 on Perry Owens Drive, 2' below grade.	5/23/2023	96	95	9.1	SM	M - 127.1 @ 8.1	☐
237	Service, Lot #38 on Perry Owens Drive, 6' below grade.	5/24/2023	96	95	8.7	SM	M - 127.1 @ 8.1	☐
238	Service, Lot #45 on Perry Owens Drive, 6' below grade.	5/24/2023	98	95	9.6	SM	M - 127.1 @ 8.1	☐
239	Service, Lot #44 on Perry Owens Drive, at grade.	5/24/2023	97	95	9.3	SM	M - 127.1 @ 8.1	☐

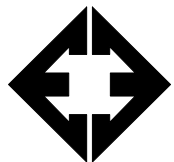


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
240	Service, Lot #39 on Perry Owens Drive, at grade.	5/24/2023	98	95	8.8	SM	M - 127.1 @ 8.1	☐
241	Service, Lot #38 on Perry Owens Drive, 4' below grade.	5/24/2023	97	95	9.1	SM	M - 127.1 @ 8.1	☐
242	Service, Lot #45 on Perry Owens Drive, 4' below grade.	5/24/2023	100	95	9.2	SM	M - 127.1 @ 8.1	☐
243	Service, Lot #38 on Perry Owens Drive, 2' below grade.	5/24/2023	98	95	9.6	SM	M - 127.1 @ 8.1	☐
244	Service, Lot #45 on Perry Owens Drive, 2' below grade.	5/24/2023	97	95	8.8	SM	M - 127.1 @ 8.1	☐
245	Service, Lot #38 on Perry Owens Drive, at grade.	5/25/2023	99	95	9.3	SM	M - 127.1 @ 8.1	☐
246	Service, Lot #45 on Perry Owens Drive, at grade.	5/25/2023	98	95	9.5	SM	M - 127.1 @ 8.1	☐
247	Manhole, station # 3 + 91.08 at Briargate Parkway, 8' below grade.	5/25/2023	97	95	10.9	SM	M - 122.3 @ 10.4	☐
248	Manhole, station # 3 + 91.08 at Briargate Parkway, 6' below grade.	5/25/2023	97	95	10.2	SM	M - 122.3 @ 10.4	☐
249	Manhole, station # 3 + 91.08 at Briargate Parkway, 4' below grade.	5/25/2023	98	95	9.6	SM	M - 122.3 @ 10.4	☐
250	Manhole, station # 3 + 91.08 at Briargate Parkway, 2' below grade.	5/26/2023	97	95	9.9	SM	M - 122.3 @ 10.4	☐
360	Main, Station # 27 + 50 on Wheatland Drive, 10' below grade.	7/27/2023	96	95	8.8	SM	M - 127.1 @ 8.1	☐

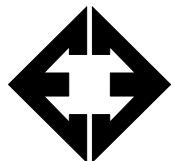


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
361	Main, Station # 27 + 25 on Wheatland Drive, 8' below grade.	7/27/2023	98	95	8.7	SM	M - 127.1 @ 8.1	☐
362	Main, Station # 27 + 00 on Wheatland Drive, 6' below grade.	7/27/2023	99	95	9.4	SM	M - 127.1 @ 8.1	☐
363	Manhole 1 - 8, Station # 27 + 71.88 on Wheatland Drive, 12' below grade.	7/27/2023	96	95	8.5	SM	M - 127.1 @ 8.1	☐
364	Manhole 1 - 8, Station # 27 + 71.88 on Wheatland Drive, 10' below grade.	7/27/2023	97	95	8.3	SM	M - 127.1 @ 8.1	☐
365	Manhole 1 - 8, Station # 27 + 71.88 on Wheatland Drive, 8' below grade.	7/27/2023	97	95	9.1	SM	M - 127.1 @ 8.1	☐
366	Main, Station # 27 + 25 on Wheatland Drive, 4' below grade.	7/27/2023	97	95	8.1	SM	M - 127.1 @ 8.1	☐
367	Manhole 1 - 8, Station # 27 + 71.88 on Wheatland Drive, 6' below grade.	7/27/2023	96	95	9.3	SM	M - 127.1 @ 8.1	☐
368	Manhole 1 - 8, Station # 27 + 71.88 on Wheatland Drive, 4' below grade.	7/27/2023	96	95	9.1	SM	M - 127.1 @ 8.1	☐
369	Manhole 1 - 8, Station # 27 + 71.88 on Wheatland Drive, 2' below grade.	7/28/2023	96	95	9.4	SM	M - 127.1 @ 8.1	☐
370	Main, Station # 27 + 50 on Wheatland Drive, 2' below grade.	7/28/2023	97	95	8.6	SM	M - 127.1 @ 8.1	☐
371	Main, Station # 27 + 00 on Wheatland Drive, at grade.	7/28/2023	97	95	9.2	SM	M - 127.1 @ 8.1	☐
372	Manhole 1 - 8, Station # 27 + 71.88 on Wheatland Drive, at grade.	7/28/2023	98	95	9.6	SM	M - 127.1 @ 8.1	☐

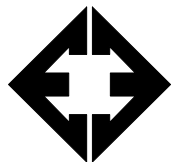


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
373	Main, Station # 2 + 00 on Robert Allison Circle, 10' below grade.	7/28/2023	97	95	8.8	SM	M - 127.1 @ 8.1	☐
374	Main, Station # 1 + 75 on Robert Allison Circle, 8' below grade.	7/28/2023	96	95	9.3	SM	M - 127.1 @ 8.1	☐
375	Main, Station # 2 + 75 on Robert Allison Circle, 6' below grade.	7/31/2023	96	95	8.5	SM	M - 127.1 @ 8.1	☐
376	Main, Station # 2 + 50 on Robert Allison Circle, 4' below grade.	7/31/2023	98	95	9.1	SM	M - 127.1 @ 8.1	☐
377	Main, Station # 2 + 25 on Robert Allison Circle, 2' below grade.	7/31/2023	97	95	8.7	SM	M - 127.1 @ 8.1	☐
378	Main, Station # 2 + 00 on Robert Allison Circle, at grade.	7/31/2023	97	95	8.8	SM	M - 127.1 @ 8.1	☐
379	Service, Lot # 72 on Robert Allison Circle, 8' below grade.	7/31/2023	96	95	8.3	SM	M - 127.1 @ 8.1	☐
380	Service, Lot # 72 on Robert Allison Circle, 6' below grade.	7/31/2023	97	95	7.9	SM	M - 127.1 @ 8.1	☐
381	Manhole 11 - 1, Station # 3 + 70.08 on Robert Allison Circle, 10' below grade.	7/31/2023	99	95	8.4	SM	M - 127.1 @ 8.1	☐
382	Manhole 11 - 1, Station # 3 + 70.08 on Robert Allison Circle, 8' below grade.	7/31/2023	97	95	8.1	SM	M - 127.1 @ 8.1	☐
383	Manhole 11 - 1, Station # 3 + 70.08 on Robert Allison Circle, 6' below grade.	7/31/2023	97	95	8.6	SM	M - 127.1 @ 8.1	☐
384	Manhole 11 - 1, Station # 3 + 70.08 on Robert Allison Circle, 4' below grade.	7/31/2023	98	95	8.9	SM	M - 127.1 @ 8.1	☐

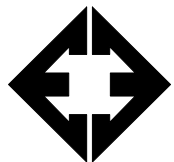


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
385	Manhole 11 - 1, Station # 3 + 70.08 on Robert Allison Circle, 2' below grade.	7/31/2023	96	95	7.9	SM	M - 127.1 @ 8.1	☐
386	Manhole 11 - 1, Station # 3 + 70.08 on Robert Allison Circle, at grade.	7/31/2023	97	95	8.5	SM	M - 127.1 @ 8.1	☐
387	Service, Lot # 72 on Robert Allison Circle, 4' below grade.	8/1/2023	96	95	8.2	SM	M - 127.1 @ 8.1	☐
388	Service, Lot # 72 on Robert Allison Circle, 2' below grade.	8/1/2023	96	95	8.6	SM	M - 127.1 @ 8.1	☐
389	Service, Lot # 68 on Robert Allison Circle, 8' below grade.	8/1/2023	96	95	7.7	SM	M - 127.1 @ 8.1	☐
390	Service, Lot # 68 on Robert Allison Circle, 6' below grade.	8/1/2023	98	95	8.8	SM	M - 127.1 @ 8.1	☐
391	Service, Lot # 68 on Robert Allison Circle, 4' below grade.	8/1/2023	97	95	8.3	SM	M - 127.1 @ 8.1	☐
392	Service, Lot # 68 on Robert Allison Circle, 2' below grade.	8/1/2023	96	95	9.5	SM	M - 127.1 @ 8.1	☐
393	Service, Lot # 68 on Robert Allison Circle, at grade.	8/1/2023	96	95	8.6	SM	M - 127.1 @ 8.1	☐
394	Service, Lot # 72 on Robert Allison Circle, at grade.	8/1/2023	97	95	9.1	SM	M - 127.1 @ 8.1	☐
395	Main, Station # 30 + 00 on Wheatland Drive, 10' below grade.	8/2/2023	96	95	7.5	SM	M - 127.1 @ 8.1	☐
396	Main, Station # 29 + 75 on Wheatland Drive, 8' below grade.	8/2/2023	97	95	8.3	SM	M - 127.1 @ 8.1	☐

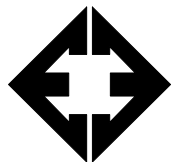


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
397	Main, Station # 29 + 40 on Wheatland Drive, 6' below grade.	8/2/2023	97	95	8.6	SM	M - 127.1 @ 8.1	☐
398	Main, Station # 30 + 25 on Wheatland Drive, 4' below grade.	8/2/2023	96	95	9.1	SM	M - 127.1 @ 8.1	☐
399	Main, Station # 29 + 60 on Wheatland Drive, 2' below grade.	8/2/2023	97	95	8.5	SM	M - 127.1 @ 8.1	☐
400	Service, Lot # 51 on Wheatland Drive, 8' below grade.	8/3/2023	96	95	9.4	SM	M - 127.1 @ 8.1	☐
401	Service, Lot # 53 on Wheatland Drive, 8' below grade.	8/3/2023	95	95	8.5	SM	M - 127.1 @ 8.1	☐
402	Service, Lot # 51 on Wheatland Drive, 6' below grade.	8/3/2023	97	95	9.6	SM	M - 127.1 @ 8.1	☐
403	Service, Lot # 53 on Wheatland Drive, 6' below grade.	8/3/2023	97	95	9.1	SM	M - 127.1 @ 8.1	☐
404	Main, Station # 30 + 00 on Wheatland Drive, at grade.	8/3/2023	96	95	9.3	SM	M - 127.1 @ 8.1	☐
405	Service, Lot # 53 on Wheatland Drive, 4' below grade.	8/3/2023	96	95	9.5	SM	M - 127.1 @ 8.1	☐
406	Service, Lot # 51 on Wheatland Drive, 4' below grade.	8/3/2023	97	95	8.7	SM	M - 127.1 @ 8.1	☐
407	Service, Lot # 53 on Wheatland Drive, 2' below grade.	8/3/2023	96	95	8.8	SM	M - 127.1 @ 8.1	☐
408	Service, Lot # 51 on Wheatland Drive, 2' below grade.	8/3/2023	96	95	8.3	SM	M - 127.1 @ 8.1	☐

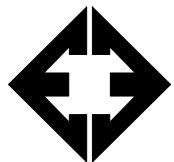


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
409	Service, Lot # 51 on Wheatland Drive, at grade.	8/4/2023	96	95	9.1	SM	M - 127.1 @ 8.1	☐
410	Service, Lot # 53 on Wheatland Drive, at grade.	8/4/2023	97	95	9.0	SM	M - 127.1 @ 8.1	☐
411	Service, Lot # 66 on Wheatland Drive, 8' below grade.	8/4/2023	98	95	9.5	SM	M - 127.1 @ 8.1	☐
412	Service, Lot # 52 on Wheatland Drive, 8' below grade.	8/4/2023	96	95	9.3	SM	M - 127.1 @ 8.1	☐
413	Service, Lot # 66 on Wheatland Drive, 6' below grade.	8/4/2023	96	95	8.9	SM	M - 127.1 @ 8.1	☐
414	Service, Lot # 52 on Wheatland Drive, 6' below grade.	8/4/2023	96	95	9.6	SM	M - 127.1 @ 8.1	☐
415	Service, Lot # 66 on Wheatland Drive, 4' below grade.	8/4/2023	95	95	9.1	SM	M - 127.1 @ 8.1	☐
416	Service, Lot # 52 on Wheatland Drive, 4' below grade.	8/4/2023	97	95	9.3	SM	M - 127.1 @ 8.1	☐
417	Service, Lot # 66 on Wheatland Drive, 2' below grade.	8/4/2023	95	95	9.2	SM	M - 127.1 @ 8.1	☐
418	Service, Lot # 52 on Wheatland Drive, 2' below grade.	8/4/2023	96	95	9.1	SM	M - 127.1 @ 8.1	☐
419	Manhole 1-9, Station # 31 + 73.44 on Wheatland Drive, 10' below grade.	8/7/2023	97	95	8.3	SM	M - 127.1 @ 8.1	☐
420	Manhole 1-9, Station # 31 + 73.44 on Wheatland Drive, 8' below grade.	8/7/2023	96	95	9.1	SM	M - 127.1 @ 8.1	☐

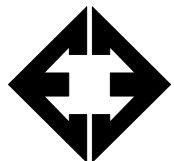


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
421	Manhole 1-9, Station # 31 + 73.44 on Wheatland Drive, 6' below grade.	8/7/2023	96	95	8.4	SM	M - 127.1 @ 8.1	☐
422	Manhole 1-9, Station # 31 + 73.44 on Wheatland Drive, 4' below grade.	8/7/2023	96	95	8.9	SM	M - 127.1 @ 8.1	☐
423	Manhole 1-9, Station # 31 + 73.44 on Wheatland Drive, 2' below grade.	8/7/2023	98	95	7.5	SM	M - 127.1 @ 8.1	☐
424	Service, Lot # 65 on Wheatland Drive, 6' below grade.	8/8/2023	96	95	8.1	SM	M - 127.1 @ 8.1	☐
425	Service, Lot # 65 on Wheatland Drive, 4' below grade.	8/8/2023	96	95	8.6	SM	M - 127.1 @ 8.1	☐
426	Manhole 1-9, Station # 31 + 73.44 on Wheatland Drive, at grade.	8/8/2023	97	95	8.3	SM	M - 127.1 @ 8.1	☐
427	Main, Station # 34 + 00 on Wheatland Drive, 10' below grade.	8/8/2023	97	95	7.9	SM	M - 127.1 @ 8.1	☐
428	Main, Station # 33 + 50 on Wheatland Drive, 8' below grade.	8/8/2023	97	95	7.7	SM	M - 127.1 @ 8.1	☐
429	Main, Station # 33 + 75 on Wheatland Drive, 6' below grade.	8/8/2023	96	95	7.9	SM	M - 127.1 @ 8.1	☐
430	Service, Lot # 65 on Wheatland Drive, 2' below grade.	8/8/2023	99	95	7.7	SM	M - 127.1 @ 8.1	☐
431	Service, Lot # 65 on Wheatland Drive, at grade.	8/8/2023	98	95	8.7	SM	M - 127.1 @ 8.1	☐
432	Main, Station # 33 + 85 on Wheatland Drive, 4' below grade.	8/8/2023	98	95	8.8	SM	M - 127.1 @ 8.1	☐

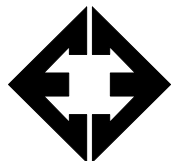


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
433	Main, Station # 33 + 65 on Wheatland Drive, 2' below grade.	8/8/2023	96	95	8.4	SM	M - 127.1 @ 8.1	☐
434	Manhole 1-10, Station # 34 + 43.58 on Wheatland Drive, 10' below grade.	8/9/2023	97	95	7.3	SM	M - 127.1 @ 8.1	☐
435	Manhole 1-10, Station # 34 + 43.58 on Wheatland Drive, 8' below grade.	8/9/2023	99	95	9.1	SM	M - 127.1 @ 8.1	☐
436	Manhole 1-10, Station # 34 + 43.58 on Wheatland Drive, 6' below grade.	8/9/2023	98	95	7.9	SM	M - 127.1 @ 8.1	☐
437	Service, Lot # 57 on Wheatland Drive, 8' below grade.	8/9/2023	98	95	8.1	SM	M - 127.1 @ 8.1	☐
438	Service, Lot # 62 on Wheatland Drive, 8' below grade.	8/9/2023	96	95	8.6	SM	M - 127.1 @ 8.1	☐
439	Main, Station # 34 + 00 on Wheatland Drive, at grade.	8/9/2023	95	95	7.7	SM	M - 127.1 @ 8.1	☐
440	Service, Lot # 57 on Wheatland Drive, 6' below grade.	8/9/2023	97	95	8.3	SM	M - 127.1 @ 8.1	☐
441	Service, Lot # 62 on Wheatland Drive, 6' below grade.	8/9/2023	97	95	8.0	SM	M - 127.1 @ 8.1	☐
442	Service, Lot # 57 on Wheatland Drive, 4' below grade.	8/9/2023	99	95	8.1	SM	M - 127.1 @ 8.1	☐
443	Service, Lot # 62 on Wheatland Drive, 4' below grade.	8/9/2023	96	95	7.6	SM	M - 127.1 @ 8.1	☐
444	Service, Lot # 60 on Wheatland Drive, 6' below grade.	8/9/2023	95	95	7.5	SM	M - 127.1 @ 8.1	☐

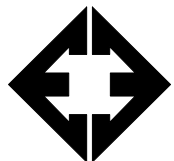


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
445	Service, Lot # 60 on Wheatland Drive, 4' below grade.	8/9/2023	95	95	7.5	SM	M - 127.1 @ 8.1	☐
446	Manhole 1-10, Station # 34 + 43.58 on Wheatland Drive, 4' below grade.	8/9/2023	97	95	7.9	SM	M - 127.1 @ 8.1	☐
447	Manhole 1-10, Station # 34 + 43.58 on Wheatland Drive, 2' below grade.	8/9/2023	96	95	8.3	SM	M - 127.1 @ 8.1	☐
448	Manhole 1-10, Station # 34 + 43.58 on Wheatland Drive, at grade.	8/9/2023	99	95	8.6	SM	M - 127.1 @ 8.1	☐
449	Service, Lot # 57 on Wheatland Drive, 2' below grade.	8/10/2023	97	95	8.0	SM	M - 127.1 @ 8.1	☐
450	Service, Lot # 62 on Wheatland Drive, 2' below grade.	8/10/2023	96	95	9.2	SM	M - 127.1 @ 8.1	☐
451	Service, Lot # 60 on Wheatland Drive, 2' below grade.	8/10/2023	95	95	8.5	SM	M - 127.1 @ 8.1	☐
452	Service, Lot # 57 on Wheatland Drive, at grade.	8/10/2023	97	95	8.4	SM	M - 127.1 @ 8.1	☐
453	Service, Lot # 62 on Wheatland Drive, at grade.	8/10/2023	95	95	7.8	SM	M - 127.1 @ 8.1	☐
454	Service, Lot # 60 on Wheatland Drive, at grade.	8/10/2023	95	95	7.3	SM	M - 127.1 @ 8.1	☐
455	Service, Lot # 61 on Wheatland Drive, 6' below grade.	8/10/2023	98	95	8.6	SM	M - 127.1 @ 8.1	☐
456	Service, Lot # 61 on Wheatland Drive, 4' below grade.	8/10/2023	96	95	9.1	SM	M - 127.1 @ 8.1	☐

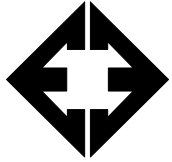

ENTECH
ENGINEERING, INC.
Density Testing Summary


Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.2
Subject: Sanitary Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 21-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
457	Service, Lot # 59 on Wheatland Drive, 6' below grade.	8/10/2023	100	95	8.1	SM	M - 127.1 @ 8.1	☐
458	Service, Lot # 59 on Wheatland Drive, 4' below grade.	8/10/2023	97	95	7.5	SM	M - 127.1 @ 8.1	☐
469	Service, Lot # 61 on Wheatland Drive, 2' below grade.	8/11/2023	96	95	7.7	SM	M - 127.1 @ 8.1	☐
470	Service, Lot # 59 on Wheatland Drive, 2' below grade.	8/11/2023	96	95	8.7	SM	M - 127.1 @ 8.1	☐
471	Service, Lot # 61 on Wheatland Drive, at grade.	8/11/2023	96	95	8.9	SM	M - 127.1 @ 8.1	☐
472	Service, Lot # 59 on Wheatland Drive, at grade.	8/11/2023	98	95	8.8	SM	M - 127.1 @ 8.1	☐

Utility Trench Backfill

Water

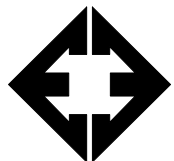


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.3
Subject: Water

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 29-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
1	Main, intersection of Wheatland Drive and Briargate Parkway (Side of Pipe), 8' below grade.	5/17/2023	99	95	10.6	SM	M - 122.3 @ 10.4	☐
2	Main, intersection of Wheatland Drive and Briargate Parkway, 6' below grade.	5/17/2023	97	95	11.3	SM	M - 122.3 @ 10.4	☐
3	Main, intersection of Wheatland Drive and Briargate Parkway, 4' below grade.	5/17/2023	97	95	10.1	SM	M - 122.3 @ 10.4	☐
4	Main, intersection of Wheatland drive and Briargate Parkway, 2' below grade.	5/17/2023	98	95	10.7	SM	M - 122.3 @ 10.4	☐
5	Main, intersection of Wheatland Drive and Briargate Parkway, at grade.	5/18/2023	98	95	10.5	SM	M - 122.3 @ 10.4	☐
6	Main, Station # 27 + 65 on Willey Picket Drive, 4' below grade	5/30/2023	96	95	8.7	SM	M - 127.1 @ 8.1	☐
7	Main, Station # 27 + 80 on Willey Picket Drive, 2' below grade	5/30/2023	98	95	9.1	SM	M - 127.1 @ 8.1	☐
8	Main, Station # 27 + 50 on Willey Picket Drive, at grade	5/30/2023	97	95	8.5	SM	M - 127.1 @ 8.1	☐
9	Main, Station # 7 + 15 on Perry Owens Drive, 4' below grade.	6/21/2023	98	95	7.5	SM	M - 127.1 @ 8.1	☐
10	Main, Station # 7 + 25 on Perry Owens Drive, 2' below grade.	6/21/2023	98	95	8.6	SM	M - 127.1 @ 8.1	☐
11	Main, Station # 7 + 50 on Perry Owens Drive, at grade.	6/21/2023	99	95	8.3	SM	M - 127.1 @ 8.1	☐
12	Service, Lot # 32 on Sam Bass Drive, 2' below grade.	7/31/2023	95	95	9.6	SM	M - 122.8 @ 9.2	☐

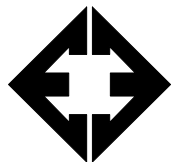


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.3
Subject: Water

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 29-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
13	Service, Lot # 32 on Sam Bass Drive, at grade.	7/31/2023	98	95	9.4	SM	M - 122.8 @ 9.2	☐
14	Service, Lot # 21 on Willey Picket Drive, 2' below grade.	8/9/2023	96	95	9.6	SM	M - 121.9 @ 8.6	☐
15	Service, Lot # 21 on Willey Picket Drive, at grade.	8/9/2023	99	95	9.4	SM	M - 121.9 @ 8.6	☐
16	Service, Lot # 20 on Willey Picket Drive, 2' below grade.	8/9/2023	95	95	9.1	SM	M - 121.9 @ 8.6	☐
17	Service, Lot # 20 on Willey Picket Drive, at grade.	8/9/2023	97	95	9.9	SM	M - 121.9 @ 8.6	☐
18	Valves, Station # 1 + 11.09 on Robert Allison Circle, 2' below grade.	8/17/2023	97	95	7.5	SM	M - 126.1 @ 7.1	☐
19	Valves, Station # 1 + 11.09 on Robert Allison Circle, at grade.	8/17/2023	99	95	7.9	SM	M - 126.1 @ 7.1	☐
20	Main, Station # 31 + 50 on Wheatland Drive, 3' below grade.	8/24/2023	96	95	9.6	SM	M - 127.1 @ 8.1	☐
21	Main, Station # 30 + 75 on Wheatland Drive, 1.5' below grade.	8/24/2023	97	95	8.8	SM	M - 127.1 @ 8.1	☐
22	Main, Station # 30 + 50 on Wheatland Drive, at grade.	8/24/2023	97	95	9.1	SM	M - 127.1 @ 8.1	☐
23	Service, Lot # 54 on Wheatland Drive, 4' below grade.	9/6/2023	97	95	8.0	SM	M - 127.1 @ 8.1	☐
24	Service, Lot # 55 on Wheatland Drive, 4' below grade.	9/6/2023	96	95	7.4	SM	M - 127.1 @ 8.1	☐

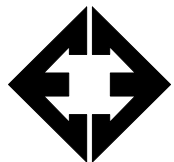


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.3
Subject: Water

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 29-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
25	Service, Lot # 56 on Wheatland Drive, 4' below grade.	9/6/2023	97	95	7.7	SM	M - 127.1 @ 8.1	☐
26	Service, Lot # 54 on Wheatland Drive, 2' below grade.	9/6/2023	98	95	8.2	SM	M - 127.1 @ 8.1	☐
27	Main, Station # 4 + 50 on Aspen Valley Road (Filing 2), 4' below grade.	9/7/2023	99	95	7.7	SM	M - 127.1 @ 8.1	☐
28	Main, Station # 4 + 25 on Aspen Valley Road (Filing 2), 2' below grade.	9/7/2023	98	95	8.4	SM	M - 127.1 @ 8.1	☐
29	Main, Station # 4 + 00 on Aspen Valley Road (Filing 2), at grade.	9/7/2023	98	95	7.9	SM	M - 127.1 @ 8.1	☐
30	Service, Lot # 54 on Wheatland Drive, at grade.	9/7/2023	99	95	8.2	SM	M - 127.1 @ 8.1	☐
31	Service, Lot # 56 on Wheatland Drive, 2' below grade.	9/7/2023	97	95	8.5	SM	M - 127.1 @ 8.1	☐
32	Service, Lot # 62 on Wheatland Drive, 4' below grade.	9/8/2023	97	95	8.5	SM	M - 127.1 @ 8.1	☐
33	Service, Lot # 63 on Wheatland Drive, at grade.	9/8/2023	99	95	8.6	SM	M - 127.1 @ 8.1	☐
34	Service, Lot # 64 on Wheatland Drive, 2' below grade.	9/8/2023	97	95	7.3	SM	M - 127.1 @ 8.1	☐
35	Service, Lot # 61 on Wheatland Drive, 2' below grade.	9/8/2023	96	95	8.1	SM	M - 127.1 @ 8.1	☐
36	Main, Station 3 + 75 on Sam Bass Drive, 3' below grade.	10/9/2023	98	95	7.1	SM	M - 127.1 @ 8.1	☐

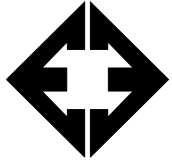


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.3
Subject: Water

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 29-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
37	Main, Station 4 + 00 on Sam Bass Drive, 1.5' below grade.	10/9/2023	98	95	7.3	SM	M - 127.1 @ 8.1	☐
38	Main, Station 4 + 25 on Sam Bass Drive, at grade.	10/9/2023	97	95	6.8	SM	M - 127.1 @ 8.1	☐

Storm Sewer Trench Backfill

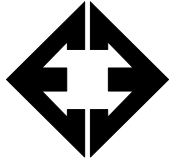


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.4
Subject: Storm Sewer

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 30-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
1	Main, Station # 0 + 50 on Perry Owens Drive, at springline.	8/23/2023	97	95	10.1	SM	M - 122.3 @ 10.4	☐
2	Main, Station # 0 + 75 on Perry Owens Drive, 2' below grade.	8/23/2023	98	95	9.3	SM	M - 122.3 @ 10.4	☐
3	Main, Station # 0 + 35 on Perry Owens Drive, at grade.	8/25/2023	96	95	9.5	SM	M - 122.3 @ 10.4	☐
4	Main, Station # 2 + 75 on Perry Owens Drive, at springline.	8/25/2023	98	95	8.1	SM	M - 127.1 @ 8.1	☐
5	Main, Station # 2 + 50 on Perry Owens Drive, 2.5' below grade.	8/25/2023	96	95	7.9	SM	M - 127.1 @ 8.1	☐
6	Main, Station # 2 + 60 on Perry Owens Drive, at grade.	8/25/2023	97	95	8.5	SM	M - 127.1 @ 8.1	☐
7	Main, Station # 0 + 50 on Wheatland Drive, at springline.	8/30/2023	96	95	7.9	SM	M - 127.1 @ 8.1	☐
8	Main, Station # 0 + 75 on Wheatland Drive, 2' below grade.	8/30/2023	96	95	8.1	SM	M - 127.1 @ 8.1	☐
9	Main, Station # 0 + 60 on Wheatland Drive, at grade.	8/30/2023	95	95	7.5	SM	M - 127.1 @ 8.1	☐

Cement Treated Subgrade

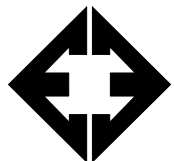


ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.6
Subject: Cement Treated Subgrade

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 30-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
1	Property line of Lot # 9 & 10 on Willey Picket Drive & 4' north of the edge of the curb, at grade.	11/7/2023	97	95	11.6	CL	S - 115.2 @ 12.0	☐
2	Property line of Lot # 4 & 5 on Willey Picket Drive & 5' north of the edge of the curb, at grade.	11/7/2023	96	95	11.9	CL	S - 115.2 @ 12.0	☐
3	Property line of Lot # 23 & 24 on Willey Picket Drive & 4' south of the edge of the curb, at grade.	11/7/2023	97	95	12.2	CL	S - 115.2 @ 12.0	☐
4	Property line of Lot # 31 & 32 on Sam Bass Drive & 6' south of the edge of the curb, at grade.	11/7/2023	96	95	11.5	CL	S - 115.2 @ 12.0	☐
5	10' west of the property line of Lot # 25 & 26 on Sam Bass Drive & 3' north of the edge of the curb, at grade.	11/7/2023	97	95	12.1	CL	S - 115.2 @ 12.0	☐
6	Property line of Lot # 34 & 35 on Sam Bass Drive & 7' south of the edge of the curb, at grade.	11/7/2023	96	95	11.6	CL	S - 115.2 @ 12.0	☐
7	Property line of Lot # 39 & 40 on Sam Bass Drive & 6' south of the edge of the curb, at grade.	11/7/2023	98	95	11.5	CL	S - 115.2 @ 12.0	☐
8	Property line of Lot # 19 & 20 on Sam Bass Drive & 4' north of the edge of the curb, at grade.	11/7/2023	98	95	11.9	CL	S - 115.2 @ 12.0	☐
9	Property line of Lot # 57 & 58 on Wheatland Drive & 4' south of the edge of the curb, at grade.	11/15/2023	97	95	11.8	CL	S - 115.2 @ 12.0	☐
10	Property line of Lot # 52 & 53 on Wheatland Drive & 6' south of the edge of the curb, at grade.	11/15/2023	96	95	11.4	CL	S - 115.2 @ 12.0	☐
11	Property line of Lot # 62 & 63 on Wheatland Drive & 5' north of the edge of the curb, at grade.	11/15/2023	98	95	12.2	CL	S - 115.2 @ 12.0	☐
12	Property line of Lot # 73 & 74 on Wheatland Drive & 5' west of the edge of the curb, at grade.	11/15/2023	98	95	11.5	CL	S - 115.2 @ 12.0	☐

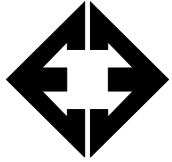

ENTECH
ENGINEERING, INC.
Density Testing Summary

Client: SR Land, LLC
Project: Homestead North, Filing 2
Entech Job #: 230423.6
Subject: Cement Treated Subgrade

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 30-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Percent Moisture	Soil Type	Proctor Type/Value	Pass/Fail ☒ = Fail
13	15' north of the intersection at Sam Bass Drive & Wheatland Drive, 4' east of the edge of the curb, at grade.	11/15/2023	96	95	11.1	CL	S - 115.2 @ 12.0	☐
14	30' north of the intersection at Sam Bass Drive & Aspen Valley Road, 8' west of the edge of the curb, at grade.	11/16/2023	98	95	11.6	CL	S - 115.2 @ 12.0	☐
15	100' north of the intersection at Sam Bass Drive & Aspen Valley Road, 4' east of the edge of the curb, at grade.	11/16/2023	97	95	12.2	CL	S - 115.2 @ 12.0	☐
16	10' west of the property line of Lot # 44 & 45 on Perry Owens Drive, 3' south of the edge of the curb, at grade.	11/16/2023	99	95	11.9	CL	S - 115.2 @ 12.0	☐
17	Property line of Lot # 38 & 39 on Perry Owens Drive, 4' north of the edge of the curb, at grade.	11/16/2023	95	95	11.3	CL	S - 115.2 @ 12.0	☐

TABLE 1
SUMMARY OF CTS FIELD TEST RESULTS

FIELD SAMPLE ID	SAND, CLAYEY, BROWN
SOIL ADDITIVE	TYPE I/II CEMENT
CURING METHOD	100° HUMIDIFIED OVEN


<i>ADDITIVE %</i>	<i>DATE SAMPLED</i>	<i>WATER %</i>	<i>DENSITY (dry)</i>	<i>AGE (days)</i>	<i>STRENGTH (psi)</i>
WILLEY PICKET DRIVE, LOTS 20/21					
2	11/07/23	11.6	125.1	7	257
2	11/07/23	11.6	126.3	7	307
2	11/07/23	11.6	127.0	7	275
AVERAGE:					280
SAM BOWS DRIVE, 10' EAST OF FILL LOTS					
2	11/07/23	10.2	125.2	7	214
2	11/07/23	10.2	125.3	7	239
2	11/07/23	10.2	126.5	7	244
AVERAGE:					232

TABLE 1
SUMMARY OF CTS FIELD TEST RESULTS

FIELD SAMPLE ID	SAND, CLAYEY, BROWN
SOIL ADDITIVE	TYPE I/II CEMENT
CURING METHOD	100° HUMIDIFIED OVEN

<i>ADDITIVE %</i>	<i>DATE SAMPLED</i>	<i>WATER %</i>	<i>DENSITY (dry)</i>	<i>AGE (days)</i>	<i>STRENGTH (psi)</i>
WHEATLAND DRIVE, LOTS 73/74					
2	11/15/23	10.3	126.6	7	337
2	11/15/23	10.3	126.3	7	329
2	11/15/23	10.3	126.3	7	347
AVERAGE:					338
WHEATLAND DRIVE, LOTS 57/58					
2	11/15/23	10.3	126.6	7	337
2	11/15/23	10.3	126.3	7	329
2	11/15/23	10.3	126.3	7	347
AVERAGE:					338
PERRY OWENS DRIVE, LOTS 38/39					
2	11/16/23	10.9	130.8	7	350
2	11/16/23	10.9	130.6	7	412
2	11/16/23	10.9	131.2	7	392
AVERAGE:					385

Asphalt Pavement

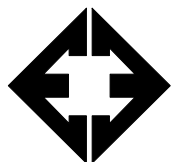

ENTECH
ENGINEERING, INC.
Asphalt Testing Summary

Client: SR Land, LLC
Project: Homestead North Filing 2
Entech Job #: 230423.6

QC Reviewed by: _____
QA Reviewed by: _____
Report Date: 29-May-25

Test #	Test Location	Testing Date	Percent Compaction	Percent Required	Field Density	Maximum Density <i>M=Marshall / R=Rice</i>	Mode / Depth	Pass/Fail ☒ = Fail
1	Property line of Lot # 17 & 18 on Willey Pickett Drive, 5' south of the edge of the pavement, in the westbound lane, bottom lift.	12/5/2023	93	92-96	141.4	R - 151.8		☐
2	10' east of the property line of Lot # 22 & 23 on Willey Pickett Drive, 4' south of the edge of the pavement, in the westbound lane, bottom lift.	12/5/2023	93	92-96	141.7	R - 151.8		☐
3	Property line of Lot # 5 & 6 on Willey Pickett Drive, 7' north of the edge of the pavement, in the eastbound lane, bottom lift.	12/5/2023	93	92-96	141.7	R - 151.8		☐
4	Property line of Lot # 25 & 25 on Sam Bass Drive, 4' north of the edge of the pavement, in the eastbound lane, bottom lift.	12/5/2023	93	92-96	140.8	R - 151.8		☐
5	Property line of Lot # 31 & 32 on Sam Bass Drive, 1' north of the centerline of the road, in the westbound lane (longitudinal joint), bottom lift.	12/5/2023	93	92-96	140.7	R - 151.8		☐
6	Property line of Lot # 67 & 68 on Robert Allison Circle, 7' south of the edge of the pavement, in the westbound lane, bottom lift.	12/5/2023	93	92-96	140.6	R - 151.8		☐
7	Property line of Lot # 71 & 72 on Robert Allison Circle, 11' north of the edge of the pavement (cul-de-sac), bottom lift.	12/5/2023	94	92-96	142.4	R - 151.8		☐
8	Property line of Lot # 61 & 62 on Wheatland Drive, 4' north of the edge of the pavement, in the northeastbound lane, bottom lift.	12/6/2023	94	92-96	142.1	R - 151.8		☐
9	Property line of Lot # 66 & 67 on Wheatland Drive, 5' west of the edge of the pavement, in the northeastbound lane, bottom lift.	12/6/2023	93	92-96	141.0	R - 151.8		☐
10	Property line of Lot # 32 & 74 on Wheatland Drive, 6' east of the edge of the pavement, in the southwestbound lane, bottom lift.	12/6/2023	93	92-96	141.7	R - 151.8		☐
11	Property line of Lot # 54 & 55 on Wheatland Drive, 6' south of the edge of the pavement, in the southwestbound lane, bottom lift.	12/6/2023	94	92-96	142.1	R - 151.8		☐
12	Property line of Lot # 49 & 48 on Sam Bass Drive, 1' north of the centerline of the road, in the westbound lane (longitudinal joint), bottom lift.	12/6/2023	93	92-96	140.7	R - 151.8		☐
13	10' west of the property line of Lot # 35 & 36 on Sam Bass Drive, 5' north of the edge of the pavement, in the eastbound lane, bottom lift.	12/6/2023	93	92-96	140.8	R - 151.8		☐



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Density of Asphalt

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Test Results

Test #	Test Date	Test Location	Lift Thickness (inches)	Mix Design	Max Density (pcf)	In Place Density (pcf)	Percent Comp.	Min/Max Comp. (%)	Rem. Code	Field Tech	Retest Of
8	04/03/2024	Bottom Lift, Drive Lane: Patch, at the northwest corner of the intersection of Wheatland Dr. & Sam Bass Dr., 17' west of the crossspan & 5' south of the north curb.	2.0	(1/2") GR SX(75) PG 64-22	152.5	138.4	93	92 / 96	SP	AO	
9	04/03/2024	Bottom Lift, Drive Lane: Patch, at the southwest corner of the intersection on Sam Bass Dr. & Wheatland Dr., 3' east of the crossspan & 14' north of the inlet.	2.0	(1/2") GR SX(75) PG 64-22	152.5	139.1	92	92 / 96	SP	AO	
10	04/03/2024	Bottom Lift, Drive Lane: Patch, 35' south of the southeast corner of the intersection at Sam Bass Dr. & Wheatland Dr., northbound lane, 5' west of the east curb.	2.0	(1/2") GR SX(75) PG 64-22	152.5	139.8	92	92 / 96	SP	AO	
17	04/04/2024	Top Lift, Drive Lane: 60' southeast of property line 72/73 in the cul-de-sac on Robert Allison Ct., 25' northeast from the southwest curb.	2.0	(3/4") GR S(75) PG 64-22	152.2	138.9	92	92 / 96	SP	AO	
18	04/04/2024	Top Lift, Drive Lane: 50' south of the southeast corner of the intersection at Wheatland Dr., & Robert Allison Ct., in the northbound lane, 6' west of the east curb.	2.0	(3/4") GR S(75) PG 64-22	152.2	140.1	93	92 / 96	SP	AO	
19	04/04/2024	Bottom Lift, Drive Lane: Patch, 20' south & 10' east of the fire hydrant at the northeast corner of the intersection at Willey Picket Dr., & Wheatland Dr.,	2.0	(3/4") GR S(75) PG 64-22	152.2	140.2	95	92 / 96	SP	AO	
20	04/04/2024	Bottom Lift, Drive Lane: Patch, 10' west & 5' south of the fire hydrant at the northeast corner of the intersection at Willey Picket Dr., & Wheatland Dr.	2.0	(3/4") GR S(75) PG 64-22	152.2	139.3	92	92 / 96	SP	AO	
21	04/04/2024	Bottom Lift, Drive Lane: Patch, 3' north & 10' east of the southwest corner of the intersection at Wheatland Dr. & Willey Picket Dr.	2.0	(3/4") GR S(75) PG 64-22	152.2	136.1	90	92 / 96	SF	AO	



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Density of Asphalt

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Test #	Test Date	Test Location	Lift Thickness (inches)	Mix Design	Max Density (pcf)	In Place Density (pcf)	Percent Comp.	Min/Max Comp. (%)	Rem. Code	Field Tech	Retest Of
22	04/04/2024	Top Lift, Drive Lane: 100' north of the intersection at Aspen Valley Rd. & Perry Owens Dr., in the northbound lane, 5' west of the east curb.	2.0	(3/4") GR S(75) PG 64-22	152.2	140.3	93	92 / 96	SP	AO	
23	04/04/2024	Top Lift, Drive Lane: 100' north of the intersection at Aspen Valley Rd. & Perry Owens Dr., in the southbound lane, 5' east of the west curb.	2.0	(3/4") GR S(75) PG 64-22	152.2	141.6	95	92 / 96	SP	AO	
36	04/05/2024	Top Lift, Drive Lane: 10' north & 3' east of the southeast corner of the intersection at Aspen Valley Rd. & Sam Bass Dr.	2.0	(1/2") GR SX(75) PG 64-22	152.2	141.6	93	92 / 96	SP	DB	
37	04/05/2024	Top Lift, Drive Lane: 250' north & 3' east of the southeast corner of the intersection at Aspen Valley Rd. & Sam Bass Dr.	2.0	(1/2") GR SX(75) PG 64-22	152.2	141.2	92	92 / 96	SP	DB	
38	04/05/2024	Top Lift, Drive Lane: 500' north & 3' east of the southeast corner of the intersection at Aspen Valley Rd. & Sam Bass Dr.	2.0	(1/2") GR SX(75) PG 64-22	152.2	141.7	94	92 / 96	SP	DB	
39	04/08/2024	Top Lift, Drive Lane: 30' east of property line 11/12 on Texas Jack Dr., in the westbound lane, 4' south of the north curb.	2.0	(1/2") GR SX(75) PG 64-22	152.2	141.6	94	92 / 96	SP	AO	
40	04/08/2024	Top Lift, Drive Lane: 30' south of property line 9/10 on Willey Picket Dr., in the southbound lane, 7' east of the west curb.	2.0	(1/2") GR SX(75) PG 64-22	152.2	142.1	95	92 / 96	SP	AO	
41	04/08/2024	Top Lift, Drive Lane: 1' south of property line 19/20 on Willey Picket Dr., in the northbound lane, 7' west of the east curb.	2.0	(1/2") GR SX(75) PG 64-22	152.2	141.9	95	92 / 96	SP	AO	
42	04/08/2024	Top Lift, Drive Lane: 6' south of property line 2/3 on Willey Picket Dr., in the southbound lane, 2' east of the west curb.	2.0	(1/2") GR SX(75) PG 64-22	152.2	143.8	95	92 / 96	SP	AO	



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Density of Asphalt

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Test #	Test Date	Test Location	Lift Thickness (inches)	Mix Design	Max Density (pcf)	In Place Density (pcf)	Percent Comp.	Min/Max Comp. (%)	Rem. Code	Field Tech	Retest Of
43	04/08/2024	Top Lift, Drive Lane: 10' south of the southeast corner of the intersection at Aspen Valley Rd. & Sam Bass Dr., in the northbound lane, 9' west of the east curb.	2.0	(1/2") GR SX(75) PG 64-22	152.2	141.2	94	92 / 96	SP	AO	
44	04/08/2024	Top Lift, Drive Lane: 10' south of the southeast corner of the intersection at Aspen Valley Rd. & Sam Bass Dr., in the southbound lane, 4' east of the west curb.	2.0	(1/2") GR SX(75) PG 64-22	152.2	139.6	92	92 / 96	SP	AO	
45	04/08/2024	Top Lift, Drive Lane: 10' north of property line 33/34 on Sam Bass Dr., in the northbound lane, 6' west of the east curb.	2.0	(1/2") GR SX(75) PG 64-22	152.2	141.3	93	92 / 96	SP	AO	
46	04/08/2024	Top Lift, Drive Lane: 10' north of property line 33/34 on Sam Bass Dr., in the southbound lane, 3' east of the west curb.	2.0	(1/2") GR SX(75) PG 64-22	152.2	142.0	94	92 / 96	SP	AO	
47	04/08/2024	Top Lift, Drive Lane: 15' north of property line 46/46 on Perry Owens Dr., in the northbound lane, 3' west of the east curb.	2.0	(1/2") GR SX(75) PG 64-22	152.2	141.1	94	92 / 96	SP	AO	
48	04/08/2024	Top Lift, Drive Lane: 5' north of property line 35/36 on Perry Owens Dr., in the southbound lane, 12' east of the west curb.	2.0	(1/2") GR SX(75) PG 64-22	152.2	140.5	92	92 / 96	SP	AO	
49	04/08/2024	Top Lift, Drive Lane: 30' south of property line 48/49 on Perry Owens Dr., in the northbound lane, 12' east of the west curb.	2.0	(1/2") GR SX(75) PG 64-22	152.2	142.8	95	92 / 96	SP	AO	
50	04/12/2024	Top Lift, Drive Lane: 50' south of the southeast corner of the intersection at Wheatland Dr. & Sam Bass Dr., in the northbound lane, 9' west of the east curb.	2.0	(1/2") GR SX(75) PG 64-22	152.2	140.2	93	92 / 96	SP	AO	
51	04/12/2024	Top Lift, Drive Lane: 90' south of the southeast corner of the intersection at Wheatland Dr. & Sam Bass Dr., in the southbound lane, 10' west of the west curb.	2.0	(1/2") GR SX(75) PG 64-22	152.2	142.8	95	92 / 96	SP	AO	



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Density of Asphalt

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Test #	Test Date	Test Location	Lift Thickness (inches)	Mix Design	Max Density (pcf)	In Place Density (pcf)	Percent Comp.	Min/Max Comp. (%)	Rem. Code	Field Tech	Retest Of
52	04/12/2024	Top Lift, Drive Lane: 30' west of the northwest corner of the intersection at Willey Picket Dr. & Wheatland Dr., in the eastbound lane.	2.0	(1/2") GR SX(75) PG 64-22	152.2	141.7	94	92 / 96	SP	AO	
53	04/12/2024	Top Lift, Drive Lane: 25' E of SEC for intersection sam bass on wheatland. EBL. 10' N of S curb	2.0	(1/2") GR SX(75) PG 64-22	152.2	142.7	95	92 / 96	SP	AO	
54	04/12/2024	Top Lift, Drive Lane: 55' E of SEC for intersection perry owens on wheatland. EBL. 9' N of S curb	2.0	(1/2") GR SX(75) PG 64-22	152.2	140.8	93	92 / 96	SP	AO	
55	04/12/2024	Top Lift, Drive Lane: 40' east of the intersection at Perry Owens Dr., westbound lane, 6' south of the north curb.	2.0	(1/2") GR SX(75) PG 64-22	152.2	139.7	92	92 / 96	SP	AO	
56	04/12/2024	Top Lift, Drive Lane: 40' east of the intersection at Sam Bass Dr., westbound lane, 7' south of the north curb.	2.0	(1/2") GR SX(75) PG 64-22	152.2	141.8	94	92 / 96	SP	AO	
57	04/12/2024	Top Lift, Drive Lane: 40' east from the northwest corner of the intersection at Willey Picket, westbound lane, 8' south of the north curb.	2.0	(1/2") GR SX(75) PG 64-22	152.2	141.8	93	92 / 96	SP	AO	
58	04/12/2024	Top Lift, Drive Lane: 120' east of the southeast corner of the intersection at Robert Allison Cir., eastbound lane, 3' north of the south curb.	2.0	(1/2") GR SX(75) PG 64-22	152.2	140.7	93	92 / 96	SP	AO	
59	04/12/2024	Top Lift, Drive Lane: 300' east of the southeast corner of the intersection at Robert Allison Cir., eastbound lane, 5' north of the south curb.	2.0	(1/2") GR SX(75) PG 64-22	152.2	141.8	93	92 / 96	SP	AO	
60	04/12/2024	Top Lift, Drive Lane: 300' east of the northeast corner of the intersection at Robert Allison Cir., westbound lane, 7' north of the curb.	2.0	(1/2") GR SX(75) PG 64-22	152.2	142.7	93	92 / 96	SP	AO	



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Density of Asphalt

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Test #	Test Date	Test Location	Lift Thickness (inches)	Mix Design	Max Density (pcf)	In Place Density (pcf)	Percent Comp.	Min/Max Comp. (%)	Rem. Code	Field Tech	Retest Of
61	04/12/2024	Top Lift, Drive Lane: 120' east of the northeast corner of the intersection at Robert Allison Cir., westbound lane, 5' north of the south curb.	2.0	(1/2") GR SX(75) PG 64-22	152.2	142.6	95	92 / 96	SP	AO	
62	04/12/2024	Top Lift, Drive Lane: East of the cul-de-sac-on Wheatland Dr. & 10' west of the fire hydrant.	2.0	(1/2") GR SX(75) PG 64-22	152.2	142.5	95	92 / 96	SP	AO	

Remarks

SP : Supplied Density Pass
SF : Supplied Density Fail

Comments

Tests are determined using backscatter method.

Compressive Strength Test Reports



ENTECH
ENGINEERING, INC.
Concrete Testing Summary

Client:	SR Land, LLC	Reviewed by:	_____
Project:	Homestead North Filing 2 & 3	Reviewed by:	_____
Entech Job #:	230423	Report Date:	28-May-25

Date	Test #	Location	Slump (in)	Air (%)	Unit Weight (pcf)	Concrete Temp (°F)	Air Temp (°F)	Specified Strength	Average Strength (Days)						Summary Comments
									3	5	7	28	45	56	
12/7/2023	1	Inlet, 700' north from the end of the new bridge at Sterling Ranch Road, GPS: 38.957917 N, -104.670977 W.	3.0	6.0	142.8	72	68	4500			4870	6140			PPC Construction, Pete Lien.



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 1 **Sample #:** 130 **Placement Date:** 01/23/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Partly Cloudy **Air Temp (°F):** 43

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 5' S. and 100' W. off SW corner of Texas Jack and Tom Ketchum Dr, **Lat/Long:** 38.9703765 / -104.6700596

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
1	1901 14024179	10.00	Slump: 4 Spec: 3 - 5	Result: 7.2 Spec.: 5 - 8	138.8	70	43

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
1 / 393	7	01/30/2024	5120		Type 2
1 / 394	28	02/20/2024	6060	CP	Type 3
1 / 395	28	02/20/2024	5920	CP	Type 5
1 / 396	28	02/20/2024	5510	CP	Type 3

Average Strength (psi): 7 Day - 5120 psi, 28 Day - 5830 psi



02/25/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 2 **Sample #:** 143 **Placement Date:** 01/24/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Partly Cloudy **Air Temp (°F):** 44

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 75' S. and 5' W. off SW corner of Wheatland and Tom Ketchum **Lat/Long:** 38.9695919 / -104.6687605

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
2	2031 14024207	10.00	Slump: 4 Spec: 3 - 5	Result: 7 Spec.: 5 - 8	138.4	78	44

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
2 / 429	7	01/31/2024	4900		Type 3
2 / 430	28	02/21/2024	5720	CP	Type 2
2 / 431	28	02/21/2024	6040	CP	Type 3
2 / 432	28	02/21/2024	5900	CP	Type 2

Average Strength (psi): 7 Day - 4900 psi, 28 Day - 5890 psi



02/25/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 3 **Sample #:** 178 **Placement Date:** 01/29/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Sunny **Air Temp (°F):** 50
Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** 5'N and 5'E off NE Corner of Wheatland and Nat Love **Lat/Long:** 38.9693369 / -104.6696818

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
3	1913 14024275	10.00	Slump: 3 1/2 Spec: 3 - 5	Result: 5.8 Spec.: 5 - 8	139.2	81	50

STRENGTH DATA

Set / Specimen / Test	Age (days)	Test Date	Diameter (in)	Length (in)	Cross-Sectional Area (in²)	Max Load (lbf)	Strength (psi)	Remark	Fracture Pattern
3 / 1 / 557	7	02/05/2024	4.04	8.00	12.8	52805	4120		Type 2

02/07/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 4 **Sample #:** 182 **Placement Date:** 01/30/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Sunny **Air Temp (°F):** 54

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Between Tom Ketchum and Nat Love, Wheatland, North side **Lat/Long:** 38.9697437 / -104.6690871

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
4	2005	9.00	Slump: 3 1/2 Spec: 3 - 5	Result: 5.5 Spec.: 5 - 8	138.2	79	54

STRENGTH DATA

Set / Specimen / Test	Age (days)	Test Date	Diameter (in)	Length (in)	Cross-Sectional Area (in²)	Max Load (lbf)	Strength (psi)	Remark	Fracture Pattern
4 / 1 / 694	7	02/06/2024	3.98	8.00	12.4	54374	4370		Type 3

02/07/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 5 **Sample #:** 198 **Placement Date:** 01/31/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Cloudy **Air Temp (°F):** 55
Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** NEC of Tom Ketchum/Wheatland, 20'E & 10'N **Lat/Long:** 38.9700568 / -104.6692001

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
5	1766 14024346	8.50	Slump: 3 Spec: 3 - 5	Result: 5.3 Spec.: 5 - 8	140.0	77	55

STRENGTH DATA

Set / Specimen / Test	Age (days)	Test Date	Diameter (in)	Length (in)	Cross-Sectional Area (in²)	Max Load (lbf)	Strength (psi)	Remark	Fracture Pattern
5 / 1 / 616	7	02/07/2024	3.98	8.00	12.4	57047	4590		Type 2

02/07/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 6 **Sample #:** 204 **Placement Date:** 02/01/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Sunny **Air Temp (°F):** 52
Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** See GPS **Lat/Long:** 38.971243 / -104.6703508

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
6	1754 14024388	10.00	Slump: 4 Spec: 3 - 5	Result: 5.7 Spec.: 5 - 8	139.6	78	52

STRENGTH DATA

Set / Specimen / Test	Age (days)	Test Date	Diameter (in)	Length (in)	Cross-Sectional Area (in²)	Max Load (lbf)	Strength (psi)	Remark	Fracture Pattern
6 / 1 / 636	7	02/08/2024	3.98	8.00	12.4	61483	4940		Type 3

02/08/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 7 **Sample #:** 218 **Placement Date:** 02/02/2024 **Technician:** Marco Wiese **Weather Conditions:** Partly Cloudy **Air Temp (°F):** 44
Contractor: Baseland, LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Building Exterior - Other **Location Details:** Pond, 200' E from N end of Wheatland Dr. **Lat/Long:** 38.9711592 / -104.6683045

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
7	4030 14024436	10.00	Slump: 3 Spec: 3 - 5	Result: 7 Spec.: 5 - 8	138.4	72	44

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
7 / 690	7	02/09/2024	4590		Type 3

02/15/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 8 **Sample #:** 231 **Placement Date:** 02/05/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Sunny **Air Temp (°F):** 43
Contractor: Baseland, LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Other **Location Details:** Trickle channel, S of Wheatland at Willey Pickett Dr. **Lat/Long:** 38.9709199 / -104.6670626

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
8	2031 14024463	10.00	Slump: 3 1/2 Spec: 3 - 5	Result: 5.2 Spec.: 5 - 8	139.8	82	43

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
8 / 868	7	02/12/2024	4360		Type 2

02/15/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 9 **Sample #:** 235 **Placement Date:** 02/06/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Cloudy **Air Temp (°F):** 48
Contractor: Baseland, LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Other **Location Details:** Trickle channel **Lat/Long:** 38.9707083 / -104.6668333

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
9	1633 14024480	10.00	Slump: 4 Spec: 3 - 5	Result: 5 Spec.: 5 - 8	140.2	80	48

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
9 / 882	7	02/13/2024	5410		Type 2

02/15/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 10 **Sample #:** 249 **Placement Date:** 02/07/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Partly Cloudy **Air Temp (°F):** 48
Contractor: Baseland, LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Inlet Box **Location Details:** See GPS **Lat/Long:** 38.9734712 / -104.6640426

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
10	2005 14024544	9.75	Slump: 4 1/2 Spec: 3 - 5	Result: 5 Spec.: 5 - 8	141.0	76	48

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
10 / 811	7	02/14/2024	5790		Type 3
10 / 812	28	03/06/2024	7150	CP	Type 3
10 / 813	28	03/06/2024	6900	CP	Type 2
10 / 814	28	03/06/2024	7280	CP	Type 3

Average Strength (psi): 28 Day - 7110 psi



03/13/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 11 **Sample #:** 256 **Placement Date:** 02/08/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Partly Cloudy **Air Temp (°F):** 39
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Other **Location Details:** Channel **Lat/Long:** 38.9706582 / -104.666732

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
11	1913 14024569	6.50	Slump: 4 1/2 Spec: 3 - 5	Result: 6.2 Spec.: 5 - 8	136.8	70	39

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
11 / 878	7	02/15/2024	3960		Type 2
11 / 879	28	03/07/2024	4990	CP	Type 2
11 / 880	28	03/07/2024	5070	CP	Type 2
11 / 881	28	03/07/2024	5310	CP	Type 3

Average Strength (psi): 28 Day - 5120 psi



03/13/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 12 **Sample #:** 272 **Placement Date:** 02/13/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Sunny **Air Temp (°F):** 43
Contractor: PPC construction **Supplier:** Pete Lien **Mix Design:** 90DJ50 **Specified Strength (psi):** 4500
Placement Location: Inlet Box **Location Details:** See GPS **Lat/Long:** 38.9737958 / -104.664174

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
12	20-00315 62538	7.00	Slump: 4 1/2 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	135.6	80	43

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
12 / 982	7	02/20/2024	3630		Type 5
12 / 983	28	03/12/2024	4640	CP	Type 1
12 / 984	28	03/12/2024	4460	CP	Type 3
12 / 985	28	03/12/2024	5000	CP	Type 3

Average Strength (psi): 28 Day - 4780 psi



03/13/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 13 **Sample #:** 279 **Placement Date:** 02/14/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Sunny **Air Temp (°F):** 46
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Inlet Box **Location Details:** Inlet adjacent to Vollmer **Lat/Long:** 38.972897 / -104.668753

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
13	2001 12020243	10.00	Slump: 4 1/2 Spec: 3 - 5	Result: 7 Spec.: 5 - 8	138.8	68	46

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
13 / 1009	7	02/21/2024	3460		Type 1
13 / 1010	28	03/13/2024	5170	CP	Type 2
13 / 1011	28	03/13/2024	4960	CP	Type 2
13 / 1012	28	03/13/2024	4980	CP	Type 2

Average Strength (psi): 7 Day - 3460 psi, 28 Day - 5040 psi



03/17/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 14 **Sample #:** 303 **Placement Date:** 02/19/2024 **Technician:** James Royse **Weather Conditions:** Sunny **Air Temp (°F):** 55
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Other **Location Details:** East cutoff wall pond #3 **Lat/Long:** 38.9736817 / -104.6640533

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
14	1640 14024615	6.00	Slump: 2 Spec: 2 - 4	Result: 5 Spec.: 5 - 8	140.6	65	55

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
14 / 1003	7	02/26/2024	6000		Type 2
14 / 1004	28	03/18/2024	7260	CP	Type 3
14 / 1005	28	03/18/2024	7580	CP	Type 2
14 / 1006	28	03/18/2024	7940	CP	Type 2

Average Strength (psi):



03/22/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 15 **Sample #:** 308 **Placement Date:** 02/20/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Sunny **Air Temp (°F):** 55
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Inlet Box **Location Details:** Inlet box south of Vollmer **Lat/Long:** 38.9717617 / -104.6699628

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
15	2032 12020434	7.00	Slump: 4 1/2 Spec: 3 - 5	Result: 6.5 Spec.: 5 - 8	135.9	72	55

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
15 / 1026	7	02/27/2024	3750		Type 3
15 / 1027	28	03/19/2024	4810	CP	Type 2
15 / 1028	28	03/19/2024	4520	CP	Type 2
15 / 1029	28	03/19/2024	4650	CP	Type 2

Average Strength (psi): 28 Day - 4660 psi



03/22/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 16 **Sample #:** 330 **Placement Date:** 02/21/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Partly Cloudy **Air Temp (°F):** 55
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Inlet Box **Location Details:** Inlet box walls **Lat/Long:** 38.9730428 / -104.6688278

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
16	1740 14024655	6.00	Slump: 4 Spec: 3 - 5	Result: 5 Spec.: 5 - 8	139.9	70	55

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
16 / 1107	7	02/28/2024	5070		Type 2
16 / 1108	28	03/20/2024	6320	CP	Type 3
16 / 1109	28	03/20/2024	6280	CP	Type 2
16 / 1110	28	03/20/2024	6290	CP	Type 2

Average Strength (psi): 28 Day - 6300 psi



03/22/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 17 **Sample #:** 340 **Placement Date:** 02/22/2024 **Technician:** James Royse **Weather Conditions:** Sunny **Air Temp (°F):** 41
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Curb & Gutter **Location Details:** Curb and gutter, STA 6+00, east side of Vollmer Road **Lat/Long:** 38.9662544 / -104.6757372

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
17	1631 14024675	10.00	Slump: 2 Spec: 3 - 5	Result: 6.2 Spec.: 5 - 8	138.8	69	41

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
17 / 1147	7	02/29/2024	4670		Type 2
17 / 1148	28	03/21/2024	6500	CP	Type 2
17 / 1149	28	03/21/2024	6380	CP	Type 3
17 / 1150	28	03/21/2024	6360	CP	Type 3

Average Strength (psi): 28 Day - 6410 psi



03/22/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 18 **Sample #:** 355 **Placement Date:** 02/26/2024 **Technician:** Michael Crytser **Weather Conditions:** Sunny / Windy **Air Temp (°F):** 54
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Inlet Box **Location Details:** North bound lane of Vollmer, 40' East of GPS **Lat/Long:** 38.9736286 / -104.6685759

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
18	2105 14024750	7.25	Slump: 4 1/4 Spec: 3 - 5	Result: 6.2 Spec.: 5 - 8	137.6	78	54

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
18 / 1209	7	03/04/2024	3730		Type 2
18 / 1210	28	03/25/2024	4900	CP	Type 5
18 / 1211	28	03/25/2024	4790	CP	Type 2
18 / 1212	28	03/25/2024	5160	CP	Type 2

Average Strength (psi): 28 Day - 4950 psi



03/25/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 19 **Sample #:** 363 **Placement Date:** 02/27/2024 **Technician:** Michael Crytser **Weather Conditions:** Cloudy / Windy / Snow **Air Temp (°F):** 32
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Other **Location Details:** Trickle channel, approx 10 ft west of GPS location **Lat/Long:** 38.971116 / -104.6664764


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
19	1739 14024779	9.00	Slump: 4 Spec: 3 - 5	Result: 5.2 Spec.: 5 - 8	138.8	68	32

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
19 / 1240	7	03/05/2024	4320		Type 2
19 / 1241	28	03/26/2024	5990	CP	Type 3
19 / 1242	28	03/26/2024	5820	CP	Type 3
19 / 1243	28	03/26/2024	5810	CP	Type 2

Average Strength (psi): 28 Day - 5870 psi

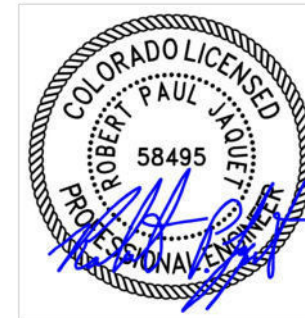

04/03/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 20 **Sample #:** 366 **Placement Date:** 02/28/2024 **Technician:** James Royse **Weather Conditions:** Sunny **Air Temp (°F):** 39
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Curb & Gutter **Location Details:** See GPS **Lat/Long:** 38.9727233 / -104.66916

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
20	1640 14024792	10.00	Slump: 1 Spec: - 3	Result: 5.2 Spec.: 5 - 8	140.7	76	39

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
20 / 1250	7	03/06/2024	4760	CP	Type 2
20 / 1251	28	03/27/2024	6170	CP	Type 2
20 / 1252	28	03/27/2024	5970	CP	Type 3
20 / 1253	28	03/27/2024	5600	CP	Type 2

Average Strength (psi): 28 Day - 5910 psi



04/03/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 22 **Sample #:** 395 **Placement Date:** 03/01/2024 **Technician:** Andrew Oswald **Weather Conditions:** Sunny **Air Temp (°F):** 51
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** 400' W. off SWC of intersection at Dines and Vollmer **Lat/Long:** 38.9669758 / -104.675137


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
22	2031 14024864	10.00	Slump: 4 Spec: 3 - 5	Result: 5.9 Spec.: 5 - 8	140.4	90	51

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
22 / 1341	7	03/08/2024	4190		Type 2
22 / 1342	28	03/29/2024	5770	CP	Type 3
22 / 1343	28	03/29/2024	5540	CP	Type 2
22 / 1344	28	03/29/2024	6020	CP	Type 3

Average Strength (psi):

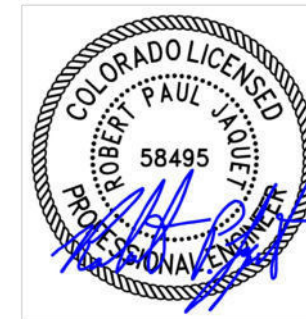

04/03/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 23 **Sample #:** 433 **Placement Date:** 03/04/2024 **Technician:** James Royse **Weather Conditions:** Sunny **Air Temp (°F):** 45
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** Vollmer Road, S of Dines Road, N of Glider Loop **Lat/Long:** 38.965833 / -104.676389


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
23	2034 14024923	10.00	Slump: 3 3/4 Spec: 3 - 5	Result: 5.5 Spec.: 5 - 8	139.3	75	45

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
23 / 1425	7	03/11/2024	3580		Type 1
23 / 1426	28	04/01/2024	6360	CP	Type 2
23 / 1427	28	04/01/2024	6510	CP	Type 2
23 / 1428	28	04/01/2024	6210	CP	Type 2

Average Strength (psi): 7 Day - 3580 psi, 28 Day - 6410 psi

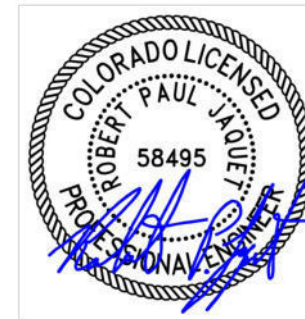

04/03/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 24 **Sample #:** 435 **Placement Date:** 03/05/2024 **Technician:** Jack Bowyer **Weather Conditions:** Sunny / Windy **Air Temp (°F):** 36
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Other **Location Details:** West side of trickle channel **Lat/Long:** 38.9738195 / -104.6631034

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
24	2005 14024940	8.00	Slump: 3 1/2 Spec: 3 - 5	Result: 5.5 Spec.: 5 - 8	139.2	70	36

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
24 / 1487	7	03/12/2024	4700		Type 2
24 / 1488	28	04/02/2024	6270	CP	Type 2
24 / 1489	28	04/02/2024	6110	CP	Type 2
24 / 1490	28	04/02/2024	6080	CP	Type 3

Average Strength (psi): 28 Day - 6150 psi



04/03/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2
Homestead at Sterling Ranch F2
Colorado Springs, CO

Set #: 25 **Sample #:** 447 **Placement Date:** 03/06/2024 **Technician:** Michael Crytser **Weather Conditions:** Sunny / Windy **Air Temp (°F):** 47
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Other **Location Details:** Trickle channel, 70' N from S channel exit **Lat/Long:** 38.9739224 / -104.6625463


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
25	4029 14024970	10.00	Slump: 4 Spec: 3 - 5	Result: 5 Spec.: 5 - 8	138.8	82	47

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
25 / 1541	7	03/13/2024	4060		Type 2
25 / 1542	28	04/03/2024	6090	CP	Type 3
25 / 1543	28	04/03/2024	5600	CP	Type 2
25 / 1544	28	04/03/2024	5890	CP	Type 2

Average Strength (psi): 28 Day - 5860 psi

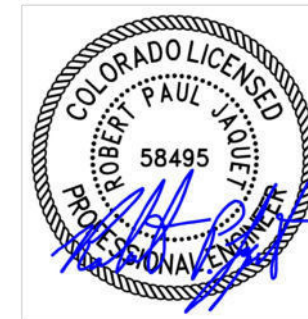

04/03/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 26 **Sample #:** 460 **Placement Date:** 03/07/2024 **Technician:** Michael Crytser **Weather Conditions:** Sunny / Windy **Air Temp (°F):** 40
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** 100' W of intersection at Wheatland Drive and Vollmer Road **Lat/Long:** 38.9651304 / -104.6766132

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
26	1740 14025005	10.00	Slump: 5 1/4 Spec: 3 - 5	Result: 5.2 Spec.: 5 - 8	138.8	82	40

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
26 / 1591	7	03/14/2024	3640		Type 2
26 / 1592	28	04/04/2024	4710	CP	Type 2
26 / 1593	28	04/04/2024	4540	CP	Type 2
26 / 1594	28	04/04/2024	4310	CP	Type 3

Average Strength (psi): 28 Day - 4520 psi



04/11/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 27 **Sample #:** 484 **Placement Date:** 03/11/2024 **Technician:** James Royse **Weather Conditions:** Partly Cloudy **Air Temp (°F):** 52
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Other **Location Details:** 3' channel, Pond #3 **Lat/Long:** 38.9737364 / -104.6646397


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
27	2034 14925046	10.00	Slump: 3 Spec: 3 - 5	Result: 5.4 Spec.: 5 - 8	137.6	73	52

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
27 / 1661	7	03/18/2024	3970		Type 2
27 / 1662	28	04/08/2024	5200	CP	Type 2
27 / 1663	28	04/08/2024	4940	CP	Type 3
27 / 1664	28	04/08/2024	5090	CP	Type 3

Average Strength (psi): 28 Day - 5080 psi

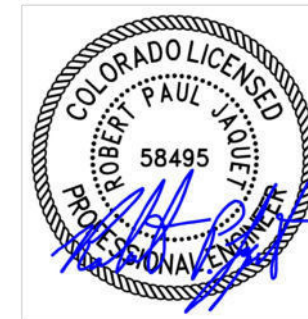

04/11/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 28 **Sample #:** 499 **Placement Date:** 03/12/2024 **Technician:** James Royse **Weather Conditions:** Sunny **Air Temp (°F):** 46
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4000
Placement Location: Other **Location Details:** 3' channel, pond 2 **Lat/Long:** 38.973623 / -104.6644906


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
28	1740 14025109	6.00	Slump: 6 Spec: 4 - 6	Result: 7.4 Spec.: 4.5 - 7.5	134.0	68	46

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
28 / 1714	7	03/19/2024	3450		Type 3
28 / 1719	28	04/09/2024	4320	CP	Type 2
28 / 1720	28	04/09/2024	4140	CP	Type 2
28 / 1721	28	04/09/2024	4500	CP	Type 3

Average Strength (psi): 28 Day - 4320 psi

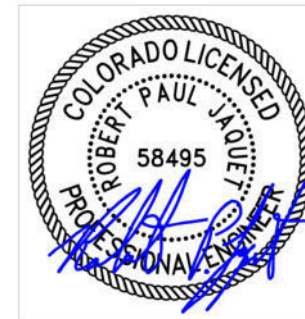

04/11/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 29 **Sample #:** 515 **Placement Date:** 03/13/2024 **Technician:** Jack Bowyer **Weather Conditions:** Cloudy / Windy **Air Temp (°F):** 42

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 10' E and 10' N of NEC of Briargate Parkway and Vollmer Rd **Lat/Long:** 38.9704494 / -104.6716413


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
29	4030 14025172	10.00	Slump: 3 1/2 Spec: 3 - 5	Result: 5.6 Spec.: 5 - 8	138.4	70	42

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
29 / 1795	7	03/20/2024	3450		Type 2
29 / 1796	28	04/10/2024	4890	CP	Type 3
29 / 1797	28	04/10/2024	4080	CP	Type 1
29 / 1798	28	04/10/2024	4800	CP	Type 2

Average Strength (psi): 28 Day - 4850 psi

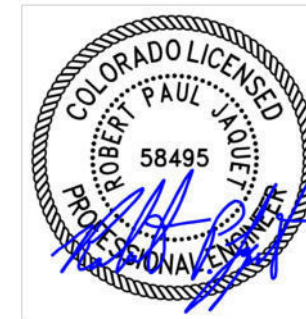

04/11/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 30 **Sample #:** 597 **Placement Date:** 03/26/2024 **Technician:** Michael Crytser **Weather Conditions:** Sunny **Air Temp (°F):** 36

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Crosspan **Location Details:** East Center of Crosspan at intersection of Vollmer and Jane Kirkham **Lat/Long:** 38.9707803 / -104.669324


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
30	2033 14025354	13.50	Slump: 3 1/2 Spec: 3 - 5	Result: 6.5 Spec.: 5 - 8	138.0	75	36

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
30 / 2108	7	04/02/2024	3750		Type 2
30 / 2109	28	04/23/2024	4670	CP	Type 2
30 / 2110	28	04/23/2024	5060	CP	Type 3
30 / 2111	28	04/23/2024	5090	CP	Type 2

Average Strength (psi): 28 Day - 4940 psi

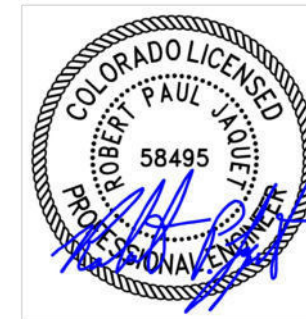

04/23/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 31 **Sample #:** 614 **Placement Date:** 03/27/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Cloudy **Air Temp (°F):** 43
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** Inlet box along Jane Kirkham and Vollmer **Lat/Long:** 38.971575 / -104.670499


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
31	1751 14025394	8.00	Slump: 4 1/4 Spec: 3 - 5	Result: 5 Spec.: 5 - 8	140.2	75	43

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
31 / 2141	7	04/03/2024	4280		Type 2
31 / 2142	28	04/24/2024	5250	CP	Type 3
31 / 2143	28	04/24/2024	6330	CP	Type 2
31 / 2144	28	04/24/2024	5780	CP	Type 2

Average Strength (psi): 28 Day - 5790 psi

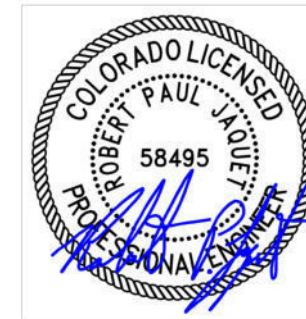

04/30/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 32 **Sample #:** 632 **Placement Date:** 03/28/2024 **Technician:** Michael Crytser **Weather Conditions:** Sunny **Air Temp (°F):** 56
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Curb & Gutter **Location Details:** Curb and gutter, NE corner of Vollmer and Sam Bass **Lat/Long:** 38.9730426 / -104.6687791


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
32	4025 14025434	7.00	Slump: 3 Spec: 3 - 5	Result: 7.8 Spec.: 5 - 8	135.6	85	56

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
32 / 2222	7	04/04/2024	3500	CP	Type 3
32 / 2223	28	04/25/2024	4310	CF	Type 3
32 / 2224	56	05/23/2024	5220	CP	Type 2
32 / 2225	56	05/23/2024	5070	CP	Type 2

Average Strength (psi): 7 Day - 3500 psi, 28 Day - 4310 psi, 56 Day - 5150 psi

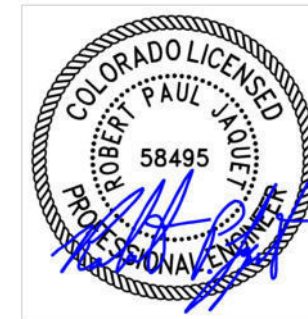

05/24/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 34 **Sample #:** 656 **Placement Date:** 04/01/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Cloudy **Air Temp (°F):** 36

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Inlet Box **Location Details:** Inlet slab, North side, 50' E and 50' N off SE corner of intersection at Vollmer and Marksheffel **Lat/Long:** 38.9571952 / -104.6865865


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
34	231 14025530	8.75	Slump: 4 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	140.4	72	36

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
34 / 2336	7	04/08/2024	4430		Type 3
34 / 2337	28	04/29/2024	5760	CP	Type 3
34 / 2338	28	04/29/2024	6380	CP	Type 2
34 / 2339	28	04/29/2024	6280	CP	Type 2

Average Strength (psi): 28 Day - 6140 psi

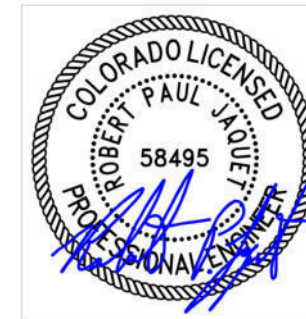

04/30/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 35 **Sample #:** 671 **Placement Date:** 04/02/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Sunny / Windy **Air Temp (°F):** 36
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Curb & Gutter **Location Details:** Curb and Gutter, 50' South of Vollmer on Sam Bass Drive **Lat/Long:** 38.9729516 / -104.6684951


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
35	2106 14025548	8.00	Slump: 3 1/2 Spec: 3 - 5	Result: 5.5 Spec.: 5 - 8	141.2	70	36

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
35 / 2352	7	04/09/2024	4230		Type 2
35 / 2353	28	04/30/2024	5770	CP	Type 2
35 / 2354	28	04/30/2024	6090	CP	Type 2
35 / 2355	28	04/30/2024	5950	CP	Type 2

Average Strength (psi): 28 Day - 5940 psi

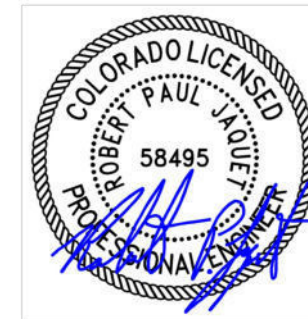

05/03/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 36 **Sample #:** 681 **Placement Date:** 04/03/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Sunny / Windy **Air Temp (°F):** 53

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Curb & Gutter **Location Details:** 20' East off SE corner of intersection at Briargate and Vollmer **Lat/Long:** 38.9702013 / -104.6713171


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
36	1740 14025585	10.00	Slump: 4 1/2 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	138.4	78	53

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
36 / 2360	7	04/10/2024	3900		Type 3
36 / 2361	28	05/01/2024	5110	CP	Type 2
36 / 2362	28	05/01/2024	5020	CP	Type 2
36 / 2363	28	05/01/2024	5240	CP	Type 3

Average Strength (psi): 28 Day - 5120 psi

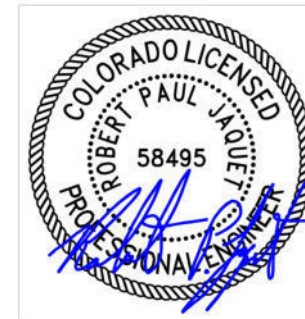

05/03/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 37 **Sample #:** 696 **Placement Date:** 04/04/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Sunny **Air Temp (°F):** 60

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Sidewalk, south side of Vollmer, 15' West off intersection of Sam Bass and Vollmer **Lat/Long:** 38.9727633 / -104.6683583


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
37	1740 14025636	10.00	Slump: 5 Spec: 3 - 5	Result: 5.5 Spec.: 5 - 8	137.6	80	60

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
37 / 2428	7	04/11/2024	3700		Type 2
37 / 2429	28	05/02/2024	5200	CP	Type 2
37 / 2430	28	05/02/2024	5260	CP	Type 2
37 / 2431	28	05/02/2024	5050	CP	Type 2

Average Strength (psi): 28 Day - 5170 psi

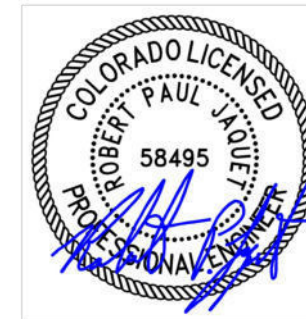

05/03/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 38 **Sample #:** 708 **Placement Date:** 04/05/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Partly Cloudy **Air Temp (°F):** 59

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Inlet Box **Location Details:** Inlet bolt box, 300' North off intersection of Vollmer and Markscheffel **Lat/Long:** 38.9582735 / -104.6866163


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
38	1631 14025686	8.00	Slump: 4 Spec: 3 - 5	Result: 5.5 Spec.: 5 - 8	137.7	80	59

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
38 / 2444	7	04/12/2024	4280		Type 2
38 / 2445	28	05/03/2024	5600	CP	Type 3
38 / 2446	28	05/03/2024	5560	CP	Type 2
38 / 2447	28	05/03/2024	5910	CP	Type 2

Average Strength (psi): 28 Day - 5690 psi

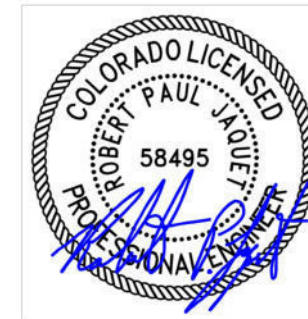

05/03/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 39 **Sample #:** 723 **Placement Date:** 04/08/2024 **Technician:** Devin Brady **Weather Conditions:** Sunny **Air Temp (°F):** 41
Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4000

Placement Location: Sidewalk

Location Details: Vollmer Road, 60' N. and 1' W. off the SE corner of intersection with Sam Bass Drive


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
39	1631 14025726	10.00	Slump: 3 1/2 Spec: 3 - 4	Result: 5.5 Spec.: 5 - 8	139.8	67	41

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
39 / 2838	9	04/15/2024	3260		Type 2
39 / 2839	28	05/06/2024	4040	CP	Type 3
39 / 2840	28	05/06/2024	4540	CP	Type 3
39 / 2841	28	05/06/2024	4200	CP	Type 2

Average Strength (psi): 9 Day - 3260 psi, 28 Day - 4260 psi

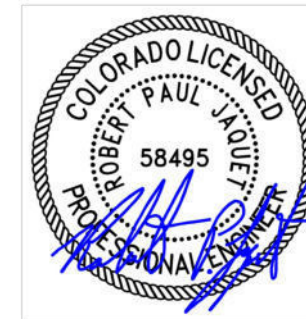

05/06/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 40 **Sample #:** 731 **Placement Date:** 04/09/2024 **Technician:** Michael Crytser **Weather Conditions:** Partly Cloudy / Windy **Air Temp (°F):** 40
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** 60' E. East of Vollmer Road at GPS **Lat/Long:** 38.9742636 / -104.6687276


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
40	2034 14025761	10.00	Slump: 4 Spec: 3 - 5	Result: 5.5 Spec.: 5 - 8	138.0	85	40

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
40 / 2583	7	04/16/2024	3790		Type 3
40 / 2584	28	05/07/2024	4410	CF	Type 2
40 / 2585	28	05/07/2024	4460	CF	Type 2
40 / 2586	56	06/04/2024	4470		Type 2

Average Strength (psi): 8 Day - 3790 psi, 28 Day - 4430 psi, 56 Day - 4470 psi

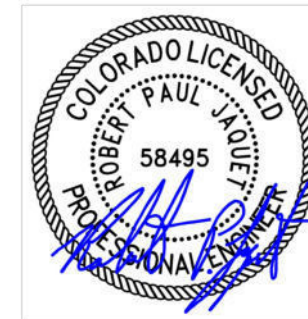

06/11/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 41 **Sample #:** 744 **Placement Date:** 04/10/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Partly Cloudy **Air Temp (°F):** 46

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Vollmer Road, south side, 100' West from intersection with Timber Ridge **Lat/Long:** 38.9747074 / -104.6685728

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
41	2033 14025796	10.00	Slump: 4 1/2 Spec: 3 - 5	Result: 5 Spec.: 5 - 8	139.6	70	46

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
41 / 2644	7	04/17/2024	4660		Type 2
41 / 2645	28	05/08/2024	5310	CP	Type 2
41 / 2646	28	05/08/2024	5930	CP	Type 2
41 / 2647	28	05/08/2024	5600	CP	Type 2

Average Strength (psi): 28 Day - 5620 psi



05/13/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 42 **Sample #:** 760 **Placement Date:** 04/11/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Sunny **Air Temp (°F):** 43
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** South side Vollmer, 250' West of Poco Road **Lat/Long:** 38.9753233 / -104.66838


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
42	4015 12021529	10.00	Slump: 5 Spec: 3 - 5	Result: 7 Spec.: 5 - 8	135.1	79	43

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
42 / 2711	7	04/18/2024	2870		Type 2
42 / 2712	28	05/09/2024	4180	CF	Type 3
42 / 2713	56	06/06/2024	5320	CP	Type 2
42 / 2714	56	06/06/2024	5080	CP	Type 3

Average Strength (psi): 7 Day - 2870 psi, 28 Day - 4180 psi, 56 Day - 5200 psi

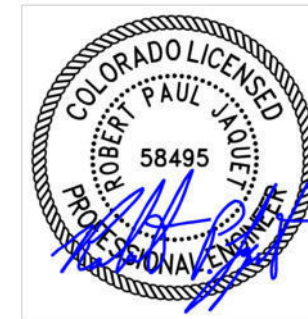

06/11/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 43 **Sample #:** 783 **Placement Date:** 04/12/2024 **Technician:** Michael Crytser **Weather Conditions:** Sunny **Air Temp (°F):** 62
Contractor: Baseland **Supplier:** Cementech **Mix Design:** CDOT_Class_D **Specified Strength (psi):** 4500
Placement Location: Other **Location Details:** No concrete placed, only for testing purposes **Lat/Long:** 38.9003715 / -104.832455

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
43	N/A 162	10.00	Slump: 4 1/2 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	133.2	65	62

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
43 / 2842	7	04/19/2024	120	CF	Type 3
43 / 2843	28	05/10/2024	130	CF	Type 3
43 / 2844	56	06/07/2024	160	CF	Type 3
43 / 2845	90	07/11/2024	140	CF	Type 3

Average Strength (psi): 7 Day - 120 psi, 28 Day - 130 psi, 56 Day - 160 psi, 90 Day - 140 psi

08/06/2024

Reviewed by: Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 44 **Sample #:** 791 **Placement Date:** 04/15/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Sunny **Air Temp (°F):** 63
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** Sidewalk, south side Vollmer, 50' W. off Poco Road **Lat/Long:** 38.9763017 / -104.6681967

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
44	426 14025907	10.00	Slump: 4 1/2 Spec: 3 - 5	Result: 7 Spec.: 5 - 8	137.1	68	63

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
44 / 2778	7	04/22/2024	4400		Type 3
44 / 2779	28	05/13/2024	4850	CP	Type 3
44 / 2780	28	05/13/2024	5220	CP	Type 2
44 / 2781	28	05/13/2024	4740	CP	Type 2

Average Strength (psi): 28 Day - 4940 psi



05/13/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 45 **Sample #:** 804 **Placement Date:** 04/16/2024 **Technician:** Jack Bowyer **Weather Conditions:** Sunny / Windy **Air Temp (°F):** 42
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4000
Placement Location: Sidewalk **Location Details:** Sidewalk on N side of Texas Jack Rd & Willy Picket Dr **Lat/Long:** 38.9720803 / -104.6688099

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
45	4026 14025949	10.00	Slump: 4 Spec: 3 - 5	Result: 5.4 Spec.: 5 - 8	139.8	68	42

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
45 / 2866	7	04/23/2024	4170		Type 4
45 / 2867	28	05/14/2024	5380	CP	Type 2
45 / 2868	28	05/14/2024	5400	CP	Type 2
45 / 2869	28	05/14/2024	5600	CP	Type 2

Average Strength (psi): 7 Day - 4170 psi, 28 Day - 5460 psi



05/20/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 46 **Sample #:** 814 **Placement Date:** 04/17/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Partly Cloudy **Air Temp (°F):** 54
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** Sidewalk across from 8249 Willy Pickett **Lat/Long:** 38.9717781 / -104.6677099

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
46	1631 14025993	10.00	Slump: 4 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	139.8	65	54

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
46 / 2899	7	04/24/2024	4450		Type 3
46 / 2900	28	05/15/2024	5560	CP	Type 2
46 / 2901	28	05/15/2024	5500	CP	Type 2
46 / 2902	28	05/15/2024	5800	CP	Type 3

Average Strength (psi): 28 Day - 5620 psi



05/20/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 47 **Sample #:** 830 **Placement Date:** 04/18/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Cloudy **Air Temp (°F):** 30
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Curb & Gutter **Location Details:** 9413 Cut Bank **Lat/Long:** 38.9660772 / -104.6701506

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
47	1751 14026042	10.00	Slump: 4 Spec: 3 - 5	Result: 5.5 Spec.: 5 - 8	140.4	70	30

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
47 / 2935	7	04/25/2024	5450		Type 3
47 / 2936	28	05/16/2024	7130	CP	Type 2
47 / 2937	28	05/16/2024	6780	CP	Type 2
47 / 2938	28	05/16/2024	7410	CP	Type 2

Average Strength (psi): 28 Day - 7110 psi



05/20/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 48 **Sample #:** 839 **Placement Date:** 04/19/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Cloudy **Air Temp (°F):** 29

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Sidewalk and crossspan at intersection of Vollmer and Willy Pickett **Lat/Long:** 38.9728241 / -104.6686361

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
48	4025 14026080	10.00	Slump: 4 Spec: 3 - 5	Result: 5.5 Spec.: 5 - 8	139.7	68	29

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
48 / 2963	7	04/26/2024	5290		Type 2
48 / 2964	28	05/17/2024	6590	CP	Type 3
48 / 2965	28	05/17/2024	5830	CP	Type 2
48 / 2966	28	05/17/2024	5720	CP	Type 2

Average Strength (psi): 28 Day - 6050 psi



05/20/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 49 **Sample #:** 853 **Placement Date:** 04/22/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Sunny / Partly Cloudy **Air Temp (°F):** 64

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 300' S. and 5' W. off SW corner of Texas Jack Drive and Willey Picket Drive **Lat/Long:** 38.9712461 / -104.6686513

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
49	1766 14026149	10.00	Slump: 4 Spec: 2 - 4	Result: 5.5 Spec.: 5 - 8	140.0	80	64

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
49 / 3101	7	04/29/2024	4090		Type 2
49 / 3102	28	05/20/2024	4630	CP	Type 2
49 / 3103	28	05/20/2024	5310	CP	Type 2
49 / 3104	28	05/20/2024	5100	CP	Type 2

Average Strength (psi): 28 Day - 5020 psi



05/21/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 50 **Sample #:** 863 **Placement Date:** 04/23/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Partly Cloudy **Air Temp (°F):** 53

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Sidewalk with approach, SE corner of intersection at Sam Bass and Wheatland **Lat/Long:** 38.9718987 / -104.6683854

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
50	2105 14026220	10.00	Slump: 4 1/2 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	138.4	78	53

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
50 / 3050	7	04/30/2024	4010		Type 3
50 / 3051	28	05/21/2024	5150	CP	Type 3
50 / 3052	28	05/21/2024	5170	CP	Type 3
50 / 3053	28	05/21/2024	5490	CP	Type 2

Average Strength (psi): 28 Day - 5270 psi



05/21/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 51 **Sample #:** 870 **Placement Date:** 04/24/2024 **Technician:** Jack Bowyer **Weather Conditions:** Sunny **Air Temp (°F):** 38
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4000
Placement Location: Sidewalk **Location Details:** 15' SW off SW corner of 9413 Cut Bank Dr. **Lat/Long:** 38.9657175 / -104.6700982


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
51	4030 14026254	10.00	Slump: 4 1/4 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	138.4	63	38

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
51 / 3066	7	05/01/2024	4230		Type 2
51 / 3067	28	05/22/2024	5260	CP	Type 2
51 / 3068	28	05/22/2024	5200	CP	Type 3
51 / 3069	28	05/22/2024	5210	CP	Type 2

Average Strength (psi): 28 Day - 5230 psi

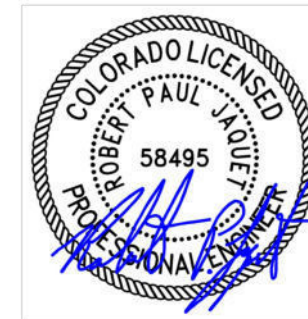

05/24/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 52 **Sample #:** 901 **Placement Date:** 04/25/2024 **Technician:** Andrew Oswald **Weather Conditions:** Sunny **Air Temp (°F):** 50

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Sidewalk on S. side of Wheatland Drive, 40' E. off SE corner of intersection with Sam Bass **Lat/Long:** 38.9717891 / -104.6663006


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
52	1640 14026312	20.00	Slump: 4 Spec: 3 - 5	Result: 6.4 Spec.: 4.5 - 7.5	140.4	80	50

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
52 / 3216	7	05/02/2024	4100		Type 3
52 / 3217	28	05/23/2024	5240	CP	Type 2
52 / 3218	28	05/23/2024	5120	CP	Type 2
52 / 3219	28	05/23/2024	5430	CP	Type 2

Average Strength (psi): 28 Day - 5260 psi

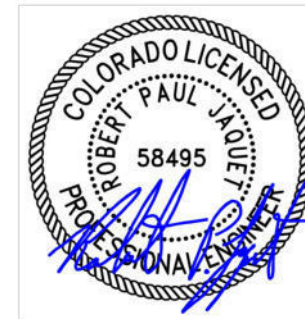

05/24/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 53 **Sample #:** 922 **Placement Date:** 04/26/2024 **Technician:** Jack Bowyer **Weather Conditions:** Sunny **Air Temp (°F):** 46

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4000

Placement Location: Sidewalk **Location Details:** Sidewalk, 20' S. off NE corner of Wheatland & Perry Owen's Dr **Lat/Long:** 38.9722004 / -104.6663548

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
53	1740 14026367	10.00	Slump: 3 1/2 Spec: 3 - 5	Result: 5.6 Spec.: 5 - 8	138.4	65	46

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
53 / 3297	7	05/03/2024	4550		Type 2
53 / 3298	28	05/24/2024	5440	CP	Type 3
53 / 3299	28	05/24/2024	5190	CP	Type 3
53 / 3300	28	05/24/2024	5320	CP	Type 2

Average Strength (psi): 28 Day - 5320 psi



05/30/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 54 **Sample #:** 935 **Placement Date:** 04/29/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Sunny / Partly Cloudy **Air Temp (°F):** 52

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 150' S and 20' W off SW corner of Wheatland and Robert Allison Circle **Lat/Long:** 38.9721574 / -104.6655158

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
54	2034 14026405	10.00	Slump: 4 Spec: 2 - 6	Result: 5.5 Spec.: 5 - 8	138.8	67	52

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
54 / 3385	7	05/06/2024	3450		Type 2
54 / 3386	28	05/27/2024	4960	CP	Type 3
54 / 3387	28	05/27/2024	4940	CP	Type 3
54 / 3388	28	05/27/2024	4660	CP	Type 3

Average Strength (psi): 29 Day - 4850 psi



05/30/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 55 **Sample #:** 947 **Placement Date:** 04/30/2024 **Technician:** Devin Brady **Weather Conditions:** Sunny **Air Temp (°F):** 57
Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4000

Placement Location: Sidewalk **Location Details:** Robert Allison Cir, 60' S and 3' E. off NE corner of intersection at Wheatland Drive **Lat/Long:** 38.9738745 / -104.66160683

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
55	4205 14026443	20.00	Slump: 4 Spec: 3 - 5	Result: 6.5 Spec.: 4.5 - 7.5	139.8	65	57

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
55 / 3719	7	05/07/2024	2800		Type 3
55 / 3720	28	05/28/2024	4300	CP	Type 3
55 / 3721	28	05/28/2024	3950	CP	Type 3
55 / 3722	28	05/28/2024	3980	CP	Type 3

Average Strength (psi): 28 Day - 4080 psi



05/30/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 56 **Sample #:** 957 **Placement Date:** 05/01/2024 **Technician:** Michael Crytser **Weather Conditions:** Sunny / Windy **Air Temp (°F):** 44
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** 5' S. off SE corner of Wheatland and Robert Allison Circle **Lat/Long:** 38.9727367 / -104.6660133

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
56	1915 14026497	10.00	Slump: 4 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	140.0	60	44

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
56 / 3377	7	05/08/2024	4720	CP	Type 3
56 / 3378	28	05/29/2024	5460	CP	Type 2
56 / 3379	28	05/29/2024	5730	CP	Type 2
56 / 3380	28	05/29/2024	5930	CP	Type 2

Average Strength (psi): 28 Day - 5700 psi



05/30/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 57 **Sample #:** 979 **Placement Date:** 05/02/2024 **Technician:** Ben Westhues **Weather Conditions:** Sunny / Partly Cloudy **Air Temp (°F):** 41

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 9748 Wheatland Drive, South side of street. 25' West of transformer box. **Lat/Long:** 38.9729234 / -104.6650892

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
57	2031 14026569	10.00	Slump: 4 1/2 Spec: 3 - 5	Result: 5.5 Spec.: 5 - 8	137.6	65	41

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
57 / 3475	7	05/09/2024	4130		Type 3
57 / 3476	28	05/30/2024	5640	CP	Type 2
57 / 3477	28	05/30/2024	5370	CP	Type 3
57 / 3478	28	05/30/2024	5650	CP	Type 2

Average Strength (psi): 28 Day - 5560 psi



05/30/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 58 **Sample #:** 989 **Placement Date:** 05/03/2024 **Technician:** Evan Padilla **Weather Conditions:** Sunny / Cloudy **Air Temp (°F):** 64
Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** South side of round-a-bout, 30' W of fire hydrant **Lat/Long:** 38.9732587 / -104.6636592

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
58	1740 14026620	8.50	Slump: 4 Spec: 3 - 5	Result: 5.5 Spec.: 5 - 8	142.0	70	64

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
58 / 3515	7	05/10/2024	3550		Type 2
58 / 3516	28	05/31/2024	4930	CP	Type 3
58 / 3517	28	05/31/2024	5010	CP	Type 2
58 / 3518	28	05/31/2024	5310	CP	Type 3

Average Strength (psi): 28 Day - 5080 psi



06/03/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 59 **Sample #:** 1010 **Placement Date:** 05/07/2024 **Technician:** Jack Bowyer **Weather Conditions:** Sunny / Windy **Air Temp (°F):** 46
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4000
Placement Location: Sidewalk **Location Details:** Sidewalk 15' N, 3' E off NW corner of 9767 Wheatland Dr **Lat/Long:** 38.973155 / -104.664215

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
59	4030 12022460	10.00	Slump: 4 Spec: 3 - 5	Result: 7.9 Spec.: 5 - 8	136.0	62	46

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
59 / 3567	7	05/14/2024	3330		Type 2
59 / 3568	28	06/04/2024	3920	CF	Type 2
59 / 3569	28	06/04/2024	3920	CF	Type 5
59 / 3570	56	07/02/2024	4560	CP	Type 2

Average Strength (psi): 7 Day - 3330 psi, 28 Day - 3920 psi, 56 Day - 4560 psi



07/08/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 60 **Sample #:** 1015 **Placement Date:** 05/08/2024 **Technician:** Jack Bowyer **Weather Conditions:** Sunny / Windy **Air Temp (°F):** 38

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Sidewalk, 15' S. and 15' W. off SE corner of 9748 Wheatland Dr. **Lat/Long:** 38.9729451 / -104.6648804

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
60	2033 1402	11.00	Slump: 3 1/2 Spec: 3 - 5	Result: 6.2 Spec.: 5 - 8	141.2	63	38

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
60 / 3603	7	05/15/2024	5010		Type 2
60 / 3604	28	06/05/2024	5940	CP	Type 2
60 / 3605	28	06/05/2024	6400	CP	Type 3
60 / 3606	28	06/05/2024	6420	CP	Type 2

Average Strength (psi): 28 Day - 6250 psi



06/05/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 61 **Sample #:** 1027 **Placement Date:** 05/09/2024 **Technician:** Jack Bowyer **Weather Conditions:** Cloudy / Windy **Air Temp (°F):** 40

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Sidewalk, 20' N., 10' E. of NE corner of 8167 Perry Owen's Dr. **Lat/Long:** 38.9730932 / -104.6679409


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
61	2106 14026774	10.00	Slump: 3 Spec: 3 - 5	Result: 5.5 Spec.: 5 - 8	143.2	60	40

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
61 / 3739	7	05/16/2024	5200		Type 2
61 / 3740	28	06/06/2024	6930		Type 3
61 / 3741	28	06/06/2024	6640		Type 2
61 / 3742	28	06/06/2024	6270		Type 2

Average Strength (psi): 28 Day - 6610 psi

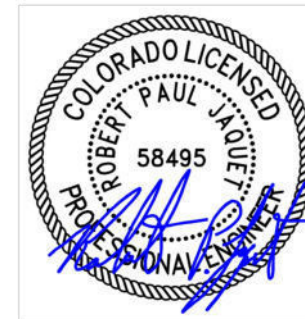

06/11/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 62 **Sample #:** 1046 **Placement Date:** 05/13/2024 **Technician:** Jack Bowyer **Weather Conditions:** Sunny **Air Temp (°F):** 55

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 10' E. and 5' N. off NE corner of Perry Owen's Dr. & Wheatland Dr. **Lat/Long:** 38.9723033 / -104.6661238


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
62	1631 14026842	10.00	Slump: 3 1/2 Spec: 3 - 5	Result: 5 Spec.: 5 - 8	141.2	70	55

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
62 / 3759	7	05/20/2024	4760		Type 3
62 / 3760	28	06/10/2024	6140	CP	Type 3
62 / 3761	28	06/10/2024	5820	CP	Type 2
62 / 3762	28	06/10/2024	6280	CP	Type 3

Average Strength (psi): 28 Day - 6080 psi

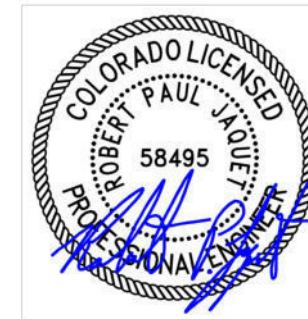

06/11/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 63 **Sample #:** 1055 **Placement Date:** 05/14/2024 **Technician:** Jack Bowyer **Weather Conditions:** Sunny **Air Temp (°F):** 59

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Sidewalk, 18' S. off NE corner of Perry Owen's Dr. & Aspen Valley **Lat/Long:** 38.9725444 / -104.6670683


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
63	1640 14026883	10.00	Slump: 4 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	139.2	65	59

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
63 / 3800	7	05/21/2024	4480		Type 3
63 / 3801	28	06/11/2024	5480	CP	Type 2
63 / 3802	28	06/11/2024	5490	CP	Type 2
63 / 3803	28	06/11/2024	5340	CP	Type 2

Average Strength (psi): 28 Day - 5440 psi

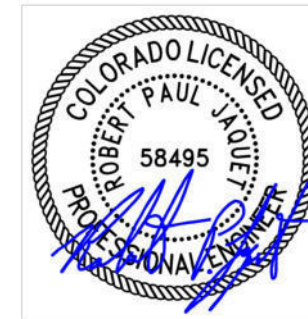

06/12/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 64 **Sample #:** 1070 **Placement Date:** 05/15/2024 **Technician:** Jack Bowyer **Weather Conditions:** Sunny **Air Temp (°F):** 44

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 5' S, 10' W off SW corner of Aspen Valley Rd & Perry Owens Dr **Lat/Long:** 38.9725177 / -104.6674244


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
64	1640 14026923	10.00	Slump: 4 Spec: 3 - 5	Result: 5.3 Spec.: 5 - 8	141.2	70	44

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
64 / 3836	7	05/22/2024	3840		Type 2
64 / 3837	28	06/12/2024	5060	CP	Type 3
64 / 3838	28	06/12/2024	5100	CP	Type 3
64 / 3839	28	06/12/2024	5420	CP	Type 2

Average Strength (psi): 28 Day - 5190 psi

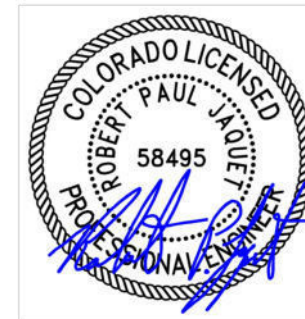

06/14/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 65 **Sample #:** 1087 **Placement Date:** 05/16/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Sunny / Partly Cloudy **Air Temp (°F):** 62

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 5' W and 50' S off NW corner of Aspen Valley Rd and Perry Owens Dr **Lat/Long:** 38.9725277 / -104.6670072


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
65	2105 14026989	10.00	Slump: 3 1/4 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	140.4	78	62

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
65 / 3895	7	05/23/2024	4060		Type 3
65 / 3896	28	06/13/2024	5040	CP	Type 2
65 / 3897	28	06/13/2024	4990	CP	Type 3
65 / 3898	28	06/13/2024	4610	CP	Type 3

Average Strength (psi): 7 Day - 4060 psi, 28 Day - 4880 psi

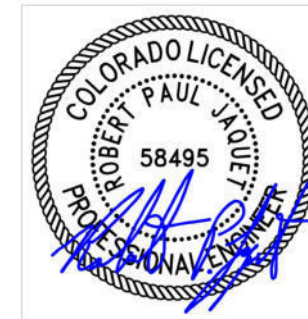

06/14/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 66 **Sample #:** 1092 **Placement Date:** 05/17/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Sunny **Air Temp (°F):** 64

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 75' W of SW corner intersection at Sam Bass and Wheatland **Lat/Long:** 38.9712933 / -104.6668275


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
66	4026 14027008	10.00	Slump: 4 Spec: 3 - 5	Result: 7 Spec.: 5 - 8	139.0	76	64

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
66 / 3899	7	05/24/2024	3520		Type 3
66 / 3900	28	06/14/2024	4460	CP	Type 2
66 / 3901	28	06/14/2024	4610	CP	Type 2
66 / 3902	28	06/14/2024	4510	CP	Type 3

Average Strength (psi): 28 Day - 4530 psi

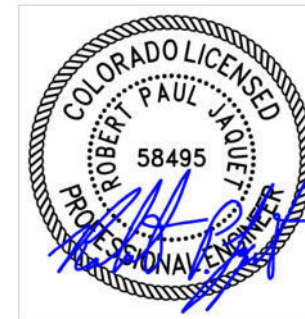

06/14/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 67 **Sample #:** 1126 **Placement Date:** 05/21/2024 **Technician:** Michael Crytser **Weather Conditions:** Sunny **Air Temp (°F):** 47

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 50' West off NW corner of intersection at Aspen Valley and Perry Owen's **Lat/Long:** 38.9731512 / -104.6679805

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
67	4015 14027113	10.00	Slump: 4 Spec: 3 - 5	Result: 7.5 Spec.: 5 - 8	139.2	68	47

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
67 / 4076	7	05/28/2024	3670		Type 3
67 / 4077	28	06/18/2024	4870	CP	Type 3
67 / 4078	28	06/18/2024	4950	CP	Type 3
67 / 4079	28	06/18/2024	4880	CP	Type 3

Average Strength (psi): 28 Day - 4900 psi



06/25/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 68 **Sample #:** 1129 **Placement Date:** 05/20/2024 **Technician:** Ben Westhues **Weather Conditions:** Sunny / Partly Cloudy / Windy **Air Temp (°F):** 67

Contractor: Baseband LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** NE corner of intersection at William Downing and Aspen Valley Rd. **Lat/Long:** 38.974607 / -104.666941


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
68	2002 14027096	8.00	Slump: 4 1/2 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	141.6	64	67

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
68 / 4020	7	05/27/2024	4690		Type 3
68 / 4021	28	06/17/2024	4850	CP	Type 3
68 / 4022	28	06/17/2024	5380	CP	Type 3
68 / 4023	28	06/17/2024	5550	CP	Type 2

Average Strength (psi): 28 Day - 5260 psi

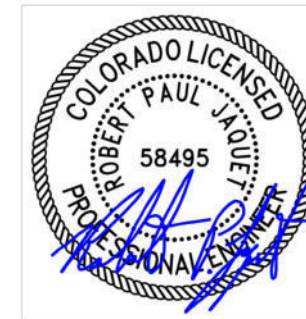

06/24/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 69 **Sample #:** 1147 **Placement Date:** 05/22/2024 **Technician:** Ben Westhues **Weather Conditions:** Sunny **Air Temp (°F):** 50

Contractor: Baseband LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** SW corner of intersection at Aspen Valley Rd. and Perry Owens Dr. **Lat/Long:** 38.9728166 / -104.6672415


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
69	2031 14027179	10.00	Slump: 5 Spec: 2 - 6	Result: 7.5 Spec.: 5 - 8	136.8	62	50

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
69 / 4745	7	05/29/2024	4230		Type 3
69 / 4746	28	06/19/2024	4500	CP	Type 3
69 / 4747	28	06/19/2024	4670	CP	Type 3
69 / 4748	28	06/19/2024	4640	CP	Type 3

Average Strength (psi): 7 Day - 4230 psi, 28 Day - 4610 psi

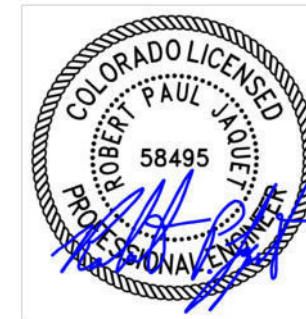

06/24/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 70 **Sample #:** 1190 **Placement Date:** 05/24/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Sunny / Windy **Air Temp (°F):** 46

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 5' S and 20' E off SE corner of Vollmer and Alzada **Lat/Long:** 38.9584579 / -104.6836351


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
70	2033 14027312	10.00	Slump: 3 1/2 Spec: 3 - 5	Result: 6.1 Spec.: 5 - 8	140.0	73	46

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
70 / 4236	7	05/31/2024	4650		Type 2
70 / 4237	28	06/21/2024	4710	CP	Type 3
70 / 4238	28	06/21/2024	4910	CP	Type 3
70 / 4239	28	06/21/2024	5060	CP	Type 3

Average Strength (psi): 28 Day - 4900 psi

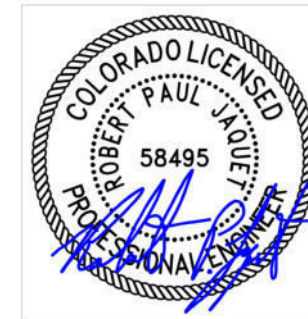

06/24/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 71 **Sample #:** 1237 **Placement Date:** 05/29/2024 **Technician:** Ben Westhues **Weather Conditions:** Sunny / Partly Cloudy **Air Temp (°F):** 55

Contractor: Trax **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Sidewalk on Harvey Logan Dr. On the North side of street, 25' East of Vollmer Rd. **Lat/Long:** 38.97163 / -104.66940

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
71	2034 14027419	10.00	Slump: 4 Spec: 4 - 6	Result: 6 Spec.: 4.5 - 7.5	141.6	62	55

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
71 / 4595	7	06/05/2024	4210		Type 3
71 / 4596	28	06/26/2024	5000	CP	Type 3
71 / 4597	28	06/26/2024	4600	CP	Type 2
71 / 4598	28	06/26/2024	4790	CP	Type 2

Average Strength (psi): 7 Day - 4210 psi, 29 Day - 4790 psi



06/28/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 72 **Sample #:** 1245 **Placement Date:** 05/30/2024 **Technician:** Andrew Oswald **Weather Conditions:** Sunny / Windy **Air Temp (°F):** 58

Contractor: Baseland llc **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** SW side of Sam Bass. 200' E off SE corner of intersection at Vollmer **Lat/Long:** 38.9726703 / -104.6682882

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
72	1915 14027454	8.00	Slump: 4 Spec: 3 - 5	Result: 6.5 Spec.: 5 - 8	139.2	75	58

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
72 / 4519	7	06/06/2024	4200		Type 3
72 / 4520	28	06/27/2024	4980	CP	Type 2
72 / 4521	28	06/27/2024	4950	CP	Type 3
72 / 4522	28	06/27/2024	5180	CP	Type 3

Average Strength (psi): 7 Day - 4200 psi, 28 Day - 5040 psi



07/08/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 73 **Sample #:** 1260 **Placement Date:** 05/31/2024 **Technician:** Andrew Oswald **Weather Conditions:** Sunny **Air Temp (°F):** 57

Contractor: Baseland Ilc **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 30' S off SW corner of intersection at Aspen Valley on Sam Bass **Lat/Long:** 38.9722132 / -104.6673512

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
73	4027 12023124	8.00	Slump: 4 1/2 Spec: 2 - 6	Result: 5.5 Spec.: 5 - 8	141.2	74	57

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
73 / 5018	7	06/07/2024	5010		Type 2
73 / 5019	28	06/28/2024	5910	CP	Type 3
73 / 5020	28	06/28/2024	5750	CP	Type 2
73 / 5021	28	06/28/2024	5580	CP	Type 3

Average Strength (psi): 7 Day - 5010 psi, 28 Day - 5750 psi



07/08/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 74 **Sample #:** 1297 **Placement Date:** 06/04/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Cloudy **Air Temp (°F):** 66

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 250' S and 5' W off SW corner of Sam Bass and Aspen Valley **Lat/Long:** 38.9719074 / -104.6679316

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
74	1913 14027594	8.00	Slump: 3 3/4 Spec: 2 - 4	Result: 6.1 Spec.: 5 - 8	139.6	68	66

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
74 / 4712	7	06/11/2024	4220		Type 3
74 / 4713	28	07/02/2024	4870	CP	Type 2
74 / 4714	28	07/02/2024	4980	CP	Type 3
74 / 4715	28	07/02/2024	4840	CP	Type 3

Average Strength (psi): 7 Day - 4220 psi, 28 Day - 4900 psi



07/08/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 75 **Sample #:** 1316 **Placement Date:** 06/05/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Sunny **Air Temp (°F):** 68

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 5' East and 200' South off the SE corner of Aspen Valley and Sam Bass **Lat/Long:** 38.9718735 / -104.6671395

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
75	4015 14027639	8.00	Slump: 5 1/2 Spec: 2 - 6	Result: 7 Spec.: 5 - 8	138.0	68	68

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
75 / 4793	7	06/12/2024	4010		Type 3
75 / 4794	28	07/03/2024	4680	CP	Type 3
75 / 4795	28	07/03/2024	4700	CP	Type 2
75 / 4796	28	07/03/2024	4280	CF	Type 3

Average Strength (psi): 7 Day - 4010 psi, 28 Day - 4550 psi



07/08/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 76 **Sample #:** 1331 **Placement Date:** 06/06/2024 **Technician:** Jack Bowyer **Weather Conditions:** Sunny **Air Temp (°F):** 68
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** 15' N off NWC of Perry Owen's Dr & Wheatland Dr **Lat/Long:** 38.9721887 / -104.6664017


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
76	4027 14027716	8.00	Slump: 3 1/2 Spec: 3 - 5	Result: 5.1 Spec.: 5 - 8	140.0	70	68

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
76 / 4797	7	06/13/2024	5380		Type 3
76 / 4798	28	07/04/2024	6660	CP	Type 3
76 / 4799	28	07/04/2024	6600	CP	Type 2
76 / 4800	28	07/04/2024	6390	CP	Type 2

Average Strength (psi): 7 Day - 5380 psi, 29 Day - 6550 psi

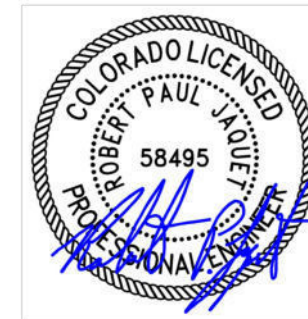

07/09/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 77 **Sample #:** 1352 **Placement Date:** 06/07/2024 **Technician:** Andrew Oswald **Weather Conditions:** Sunny **Air Temp (°F):** 68

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 40' W off NW corner intersection at Sam Bass and Wheatland. **Lat/Long:** 38.9715784 / -104.6667518

Notes: First truck failed with 8.4% air. Rejected by crew for time. 2nd trucks first test with air 4%.

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
77	4025 14027826	8.00	Slump: 4 1/2 Spec: 3 - 5	Result: 5.4 Spec.: 4.5 - 7.5	141.6	85	68

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
77 / 5014	7	06/14/2024	4290		Type 2
77 / 5015	28	07/05/2024	5850	CP	Type 2
77 / 5016	28	07/05/2024	5970	CP	Type 3
77 / 5017	28	07/05/2024	5770	CP	Type 3

Average Strength (psi): 7 Day - 4290 psi, 28 Day - 5860 psi



07/08/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 78 **Sample #:** 1371 **Placement Date:** 06/10/2024 **Technician:** Matt Spring **Weather Conditions:** Cloudy **Air Temp (°F):** 55

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 75' West and 5' North off NW corner of Wheatland and Willey Picket **Lat/Long:** 38.971285 / -104.6690477


PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
78	1640 14027916	8.00	Slump: 3 1/2 Spec: 2 - 6	Result: 6.8 Spec.: 5 - 8	139.2	67	55

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
78 / 4949	7	06/17/2024	4170		Type 2
78 / 4950	28	07/08/2024	5360	CP	Type 3
78 / 4951	28	07/08/2024	5200	CP	Type 3
78 / 4952	28	07/08/2024	5160	CP	Type 3

Average Strength (psi): 7 Day - 4170 psi, 28 Day - 5240 psi

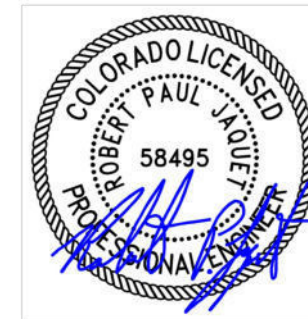

07/09/2024

Digitally Signed by Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 79 **Sample #:** 1391 **Placement Date:** 06/11/2024 **Technician:** Matt Spring **Weather Conditions:** Sunny **Air Temp (°F):** 67

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 5' South and 10" West off SW corner of Willey Picket and Wheatland **Lat/Long:** 38.970935 / -104.667436

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
79	4029 14027994	8.00	Slump: 4 Spec: 2 - 6	Result: 7.1 Spec.: 5 - 8	137.2	77	67

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
79 / 5059	7	06/18/2024	3260	Type 3
79 / 5060	28	07/09/2024	3770	Type 3
79 / 5061	56	08/06/2024	4070	Type 3
79 / 5062	90	09/09/2024	4730	Type 2

Average Strength (psi): 7 Day - 3270 psi, 28 Day - 3770 psi, 56 Day - 4070 psi, 90 Day - 4730 psi

09/19/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 80 **Sample #:** 1399 **Placement Date:** 06/12/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Sunny **Air Temp (°F):** 73
Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** 5' W and 25' S off SW corner of Wheatland and Sam Bass **Lat/Long:** 38.9714073 / -104.6664882

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
80	1913 14028022	8.00	Slump: 3 1/4 Spec: 3 - 5	Result: 5.8 Spec.: 5 - 8	141.2	72	73

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
80 / 5071	7	06/19/2024	4380		Type 2
80 / 5072	28	07/10/2024	5440	CP	Type 2
80 / 5073	28	07/10/2024	4980	CP	Type 3
80 / 5074	28	07/10/2024	4600	CP	Type 3

Average Strength (psi): 7 Day - 4380 psi, 28 Day - 5010 psi



07/18/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 81 **Sample #:** 1415 **Placement Date:** 06/13/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Sunny **Air Temp (°F):** 76

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 5' N and 115' E off NE corner of Aspen Valley and Perry Owens **Lat/Long:** 38.9730126 / -104.6670071

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
81	2106 14028087	8.00	Slump: 3 1/2 Spec: 3 - 5	Result: 5.9 Spec.: 5 - 8	141.2	86	76

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
81 / 5159	7	06/20/2024	4310		Type 3
81 / 5160	28	07/11/2024	5130	CP	Type 2
81 / 5161	28	07/11/2024	5600	CP	Type 3
81 / 5162	28	07/11/2024	5430	CP	Type 3

Average Strength (psi): 7 Day - 4310 psi, 28 Day - 5390 psi



07/18/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 82 **Sample #:** 1428 **Placement Date:** 06/14/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Partly Cloudy / Cloudy **Air Temp (°F):** 68

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 10' S and 15' W off SW corner of Sam Bass and Wheatland **Lat/Long:** 38.971495 / -104.6665767

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
82	2106 14028151	10.00	Slump: 3 3/4 Spec: 3 - 5	Result: 6.2 Spec.: 5 - 8	140.0	79	68

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
82 / 5155	7	06/21/2024	4640		Type 3
82 / 5156	28	07/12/2024	4860	CP	Type 2
82 / 5157	28	07/12/2024	5200	CP	Type 2
82 / 5158	28	07/12/2024	5280	CP	Type 2

Average Strength (psi): 7 Day - 4640 psi, 28 Day - 5120 psi



07/18/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 83 **Sample #:** 1438 **Placement Date:** 06/17/2024 **Technician:** Michael Crytser **Weather Conditions:** Sunny **Air Temp (°F):** 66

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** East bound lane of Aspen Valley Road. At GPS coordinates, 20' West of light pole **Lat/Long:** 38.9734633 / -104.6663125

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
83	4026 14028188	8.00	Slump: 4 Spec: 3 - 5	Result: 8 Spec.: 5 - 8	137.6	75	66

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
83 / 5206	7	06/24/2024	3960	Type 2
83 / 5207	28	07/15/2024	4070	Type 2
83 / 5208	56	08/12/2024	5070	Type 2
83 / 5209	56	08/12/2024	5010	Type 2

Average Strength (psi): 7 Day - 3960 psi, 28 Day - 4070 psi, 56 Day - 5040 psi

08/19/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 84 **Sample #:** 1466 **Placement Date:** 06/18/2024 **Technician:** Michael Crytser **Weather Conditions:** Sunny / Windy **Air Temp (°F):** 54

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** SE corner of intersection off Aspen Valley Road and William Downing Drive **Lat/Long:** 38.9743609 / -104.6655497

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
84	2034 14028235	8.00	Slump: 4 1/2 Spec: 3 - 5	Result: 8 Spec.: 5 - 8	137.6	72	54

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
84 / 5278	7	06/25/2024	3690	Type 3
84 / 5279	28	07/16/2024	4130	Type 2
84 / 5280	56	08/13/2024	4720	Type 2
84 / 5281	56	08/13/2024	4620	Type 2

Average Strength (psi): 7 Day - 3690 psi, 28 Day - 4130 psi, 56 Day - 4670 psi

08/19/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 85 **Sample #:** 1496 **Placement Date:** 06/19/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Cloudy **Air Temp (°F):** 50
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Inlet Box **Location Details:** Manhole at Jane Kirkham's **Lat/Long:** 38.9714297 / -104.6707047

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
85	1740 14028277	9.00	Slump: 4 1/2 Spec: 3 - 5	Result: 7.5 Spec.: 5 - 8	137.7	73	50

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
85 / 5483	7	06/26/2024	4340		Type 2
85 / 5484	28	07/17/2024	4760	CP	Type 2
85 / 5485	28	07/17/2024	5060	CP	Type 2
85 / 5486	28	07/17/2024	4870	CP	Type 2

Average Strength (psi): 7 Day - 4340 psi, 28 Day - 4890 psi

08/08/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 86 **Sample #:** 1505 **Placement Date:** 06/20/2024 **Technician:** Andrew Oswald **Weather Conditions:** Sunny **Air Temp (°F):** 57

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 350' E of NE corner of intersection at Sam Bass and Aspen Valley **Lat/Long:** 38.9735542 / -104.6665059

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
86	2034 14028318	8.00	Slump: 4 Spec: 3 - 5	Result: 5.6 Spec.: 4.5 - 7.5	140.8	74	57

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
86 / 5515	7	06/27/2024	5030		Type 3
86 / 5516	28	07/18/2024	6050	CP	Type 2
86 / 5517	28	07/18/2024	6360	CP	Type 2
86 / 5518	28	07/18/2024	6140	CP	Type 2

Average Strength (psi): 7 Day - 5030 psi, 28 Day - 6190 psi



07/29/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 87 **Sample #:** 1534 **Placement Date:** 06/21/2024 **Technician:** Ross Lewis **Weather Conditions:** Partly Cloudy **Air Temp (°F):** 77

Contractor: SR Morley **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk

Location Details: 35' N and 10' E off NW corner of intersection at Lodge
Grass Way and Poison Road

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
87	1758 12024012	8.00	Slump: 4 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	138.4	80	77

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
87 / 5633	7	06/28/2024	3930		Type 3
87 / 5634	28	07/19/2024	4470	CP	Type 2
87 / 5635	28	07/19/2024	4640	CP	Type 2
87 / 5636	28	07/19/2024	4460	CP	Type 3

Average Strength (psi): 7 Day - 3930 psi, 28 Day - 4530 psi



07/29/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 88 **Sample #:** 1549 **Placement Date:** 06/24/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Sunny / Partly Cloudy **Air Temp (°F):** 76

Contractor: Baseland **Supplier:** Cementech **Mix Design:** 4500mixAug2023 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 40' W and 5' N off NW corner of Aspen Valley and William Downing Dr. **Lat/Long:** 38.9744374 / -104.6652296

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
88	1 94		Slump: 5 3/4 Spec: 3 - 5	Result: 5 Spec.: 5 - 8	137.6	82	76

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
88 / 5649	7	07/01/2024	3010	Type 1
88 / 5650	28	07/22/2024	3160	Type 2
88 / 5651	56	08/19/2024	3230	Type 3
88 / 5652	90	09/22/2024	3190	Type 6

56 Day Breaks will be provided when available.

09/27/2024

Reviewed by: Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 89 **Sample #:** 1562 **Placement Date:** 06/25/2024 **Technician:** Rodney Fannin **Weather Conditions:** Sunny **Air Temp (°F):** 83

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 75' E off the NE corner of Aspen Valley Rd. and William Downing Dr. **Lat/Long:** 38.9744237 / -104.6654713

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
89	4028 12024170	16.00	Slump: 6 Spec: 4 - 7	Result: 6.4 Spec.: 4.5 - 7.5	140.0	85	83

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
89 / 5686	7	07/02/2024	3830		Type 3
89 / 5687	28	07/23/2024	4450	CP	Type 2
89 / 5688	28	07/23/2024	4600	CP	Type 3
89 / 5689	28	07/23/2024	4600	CP	Type 3

Average Strength (psi): 7 Day - 3840 psi, 28 Day - 4550 psi



07/29/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 90 **Sample #:** 1574 **Placement Date:** 06/26/2024 **Technician:** Matt Spring **Weather Conditions:** Sunny **Air Temp (°F):** 71
Contractor: SR Land **Supplier:** SRM **Mix Design:** ZCDOT45071-4 **Specified Strength (psi):** 4500
Placement Location: Curb & Gutter **Location Details:** 30' N and 5' E off the NE corner of Briargate and Vollmer **Lat/Long:** 38.9702903 / -104.6720572

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
90	1740 14028471	10.00	Slump: 1 Spec: 1 - 2	Result: 7 Spec.: 5 - 8	141.2	80	71

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
90 / 5725	7	07/03/2024	4160		Type 2
90 / 5726	28	07/24/2024	4970	CP	Type 2
90 / 5727	28	07/24/2024	4490	CP	Type 2
90 / 5728	28	07/24/2024	4670	CP	Type 2

Average Strength (psi): 7 Day - 4160 psi, 28 Day - 4710 psi



07/29/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 91 **Sample #:** 1602 **Placement Date:** 06/27/2024 **Technician:** Andrew Oswald **Weather Conditions:** Sunny / Partly Cloudy **Air Temp (°F):** 66

Contractor: Baseland **Supplier:** Cementech **Mix Design:** 4500mixAug2023 **Specified Strength (psi):** 4500

Placement Location: Curb & Gutter **Location Details:** N side of Vollmer. 73' N and 40' E off SE corner of intersection with Jane Kirkham **Lat/Long:** 38.9716156 / -104.6703989

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
91	47 104	2.10	Slump: 4 1/2 Spec: 3 - 5	Result: 7.5 Spec.: 5 - 8	136.0	82	66

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
91 / 5910	7	07/04/2024	2750	Type 3
91 / 5911	28	07/25/2024	2900	Type 3
91 / 5912	56	08/22/2024	3500	Type 2
91 / 5913	90	09/25/2024	3430	Type 3

Average Strength (psi): 7 Day - 2750 psi, 28 Day - 2900 psi, 56 Day - 3500 psi

09/27/2024

Reviewed by: Robert Jaquet, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 92 **Sample #:** 1623 **Placement Date:** 06/28/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Sunny / Partly Cloudy **Air Temp (°F):** 78

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 50' East and 5' North off the NE corner of Aspen Valley and William Downing **Lat/Long:** 38.9742703 / -104.6654536

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
92	2106 14028571	10.00	Slump: 3 1/4 Spec: 3 - 5	Result: 5.3 Spec.: 5 - 8	140.8	76	78

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
92 / 5794	7	07/05/2024	4630		Type 2
92 / 5795	28	07/26/2024	5390	CP	Type 2
92 / 5796	28	07/26/2024	5050	CP	Type 2
92 / 5797	28	07/26/2024	5070	CP	Type 2

Average Strength (psi): 7 Day - 4630 psi, 28 Day - 5170 psi



07/29/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 93 **Sample #:** 1641 **Placement Date:** 07/01/2024 **Technician:** Jack Bowyer **Weather Conditions:** Sunny **Air Temp (°F):** 67
Contractor: Baseland **Supplier:** SRM **Mix Design:** CDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Curb & Gutter **Location Details:** NW side of cul-de-sac **Lat/Long:** 38.9743058 / -104.6640217

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
93	2033 14028622	8.00	Slump: 4 Spec: 3 - 5	Result: 5.1 Spec.: 5 - 8	140.8	70	67

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
93 / 5946	7	07/08/2024	4450		Type 3
93 / 5947	28	07/29/2024	5240	CP	Type 2
93 / 5948	28	07/29/2024	5430	CP	Type 2
93 / 5949	28	07/29/2024	5470	CP	Type 3

Average Strength (psi): 7 Day - 4450 psi, 28 Day - 5380 psi



07/29/2024

Digitally Signed by Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 94 **Sample #:** 1661 **Placement Date:** 07/02/2024 **Technician:** Andrew Oswald **Weather Conditions:** Sunny / Partly Cloudy **Air Temp (°F):** 70

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Sidewalk on property line 77/76 on south side of cul-de-sac for William Downing Dr. **Lat/Long:** 38.974302 / -104.6639267

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
94	4027 12024479	10.00	Slump: 5 Spec: 3 - 5	Result: 7.2 Spec.: 4.5 - 7.5	137.2	85	70

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
94 / 7060	7	07/09/2024	3300	Type 3
94 / 7061	28	07/30/2024	4460	Type 2
94 / 7062	28	07/30/2024	4140	Type 2
94 / 7063	56	08/27/2024	4870	Type 3

Average Strength (psi): 7 Day - 3300 psi, 28 Day - 4300 psi, 56 Day - 4870 psi

08/28/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 95 **Sample #:** 1678 **Placement Date:** 07/03/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Cloudy **Air Temp (°F):** 59
Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** Directly in front of 8419 William Downing **Lat/Long:** 38.9743181 / -104.6648465

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
95	2034 14028719	10.00	Slump: 4 Spec: 3 - 5	Result: 5.7 Spec.: 5 - 8	140.8	70	59

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
95 / 6096	7	07/10/2024	4480		Type 3
95 / 6097	28	07/31/2024	5420	CP	Type 2
95 / 6098	28	07/31/2024	5450	CP	Type 2
95 / 6099	28	07/31/2024	5610	CP	Type 2

Average Strength (psi): 7 Day - 4490 psi, 28 Day - 5500 psi

08/02/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 96 **Sample #:** 1699 **Placement Date:** 07/08/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Sunny **Air Temp (°F):** 62

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 5' S and 100' W off SW corner of Aspen Valley and William Downing **Lat/Long:** 38.9743859 / -104.6662527

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
96	4015 14028767	10.00	Slump: 3 1/2 Spec: 3 - 5	Result: 5.2 Spec.: 5 - 8	140.0	70	62

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Remark	Fracture Pattern
96 / 6198	7	07/15/2024	4610		Type 3
96 / 6199	28	08/05/2024	5670	CP	Type 3
96 / 6200	28	08/05/2024	5430	CP	Type 2
96 / 6201	28	08/05/2024	5530	CP	Type 2

Average Strength (psi): 7 Day - 4610 psi, 28 Day - 5540 psi

08/05/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 97 **Sample #:** 1713 **Placement Date:** 07/09/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Sunny **Air Temp (°F):** 72

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 5' S and 300' W off southwest corner of Aspen Valley and William Downing **Lat/Long:** 38.9745118 / -104.66677

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
97	4029 14028817	10.00	Slump: 3 1/2 Spec: 3 - 5	Result: 6.2 Spec.: 5 - 8	139.2	78	72

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
97 / 7512	7	07/16/2024	4580	Type 3
97 / 7513	28	08/06/2024	5120	Type 4
97 / 7514	28	08/06/2024	5380	Type 2
97 / 7515	28	08/06/2024	5080	Type 2

Average Strength (psi): 7 Day - 4580 psi, 28 Day - 5190 psi

08/19/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 98 **Sample #:** 1730 **Placement Date:** 07/10/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Sunny **Air Temp (°F):** 74

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 5' N and 50' E off NE corner of William Downing and Perry Owens **Lat/Long:** 38.9734952 / -104.6679476

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
98	1640 14028863	11.00	Slump: 3 1/4 Spec: 3 - 5	Result: 5.4 Spec.: 5 - 8	141.6	74	74

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
98 / 6350	7	07/17/2024	4160	Type 2
98 / 6351	28	08/07/2024	5480	Type 3
98 / 6352	28	08/07/2024	5110	Type 3
98 / 6353	28	08/07/2024	5490	Type 2

Average Strength (psi): 7 Day - 4160 psi, 28 Day - 5360 psi

08/19/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 99 **Sample #:** 1742 **Placement Date:** 07/11/2024 **Technician:** Herbert Hafenrichter **Weather Conditions:** Sunny **Air Temp (°F):** 74

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 100' North off NE corner of William Downing Drive and Perdy Owen's Drive **Lat/Long:** 38.9731085 / -104.6677696

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
99	4029 14028909	20.00	Slump: 4 Spec: 3 - 5	Result: 6.1 Spec.: 5 - 8	141.6	65	74

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
99 / 6428	7	07/18/2024	4020	Type 2
99 / 6429	28	08/08/2024	4810	Type 3
99 / 6430	28	08/08/2024	4550	Type 3
99 / 6431	28	08/08/2024	4550	Type 3

Average Strength (psi): 7 Day - 4020 psi, 28 Day - 4640 psi

08/19/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 100 **Sample #:** 1757 **Placement Date:** 07/12/2024 **Technician:** Rodney Fannin **Weather Conditions:** Sunny **Air Temp (°F):** 77
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** 15' W off NW corner of transformer #157. **Lat/Long:** 38.9742651 / -104.6678187

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
100	2031 14028963	10.00	Slump: 5 3/4 Spec: 3 - 5	Result: 6.4 Spec.: 4.5 - 7.5	141.6	84	77

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
100 / 6390	7	07/19/2024	3760	Type 2
100 / 6391	28	08/09/2024	4500	Type 3
100 / 6392	28	08/09/2024	4540	Type 5
100 / 6393	28	08/09/2024	4480	Type 3

Average Strength (psi): 7 Day - 3760 psi, 28 Day - 4500 psi

08/19/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 101 **Sample #:** 1777 **Placement Date:** 07/15/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Sunny **Air Temp (°F):** 84
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** Sidewalk, East side William Downing **Lat/Long:** 38.9743609 / -104.6663126

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
101	4029 14028998	10.00	Slump: 4 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	141.0	80	84

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
101 / 6506	7	07/22/2024	4090	Type 3
101 / 6507	28	08/12/2024	4670	Type 5
101 / 6508	28	08/12/2024	4810	Type 3
101 / 6509	28	08/12/2024	4630	Type 5

Average Strength (psi): 7 Day - 4090 psi, 28 Day - 4710 psi

08/19/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 102 **Sample #:** 1797 **Placement Date:** 07/16/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Partly Cloudy **Air Temp (°F):** 75
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** Sidewalk, William Downing, Lot 65 **Lat/Long:** 38.9738705 / -104.6677784

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
102	1915 14029024	10.00	Slump: 4 1/2 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	141.1	87	75

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
102 / 6530	7	07/23/2024	3780	Type 3
102 / 6531	28	08/13/2024	5360	Type 2
102 / 6532	28	08/13/2024	5220	Type 2
102 / 6533	28	08/13/2024	4910	Type 2

Average Strength (psi): 7 Day - 3780 psi, 28 Day - 5160 psi

08/19/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 105 **Sample #:** 1855 **Placement Date:** 07/19/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Sunny **Air Temp (°F):** 75
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** Lot 41 sidewalk at David Rudabough **Lat/Long:** 38.9753036 / -104.6650566

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
105	2106 14029144	10.00	Slump: 5 Spec: 3 - 5	Result: 6.5 Spec.: 5 - 8	140.6	84	75

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
105 / 6789	7	07/26/2024	4000	Type 2
105 / 6790	28	08/16/2024	5020	Type 2
105 / 6791	28	08/16/2024	5040	Type 3
105 / 6792	28	08/16/2024	4920	Type 2

Average Strength (psi): 7 Day - 4000 psi, 28 Day - 4990 psi

08/26/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 106 **Sample #:** 1864 **Placement Date:** 07/22/2024 **Technician:** Jack Bowyer **Weather Conditions:** Cloudy **Air Temp (°F):** 64
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** Entire cul-de-sac at GPS coordinates **Lat/Long:** 38.9752936 / -104.663773

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
106	4025 14029180	10.00	Slump: 4 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	140.8	75	64

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
106 / 6822	7	07/29/2024	4650	Type 3
106 / 6823	28	08/19/2024	5570	Type 2
106 / 6824	28	08/19/2024	5400	Type 2
106 / 6825	28	08/19/2024	5580	Type 2

Average Strength (psi): 7 Day - 4650 psi, 28 Day - 5520 psi

08/26/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 107 **Sample #:** 1878 **Placement Date:** 07/23/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Sunny / Partly Cloudy **Air Temp (°F):** 67
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45071-4 **Specified Strength (psi):** 4500
Placement Location: Curb & Gutter **Location Details:** Southbound curb on Vollmer Rd, STA 0+50 **Lat/Long:** 38.9656059 / -104.6771997

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
107	1915 14029226	10.00	Slump: 1 Spec: - 3	Result: 6.5 Spec.: 5 - 8	140.8	75	67

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
107 / 6838	7	07/30/2024	4690	Type 2
107 / 6839	28	08/20/2024	6160	Type 2
107 / 6840	28	08/20/2024	5480	Type 5
107 / 6841	28	08/20/2024	5710	Type 2

Average Strength (psi): 7 Day - 4690 psi, 28 Day - 5780 psi

08/26/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 108 **Sample #:** 1893 **Placement Date:** 07/24/2024 **Technician:** Matt Spring **Weather Conditions:** Sunny **Air Temp (°F):** 73
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** 5' S & 40' W of SWC of Aspen Valley and David Rudabaugh **Lat/Long:** 38.9752949 / -104.6664296

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
108	4025 14029269	10.00	Slump: 4 Spec: 3 - 5	Result: 5.1 Spec.: 5 - 8	141.6	80	73

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
108 / 6886	7	07/31/2024	4790	Type 3
108 / 6887	28	08/21/2024	5610	Type 2
108 / 6888	28	08/21/2024	5530	Type 3
108 / 6889	28	08/21/2024	5650	Type 3

Average Strength (psi): 7 Day - 4790 psi, 28 Day - 5600 psi

08/26/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 109 **Sample #:** 1906 **Placement Date:** 07/25/2024 **Technician:** Matt Spring **Weather Conditions:** Sunny **Air Temp (°F):** 75

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Curb & Gutter **Location Details:** Parallel to corner of Wheatland and scoby, 250' N 50' E on Vollmer **Lat/Long:** 38.9659134 / -104.6769109

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
109	4026 14029303	10.00	Slump: 4 Spec: 3 - 5	Result: 5.5 Spec.: 5 - 8	140.8	80	75

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
109 / 6934	7	08/01/2024	4730	Type 3
109 / 6935	28	08/22/2024	5770	Type 2
109 / 6936	28	08/22/2024	5950	Type 3
109 / 6937	28	08/22/2024	5810	Type 5

Average Strength (psi): 7 Day - 4730 psi, 28 Day - 5850 psi

08/26/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 110 **Sample #:** 1931 **Placement Date:** 07/26/2024 **Technician:** Matt Spring **Weather Conditions:** Partly Cloudy **Air Temp (°F):** 75

Contractor: SR land **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Northeast corner of Aspen Valley and David Rudabaugh, 5' north 75' east **Lat/Long:** 38.97526 / 104.66532

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
110	1909 14029345	10.00	Slump: 3 Spec: 2 - 6	Result: 5.3 Spec.: 5 - 8	141.6	75	75

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
110 / 6994	7	08/02/2024	4180	Type 3
110 / 6995	28	08/23/2024	5170	Type 2
110 / 6996	28	08/23/2024	4910	Type 2
110 / 6997	28	08/23/2024	5130	Type 2

Average Strength (psi): 7 Day - 4180 psi, 28 Day - 5070 psi

08/26/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 111 **Sample #:** 1947 **Placement Date:** 07/29/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Sunny / Partly Cloudy **Air Temp (°F):** 76

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Northwest end of David Rudabaugh, along west bound lane **Lat/Long:** 38.9756168 / -104.6675825

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
111	801 14029408	10.00	Slump: 4 Spec: 2 - 6	Result: 6 Spec.: 5 - 8	140.4	75	76

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
111 / 7088	7	08/05/2024	4650	Type 2
111 / 7089	28	08/26/2024	4870	Type 2
111 / 7090	28	08/26/2024	5280	Type 5
111 / 7091	28	08/26/2024	5070	Type 2

Average Strength (psi): 7 Day - 4650 psi, 28 Day - 5070 psi

08/26/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 112 **Sample #:** 1968 **Placement Date:** 07/30/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Sunny **Air Temp (°F):** 78

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Northwest corner of Aspen Valley/David Rudabaugh, 5' north and 200' west **Lat/Long:** 38.9753828 / -104.6663386

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
112	2046 12025591	10.00	Slump: 4 1/4 Spec: 2 - 6	Result: 6.6 Spec.: 5 - 8	140.4	86	78

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
112 / 7145	7	08/06/2024	5210	Type 3
112 / 7146	28	08/27/2024	5440	Type 2
112 / 7147	28	08/27/2024	5590	Type 5
112 / 7148	28	08/27/2024	5950	Type 3

Average Strength (psi): 7 Day - 5210 psi, 28 Day - 5660 psi

08/28/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 113 **Sample #:** 1986 **Placement Date:** 07/31/2024 **Technician:** Matt Spring **Weather Conditions:** Sunny **Air Temp (°F):** 72

Contractor: SR land **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Sidewalk, northwest of Jesse Evans and Aspen Valley, 5'N 100'W **Lat/Long:** 38.9758334 / -104.6666192

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
113	1915 14029497	8.00	Slump: 3 Spec: 2 - 6	Result: 5.2 Spec.: 5 - 8	142.0	75	72

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
113 / 7210	7	08/07/2024	4300	Type 3
113 / 7211	28	08/28/2024	5130	Type 3
113 / 7212	28	08/28/2024	5090	Type 3
113 / 7213	28	08/28/2024	5180	Type 3

Average Strength (psi): 7 Day - 4300 psi, 28 Day - 5130 psi

09/03/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 114 **Sample #:** 2004 **Placement Date:** 08/01/2024 **Technician:** Matt Spring **Weather Conditions:** Sunny **Air Temp (°F):** 72
Contractor: SR land **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Southwest corner of Aspen Valley and Jesse Evans, 75' west 5' north **Lat/Long:** 38.9758098 / -104.666398

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
114	4026 14029556	8.00	Slump: 5 Spec: 2 - 6	Result: 6 Spec.: 5 - 8	140.0	80	72

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
114 / 7349	7	08/08/2024	4710	Type 2
114 / 7350	28	08/29/2024	5240	Type 3
114 / 7351	28	08/29/2024	5190	Type 2
114 / 7352	28	08/29/2024	5040	Type 2

Average Strength (psi): 7 Day - 4710 psi, 28 Day - 5160 psi

09/03/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 115 **Sample #:** 2028 **Placement Date:** 08/02/2024 **Technician:** Matt Spring **Weather Conditions:** Sunny **Air Temp (°F):** 74

Contractor: SR land **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Northwest corner of Aspen Valley and David Rudabaugh,
5' west 30' north **Lat/Long:** 38.97561 / -104.6657683

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
115	1769 14029605	8.00	Slump: 3 1/2 Spec: 2 - 6	Result: 5.7 Spec.: 5 - 8	139.2	79	74

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
115 / 7263	7	08/09/2024	4570	Type 3
115 / 7264	28	08/30/2024	5060	Type 3
115 / 7265	28	08/30/2024	5770	Type 3
115 / 7266	28	08/30/2024	5260	Type 3

Average Strength (psi): 7 Day - 4570 psi, 28 Day - 5360 psi

09/03/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 116 **Sample #:** 2048 **Placement Date:** 08/05/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Sunny **Air Temp (°F):** 76

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45071-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Sidewalk east side of Jesse Owen's, culdesac across from 8321 **Lat/Long:** 38.9763315 / -104.6622173

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
116	1640 14029700	10.00	Slump: 4 Spec: 3 - 5	Result: 7 Spec.: 5 - 8	140.3	81	76

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
116 / 7423	7	08/12/2024	4260	Type 2
116 / 7424	28	09/02/2024	5190	Type 2
116 / 7425	28	09/02/2024	4900	Type 3
116 / 7426	28	09/02/2024	4820	Type 2

Average Strength (psi): 7 Day - 4270 psi, 28 Day - 4970 psi

09/03/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 117 **Sample #:** 2065 **Placement Date:** 08/06/2024 **Technician:** Michael Crytser **Weather Conditions:** Sunny **Air Temp (°F):** 78

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Sidewalk start of cul-da-sac going east on Jesse Evans Drive. Approx 6 ft before the bend **Lat/Long:** 38.9761432 / -104.6645167

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
117	2034 14029761	10.00	Slump: 4 Spec: 3 - 5	Result: 6.4 Spec.: 5 - 8	140.8	84	78

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
117 / 7477	7	08/13/2024	4250	Type 3
117 / 7478	28	09/03/2024	5040	Type 3
117 / 7479	28	09/03/2024	4930	Type 3
117 / 7480	28	09/03/2024	5020	Type 3

Average Strength (psi): 7 Day - 4250 psi, 28 Day - 5000 psi

09/03/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 118 **Sample #:** 2068 **Placement Date:** 08/07/2024 **Technician:** Dillon Mercer **Weather Conditions:** Sunny **Air Temp (°F):** 61
Contractor: Baseland Concrete **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** Westbound sidewalk on Jesse Evans Road **Lat/Long:** 38.97617 / -104.66436

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
118	4025 14029769	10.00	Slump: 4 Spec: 3 - 5	Result: 7 Spec.: 5 - 8	138.2	81	61

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
118 / 7499	7	08/14/2024	4300	Type 2
118 / 7500	28	09/04/2024	4980	Type 2
118 / 7501	28	09/04/2024	4870	Type 2
118 / 7502	28	09/04/2024	5190	Type 6

Average Strength (psi): 7 Day - 4300 psi, 28 Day - 5010 psi

09/06/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 119 **Sample #:** 2078 **Placement Date:** 08/08/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Cloudy **Air Temp (°F):** 60

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Sidewalk 80' south from southeast corner of Jesse Evans and Aspen Valley

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
119	1640 14029812	10.00	Slump: 4 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	140.7	80	60

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
119 / 7528	7	08/15/2024	4540	Type 3
119 / 7529	28	09/05/2024	5640	Type 2
119 / 7530	28	09/05/2024	5620	Type 3
119 / 7531	28	09/05/2024	5720	Type 3

Average Strength (psi): 7 Day - 4540 psi, 28 Day - 5660 psi

09/06/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 120 **Sample #:** 2089 **Placement Date:** 08/12/2024 **Technician:** Dillon Mercer **Weather Conditions:** Sunny / Partly Cloudy **Air Temp (°F):** 73

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Sidewalk of North & South Side of Intersection of Aspen Valley Rd & Jesse Evans Dr. **Lat/Long:** 38.97623 / -104.66565

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
120	1640 14029874	10.00	Slump: 3 3/4 Spec: 3 - 5	Result: 5.5 Spec.: 5 - 8	141.1	73	73

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
120 / 7566	7	08/19/2024	4750	Type 2
120 / 7567	28	09/09/2024	5300	Type 3
120 / 7568	28	09/09/2024	5640	Type 2
120 / 7569	28	09/09/2024	5480	Type 3

Average Strength (psi): 7 Day - 4750 psi, 28 Day - 5470 psi

09/19/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 121 **Sample #:** 2098 **Placement Date:** 08/13/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Cloudy **Air Temp (°F):** 65
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500
Placement Location: Sidewalk **Location Details:** Sidewalk south of 8149 Jesse Evans **Lat/Long:** 38.9772114 / -104.666255

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
121	1913 14029924	10.00	Slump: 4 1/2 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	139.7	84	65

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
121 / 7600	7	08/20/2024	4810	Type 2
121 / 7601	28	09/10/2024	5450	Type 3
121 / 7602	28	09/10/2024	5780	Type 3
121 / 7603	28	09/10/2024	6000	Type 3

Average Strength (psi): 7 Day - 4810 psi, 28 Day - 5750 psi

09/19/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 122 **Sample #:** 2107 **Placement Date:** 08/14/2024 **Technician:** Matt Spring **Weather Conditions:** Sunny **Air Temp (°F):** 68

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 5' north & 45' west of northwest corner of the intersection of Aspen Valley and Jesse Evans **Lat/Long:** 38.9761751 / -104.6664287

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
122	2031 14029956	10.00	Slump: 4 Spec: 3 - 5	Result: 5.4 Spec.: 5 - 8	141.2	80	68

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
122 / 7633	7	08/21/2024	4920	Type 3
122 / 7634	28	09/11/2024	5730	Type 1
122 / 7635	28	09/11/2024	5720	Type 3
122 / 7636	28	09/11/2024	5470	Type 3

Average Strength (psi): 7 Day - 4920 psi, 28 Day - 5640 psi

09/19/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 123 **Sample #:** 2123 **Placement Date:** 08/15/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Sunny **Air Temp (°F):** 68

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** East side of Jesse Evans, 15' south from southeast corner of Aspen Valley intersection **Lat/Long:** 38.9770483 / -104.6653519

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
123	4024 14030010	10.00	Slump: 4 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	141.4	85	68

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
123 / 7691	7	08/22/2024	4310	Type 3
123 / 7692	28	09/12/2024	5240	Type 3
123 / 7693	28	09/12/2024	5220	Type 2
123 / 7694	28	09/12/2024	5190	Type 3

Average Strength (psi): 7 Day - 4310 psi, 28 Day - 5220 psi

09/20/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 124 **Sample #:** 2137 **Placement Date:** 08/16/2024 **Technician:** Jayce Barnhart **Weather Conditions:** Sunny **Air Temp (°F):** 68

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** North-south pedestrian sidewalk through barrier wall off William Downing

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
124	4030 14030112	10.00	Slump: 4 Spec: 3 - 5	Result: 6.5 Spec.: 5 - 8	140.4	78	68

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
124 / 7712	7	08/23/2024	4370	Type 2
124 / 7713	28	09/13/2024	5280	Type 2
124 / 7714	28	09/13/2024	5200	Type 2
124 / 7715	28	09/13/2024	4940	Type 2

Average Strength (psi): 7 Day - 4370 psi, 28 Day - 5140 psi

09/20/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 125 **Sample #:** 2150 **Placement Date:** 08/20/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Sunny **Air Temp (°F):** 71

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** 10' East and 10' South of Southeast corner of Aspen Valley/Poco Rd **Lat/Long:** 38.9771436 / -104.6654539

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
125	1913 14030262	7.00	Slump: 5 Spec: 3 - 5	Result: 6.8 Spec.: 5 - 8	139.2	81	71

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
125 / 7817	7	08/27/2024	4500	Type 3
125 / 7818	28	09/17/2024	5050	Type 2
125 / 7819	28	09/17/2024	5500	Type 2
125 / 7820	28	09/17/2024	4930	Type 5

Average Strength (psi): 7 Day - 4500 psi, 28 Day - 5160 psi

09/20/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 126 **Sample #:** 2160 **Placement Date:** 08/21/2024 **Technician:** Glenn McLaughlin **Weather Conditions:** Cloudy / Windy **Air Temp (°F):** 73

Contractor: Baseland LLC **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Curb & Gutter **Location Details:** From the south east corner of Marksheffel and Sterling Ranch, 1 foot east and 20 feet south. **Lat/Long:** 38.9542724 / -104.6823339

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
126	1913 14030308	6.00	Slump: 4 1/2 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	140.4	80	73

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
126 / 7825	7	08/28/2024	4600	Type 2
126 / 7826	28	09/18/2024	5610	Type 2
126 / 7827	28	09/18/2024	5040	Type 5
126 / 7828	28	09/18/2024	5680	Type 2

Average Strength (psi): 7 Day - 4600 psi, 28 Day - 5440 psi

09/20/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 127 **Sample #:** 2182 **Placement Date:** 08/22/2024 **Technician:** Matt Spring **Weather Conditions:** Sunny **Air Temp (°F):** 76

Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** From the north west corner of Briargate and Volmer, 7 feet west and 4 feet south. **Lat/Long:** 38.9696865 / -104.6718124

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
127	1909 14030390	10.00	Slump: 4 1/2 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	140.0	86	76

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
127 / 7873	7	08/29/2024	4270	Type 3
127 / 7874	28	09/19/2024	4970	Type 2
127 / 7875	28	09/19/2024	5040	Type 3
127 / 7876	28	09/19/2024	4850	Type 3

Average Strength (psi): 7 Day - 4270 psi, 28 Day - 4950 psi

09/23/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 128 **Sample #:** 2187 **Placement Date:** 08/23/2024 **Technician:** Michael Crytser **Weather Conditions:** Sunny **Air Temp (°F):** 61
Contractor: Baseland **Supplier:** SRM **Mix Design:** ZCDOT45070-4 **Specified Strength (psi):** 4500

Placement Location: Curb & Gutter **Location Details:** 400 feet north of the northwest corner of the intersection of Antelope Ravine Drive and Elk Antler Lane. **Lat/Long:** 38.9807637 / -104.6600857

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
128	1760 14030442	7.00	Slump: 4 Spec: 3 - 5	Result: 7.6 Spec.: 5 - 8	138.8	80	61

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
128 / 7939	7	08/30/2024	3720	Type 2
128 / 7940	28	09/20/2024	4680	Type 2
128 / 7941	28	09/20/2024	4590	Type 3
128 / 7942	28	09/20/2024	4460	Type 2

Average Strength (psi): 7 Day - 3720 psi, 28 Day - 4580 psi

09/23/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 129 **Sample #:** 2420 **Placement Date:** 09/18/2024 **Technician:** Kirby Hooker **Weather Conditions:** Sunny **Air Temp (°F):** 76

Contractor: JD Concrete LLC **Supplier:** Holcim **Mix Design:** T34592110 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** Sidewalk repair at 9772 Wheatland Drive.

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
129	390 86743029	8.00	Slump: 4 Spec: 3 - 5	Result: 6 Spec.: 5 - 8	138.8	75	76

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
129 / 8737	7	09/25/2024	4000	Type 2
129 / 8738	28	10/16/2024	4760	Type 2
129 / 8739	28	10/16/2024	4600	Type 2
129 / 8740	28	10/16/2024	4830	Type 2

Average Strength (psi): 7 Day - 4000 psi, 28 Day - 4730 psi

10/21/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 130 **Sample #:** 2785 **Placement Date:** 10/31/2024 **Technician:** Rodney Fannin **Weather Conditions:** Sunny **Air Temp (°F):** 41
Contractor: SSS Enterprise **Supplier:** Pete Lien **Mix Design:** 40DG50 **Specified Strength (psi):** 4000

Placement Location: Curb & Gutter

Location Details: Via "B" Gate stake at STA 37+00, pour began at STA 35+75 in the northeast curb of the southeast lane of Briargate Parkway. The pour concluded at STA 36+00 in the northeast curb of the northwest lane

Lat/Long: 38.9656634 / -104.665002

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
130	306 130819	7.00	Slump: 3 Spec: 3 - 5	Result: 5.3 Spec.: 5 - 8	140.8	72	41

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
130 / 9896	7	11/07/2024	5210	Type 2
130 / 9897	28	11/28/2024	6510	Type 2
130 / 9898	28	11/28/2024	6690	Type 2
130 / 9899	28	11/28/2024	6110	Type 2

Average Strength (psi): 7 Day - 5210 psi, 28 Day - 6440 psi

12/04/2024

Reviewed by: Dylan Gassmann, PE



Entech Engineering
505 Elkton Dr
Colorado Springs, CO 80907
Phone: 719-531-5599

Concrete Test

Client:

SR Land, LLC
20 Boulder Crescent
Colorado Springs, CO 80903

Project:

230423
Homestead at Sterling Ranch F2 and 3
Homestead at Sterling Ranch F2 and 3
Colorado Springs, CO

Set #: 131 **Sample #:** 3926 **Placement Date:** 04/16/2025 **Technician:** Andrew Oswald **Weather Conditions:** Sunny / Partly Cloudy **Air Temp (°F):** 64

Contractor: JD Concrete LLC **Supplier:** Holcim **Mix Design:** T34592110 **Specified Strength (psi):** 4500

Placement Location: Sidewalk **Location Details:** From the front door of 8322 William Downing Drive, 30 feet east. **Lat/Long:** 38.9740804 / -104.667858

PLACEMENT DATA

Set #	Truck # Ticket #	Load Vol (yd³)	Slump (in)	Air Content (%)	Unit Weight (lb/ft³)	Concrete Temp (°F)	Air Temp (°F)
131	8667 71397120	9.00	Slump: 5 Spec: 4 - 6	Result: 6 Spec.: 5 - 8	138.8	80	64

STRENGTH DATA

Set / Test	Age (days)	Test Date	Strength (psi)	Fracture Pattern
131 / 13392	7	04/23/2025	3560	Type 3
131 / 13393	28	05/14/2025	4190	Type 3

Average Strength (psi): 7 Day - 3570 psi, 28 Day - 4190 psi

56 Day Breaks will be provided when available.

05/15/2025

Reviewed by: Dylan Gassmann, PE