



6825 Silver Ponds Heights #101
Colorado Springs, CO 80908
(719) 481-4560

Ginger Spence
14090 Davis Road
Peyton, Colorado 80831

RE: Soil Test Receipt, 0 Davis Road, Geoquest #22-0662

To Whom It May Concern:

Thank you for choosing Geoquest, LLC to perform the Soils Report for the property at the above location.

The attached Soils Report provided by Geoquest, LLC, has been prepared in accordance with the standard of practice. This report does not address possible geologic hazards, environmental hazards, or drainage that exist on-site. There are specific requirements for the design and construction of the foundation of a structure at the location noted in the report. Some of these requirements are placed on the homeowner of the property and may be outside of the builders' control. **Accordingly, we are requiring both the builder and the homeowner to sign this letter indicating both parties have accepted a copy of the report, have read and understood the contents, and know they each have specific responsibilities. Failure to follow the recommendations and requirements of the report by any party can result in unsatisfactory performance of the foundation or building components. The Builder and Owner understand the risks, as noted in the Soils Report, and accept all risk, including movement of slabs.**

After the excavation has been completed an **Open Hole Observation is required** to be performed by the Soils Engineer. **After the Open Hole Observation is complete, the owner/builder should inform the Foundation Engineer of any changes to the soil conditions or allowable bearing. The Open Hole Observation is an additional cost.**

Geoquest, LLC, will not provide any documentation for site inspections until we have received this letter with the required signatures. If the property is being developed as a speculative investment and no homeowner has been contracted to purchase the property, you can indicate that under the homeowner signature line. Upon the sale of the property the builder understands that both this letter and a copy of the Soils Report shall be provided to the buyer, and a homeowner signed copy returned to Geoquest, LLC.


If you have any questions, feel free to contact us at (719) 481-4560.

Sincerely,

Charles E. Milligan, P.E.

Builder Representatives

Homeowner(s)

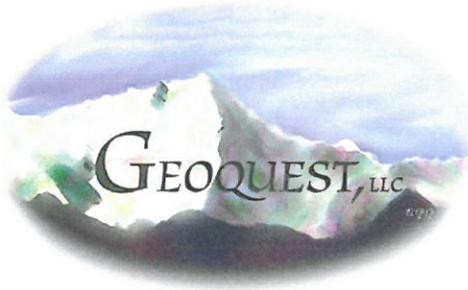

6825 Silver Ponds Heights #101
Colorado Springs, CO 80908
(719) 481-4560

SOILS REPORT

FOR

GINGER SPENCE

JOB #22-0662

0 Davis Road,
El Paso County,
Colorado

Sincerely,


Charles E. Milligan, P.E.



TABLE OF CONTENTS

INTRODUCTION1

CONCLUSIONS1

GENERAL.....1

FIELD AND LABORATORY INVESTIGATION1

TOPOGRAPHY2

WEATHER2

DESIGN AND CONSTRUCTION CONSIDERATIONS2

RECOMMENDATION REMARKS.....3

COLD TEMPERATURE CONSIDERATIONS.....3

SURFACE DRAINAGE.....3

SUBSURFACE DRAINAGE4

REINFORCING4

FOOTING DESIGN4

CONSTRUCTION DETAILS.....4

MINIMUM MATERIALS SPECIFICATIONS.....4

OPEN HOLE OBSERVATION (added cost).....4

COMPACTION TESTING (added cost)5

MODIFIED PROCTOR DENSITY TESTING (added cost)5

FINAL OBSERVATIONS (added cost)5

LIMITATIONS5

APPENDIX6

INTRODUCTION

The owners must be made aware of the contents of this report. If there are any questions or concerns regarding the information in this report, please contact Geoquest, LLC. It is the responsibility of the contractor on this project to make subsequent owners aware of the contents of this report. This is to ensure that the recommendations and requirements of the report, especially regarding the surface drainage, are acknowledged and followed. This report is prepared for **Ginger Spence, owner, on 14090 Davis Road, El Paso County, Colorado**. This report is prepared with the understanding that a single-family residence is planned for this site. The site does not have existing structures.

CONCLUSIONS

A satisfactory foundation for this structure is a properly designed shallow foundation system consisting of foundation components resting directly on undisturbed materials. Foundation components resting directly on undisturbed moderate density materials shall be designed for a loading of not greater than **2,000 pounds per square foot**. Foundation components resting directly on undisturbed low-moderate density materials shall be designed for a loading of not greater than **1,500 pounds per square foot**. **Any design by any engineer is subject to revision based on the results of the open hole observation.** The compressibility of this material is low. This bearing capacity is calculated with a safety factor of three. The type of foundation configuration used depends on the building loads applied. The depth of foundation elements shall be determined by the foundation engineer but should be at least as deep as the minimum depth required by the governing building authority. **The laboratory testing revealed that the on-site soil is clayey sand (U.S.C.S. Classification Symbol SC). The unit weight of equivalent fluid soil pressure of this material is 85 pounds per cubic foot. The native SC is not suitable and shall not be used as backfill material around the perimeter of the foundation.** The actual equivalent fluid soil pressure was not determined. The expected values are from ASCE 7-10, Table 3.2-1. **Foundation components should bear on soils of similar bearing capacity. Foundation components bearing on dissimilar soils should be avoided. The owners shall be made aware that movement will occur if surface or subsurface water is allowed to collect around the foundation wall.**

GENERAL

The investigation was made to reveal important characteristics of the soils and of the site influencing the foundation design. Also evaluated during the investigation were subsurface conditions that affect the depth of the foundation and subsequent loading design, such as ground water levels, soil types, and other factors which affect the bearing capacity of the soils. Design loadings are based on soils characteristics and represent the maximum permissible loads for these conditions. The bearing capacity is calculated with a safety factor of three.

FIELD AND LABORATORY INVESTIGATION

Two exploratory holes were drilled on July 14, 2022, at the locations shown on the enclosed site map. The location of these test holes was determined by Ginger Spence. The test holes were drilled with a 4-inch diameter auger. At intervals anticipated to be the foundation depths, and as determined by the soils conditions, the drill tools were removed, and samples were taken by the use of a 2-inch split barrel sampler connected to a 140-pound drop-hammer. This hammer is dropped 30 inches to drive the penetration sampler into the soil (**ASTM D-1586**). The depths and descriptions of the materials encountered in each test boring at which the samples were taken are shown on the enclosed log sheets. All samples were classified both in the field and in the laboratory to evaluate the physical and mechanical properties of the materials encountered.

TOPOGRAPHY

The topography of this site is that of an incline sloping down towards the east at 4%.

WEATHER

The weather at the time of the soil examination consisted of partly cloudy skies with hot temperatures.

DESIGN AND CONSTRUCTION CONSIDERATIONS

Slabs-on-grade may move and crack. Vertical slab movement of up to one and a half inches should be expected for native soils with low expansion potential. In some cases, vertical movement may exceed this range. If movement and associated damage to basement floors and finishes cannot be tolerated, a structural floor system should be installed. If compaction is not performed, settlement may occur causing cracking of foundation walls and floors. Soil located beneath concrete walls shall be compacted to at least 95% Modified Proctor density (**ASTM D-1557**). Soil located beneath concrete slabs shall be compacted to at least 85% Modified Proctor density. Special care is to be taken to re-compact the material above utility lines to a minimum of 85% Modified Proctor density. During construction, conditions that could cause settlement shall be eliminated. Interior non-bearing partition walls shall be constructed such that they do not transmit floor slab movement to the roof or overlying floor. The gap or void (1.5 inch min.) installed in these non-bearing partitions may require re-construction over the life of the structure to re-establish the gap or void to allow for vertical slab movement. Stairwells, doorways, and sheeted walls should be designed for this movement.

The following are general recommendations of on-grade slabs:

1. Slabs shall be placed on well-compacted, non-expansive materials, and all soft spots shall be thoroughly excavated and replaced with non-expansive fill materials as stated above.
2. Slabs shall be separated from all foundation walls, load bearing members, and utility lines.
3. At intervals not to exceed 12 feet in each direction, provide control joints to reduce problems with shrinkage and curling as recommended by the American Concrete Institute (**ACI 360R-10**). Moisten the ground beneath the slab prior to the placement of concrete.
4. All concrete placed must be cured properly as recommended by the American Concrete Institute (**ACI 360R-10**). Separate load bearing members from slabs, as discussed above. Care must be exercised to prevent excess moisture from entering the soil under the structure, both during and after construction.
5. Due to the exposure of exterior concrete to variations in moisture fluctuations, heaving and cracking of exterior slabs-on-grade should be expected. Placement of at least 3 feet of non-expansive fill beneath the slabs can help to reduce the impact of differential movement and cracking but may not eliminate movement. Exterior concrete shall slope away from the structure a minimum of 2% grade.
6. **The clayey sand (SC) has been tested for its expansion and/or consolidation potential. This material has a 0.02% expansion potential with a dead load of 1,500 pounds per square foot.** Basement slabs, garage slabs, and all concrete floor slabs, exert a very low dead-load pressure on the soil. Since this soil contains a small amount of swell/consolidation potential, slabs will crack and heave or settle if excess water is allowed to penetrate the subgrade. For example, column openings to pads below the placed slab, if exposed to precipitation during construction, will conduct water to the subgrade, possibly causing it to expand/consolidate. Also, if the slab is placed with concrete too wet, expansion/consolidation may occur. We recommend 3,000 psi concrete placed at a maximum slump of 4 inches.

RECOMMENDATION REMARKS

The recommendations provided in this report are based upon the observed soil parameters, anticipated foundation loads, and accepted engineering procedures. The recommendations are intended to minimize differential movement resulting from the heaving of expansive soil or from the settlement induced by the application of loads. **It must be recognized that the foundation will undergo some movement on all soil types.** In addition, concrete floor slabs will move vertically, therefore, adherence to those recommendations which isolate floor slabs from columns, walls, partitions or other structural components is extremely important if damage to the superstructure is to be minimized.

Any subsequent owners should be apprised of the soil conditions and advised to maintain good practice in the future with regard to surface and subsurface drainage and partition framing, drywall and finish work above floor slabs.

Geoquest, LLC does not assure that the contractor and/or homeowner will comply with the recommendations provided in this report. Geoquest, LLC provides recommendations only and does not supervise, direct or control the implementation of the recommendations.

Failure to follow the recommendation provided by Geoquest, LLC and follow observation requirements may jeopardize the construction project and Geoquest, LLC shall be absolved from any and all responsibility for any damages arising from the failure to obtain proper site observation and follow recommendations.

COLD TEMPERATURE CONSIDERATIONS

1. Concrete shall not be placed upon wet or frozen soil.
2. Concrete shall be protected from freezing until it has been allowed to cure for at least 7 days after placement in forms.
3. Snow or other frozen water shall not be allowed in the forms during placement of concrete.
4. Concrete shall be cured in forms for at least 72 hours.
5. Concrete shall be vibrated or rodded in forms to avoid segregation and cold joints.
6. The site shall be kept well drained at all times. Ponding of water should be avoided in the excavation area.

SURFACE DRAINAGE

After construction of foundation walls, the backfill material shall be well compacted to 80% Modified Proctor density, to reduce future settlement. Any areas that settle after construction shall be filled to eliminate ponding of water adjacent to the foundation walls. **The finished grade shall have a positive slope away from the structure with an initial slope of 6 inch in the first 10 feet.** If a 10 foot zone is not possible on the upslope side of the structure, then a well-defined swale should be created a minimum of 5 feet from the foundation and sloped parallel with the wall at a 2% grade to intercept the surface water and carry it around and away from the structure. Homeowners shall maintain the surface grading and drainage installed by the builder to prevent water from being directed in the wrong direction. All downspouts shall have extensions that will remove runoff to the outside of the backfilled areas. Shrubs and plants requiring minimal watering shall be established in this area. Irrigated grass shall not be located within 5 feet of the foundation. Sprinklers shall not discharge water within 5 feet of the foundation. Irrigation should be limited to the minimum amount sufficient to maintain vegetation. Application of more water will increase the likelihood of floor slab and foundation movement.

All exterior grading and location of downspouts and their performance shall be inspected by Geoquest, LLC. **The native clayey sand (SC) material is not suitable and shall not be used as backfill material around the perimeter of the foundation.** If on-site soils are not suitable for the backfill, the backfill material shall consist of clean non-cohesive granular soils or road base material as described previously. Imported material is to be approved by Geoquest, LLC prior to placement. **We recommend imported granular backfill with a maximum unit weight of 45 pounds per cubic foot.** It is the responsibility of the contractor to schedule all inspections.

SUBSURFACE DRAINAGE

Perimeter drains are required around all walls of the habitable or usable area portion of the structure that are below finished grade including all common wall(s) adjacent to the basement. Crawlspace, slab on grade, and walkout areas need not be drained unless specified at the time of the Open Hole Observation. Perimeter drains may be required during the open hole due to high moisture or grade that slopes toward the excavation. The final determination of the necessity for perimeter drains will be made at the time of the Open Hole Observation. An Exterior Drain Detail is provided in this report. Drains should daylight away from the structure or discharge to a sump pump. Even if drains are not required, areas below grade may experience moisture problems if unusual conditions are present in the future.

REINFORCING

The concrete foundation walls shall be properly reinforced as per the specific design for this foundation by a **Colorado Registered Professional Engineer**. **Exact requirements are a function of the design of the structure. Questions concerning the specific design requirements shall be referred to the design engineer.**

FOOTING DESIGN

The design for footings, pads, and/or piers for this structure is determined by applying the dead load and full live load to the foundation walls.

CONSTRUCTION DETAILS

It is necessary with any soils investigation to assume that the materials from the test holes are representative of the materials in the area. On occasion variations in the subsurface materials do occur, therefore, should such variations become apparent during construction, the owner is advised to contact this office for a determination as to whether these variations will affect the design of the structure's foundation. If anomalies are observed during the excavation for the structure, this office should be contacted to determine whether the layers will adversely affect the design.

MINIMUM MATERIALS SPECIFICATIONS

1. Minimum materials specifications of the concrete, reinforcing, etc., shall be determined by the Professional Foundation Design Engineer.
2. Compact beneath foundation walls a minimum of 95% Modified Proctor density to prevent settlement.
3. Compact all backfill material located around the perimeter of the foundation to a minimum of 80% Modified Proctor density.
4. Concrete shall be vibrated or rodded in forms to avoid segregation and cold joints.
5. The site shall be kept well drained at all times.

OPEN HOLE OBSERVATION (added cost)

If anyone other than Geoquest, LLC, performs the Open Hole Observation, that person/company assumes liability for the soils, and any possible changes to the foundation design.

The owner, or a representative of the construction company shall contact **Geoquest, LLC** a minimum of **24 hours** prior to excavating for the foundation. An Open Hole Observation must be performed on each individual structure prior to the placement of concrete, and preferably prior to the placement of forms in the excavated area. **The failure to request or obtain an Open Hole Observation prior to the placement of foundation components may result in this Soils Report being declared null and void.** This is to ensure that soft areas, anomalies, etc., are not present in the foundation region. At the time of the open hole observation the **foundation type recommendations, maximum allowable bearing capacity may be revised** according to soil conditions found at that time. If revisions are made to the Soils Report due to the soil conditions of the excavation, **the Foundation Design Engineer must be notified of all revisions.**

COMPACTION TESTING (added cost)

Geoquest, LLC shall perform compaction testing on any replaced material. Soil shall be compacted in maximum 6-inch lifts. Testing shall be performed at intervals not to exceed 24 inches (or as required by the design engineer). Modified Proctor Density must be provided to Geoquest, LLC prior to compaction testing, see below.

The owner, or a representative of the construction, shall contact Geoquest, LLC a **minimum of 24 hours prior to the time the compaction test is requested. The failure to properly compact and/or obtain proper compaction testing may result in this Soils Report being declared null and void.**

MODIFIED PROCTOR DENSITY TESTING (added cost)

Modified Proctor Density test must be provided to Geoquest, LLC prior to compaction testing. If a Proctor cannot be provided, a Modified Proctor Density test must be completed prior to compaction testing. Two 5-gallon valid samples of the soil to be used, must be provided for testing, at least 2 weeks prior to the placement and compaction of the material.

The failure to provide this data may result in this Soils Report being declared null and void.

FINAL OBSERVATIONS (added cost)

The owner, or a representative of the construction company, shall contact Geoquest, LLC at the time final grading and landscaping procedures are completed. This is to ensure that sprinkler systems are not installed adjacent to the structure and that only shrubs or plants that require minimal watering are established in this area. All exterior grading as well as the location of downspouts and their performance shall be inspected by Geoquest, LLC. Any additional landscaping or grading changes performed by subsequent contractors and/or owners shall be inspected and approved. It is the responsible of the contractor and/or owner to schedule all these inspections at the appropriate times. **The failure to obtain this inspection may result in this Soils Report being declared null and void.**

LIMITATIONS

This report is issued based on the understanding that the owner or his representative will bring the information, data, and recommendations contained in this report to the attention of the project engineer and architect, in order that they may be incorporated into the plans for the structure. It is also the owner's responsibility to ensure that all contractors and sub-contractors carry out these recommendations during the construction phase.

This report was prepared in accordance with generally accepted professional geotechnical/engineering methods. However, Geoquest, LLC makes no other warranty, express or implied, as to the findings, data, specifications, or professional advice rendered hereunder. **Due to circumstances outside of Geoquest, LLC's control, including improper construction, failure to follow recommendations, and unforeseen events, the Limits of Liability extend only to fees rendered for the professional services provided.**

This report is considered valid as of the present date. The owner acknowledges, however, that changes in the conditions of the property might occur with the passage of time, such as those caused by natural effects or man-made changes, both on this land and on abutting properties. Further, changes in acceptable tolerances or standards might arise as the result of new legislative actions, new engineering advances, or the broadening of geotechnical knowledge. Thus, certain developments beyond our control may invalidate this report, in whole or in part.

This report and its recommendations do not apply to any other site than the one described herein and are predicated on the assumption that the soil conditions do not deviate from those described. In the event that any variations or undesirable conditions should be detected during the construction phase or if the proposed construction varies from that planned as of this report date, the owner shall immediately notify Geoquest, LLC in order that supplemental recommendations can be provided, if so required.

This report excludes possible environmental issues, geologic hazards, flooding, or any other natural or man-made hazards that affect this site. These are outside the scope of work, for this report.

APPENDIX



DRILL LOGS


JOB #: 22-0662 TEST BORING NO.: TH-1 Date: 07/14/2022 By: ADB	DEPTH (in ft.)	SYMBOL	SAMPLES	BLOW COUNT	WATER %	SOIL TYPE
0" - 6" <u>TOPSOIL</u>	0-6	XXXX				
6" - 15' <u>Sand (SC)</u> Fine-Medium grained Low-Moderate density Low-Moderate moisture content Moderate clay content Low plasticity Very Pale Brown color	2	Diagonal lines				
	4	Diagonal lines	22 12"	5.8		SC
	6	Diagonal lines				
	8	Diagonal lines				
	10	Diagonal lines	15 12"	5.4		SC
	12	Diagonal lines				
	14	Diagonal lines				
	16	Diagonal lines				
	18	Diagonal lines				
	20	Diagonal lines				

JOB #: 22-0662 TEST BORING NO.: TH-2 Date: 07/14/2022 By: ADB	DEPTH (in ft.)	SYMBOL	SAMPLES	BLOW COUNT	WATER %	SOIL TYPE
0" - 6" <u>TOPSOIL</u>	0-6	XXXX				
6" - 15' <u>Sand (SC)</u> Fine-Medium grained Low-Moderate density Low-Moderate moisture content Moderate clay content Low plasticity Dark Yellowish Brown color	2	Diagonal lines				
	4	Diagonal lines	21 12"	4.7		SC
	6	Diagonal lines				
	8	Diagonal lines				
	10	Diagonal lines	15 12"	6.8		SC
	12	Diagonal lines				
	14	Diagonal lines				
	16	Diagonal lines				
	18	Diagonal lines				
	20	Diagonal lines				

GEOQUEST LLC

SITE MAP

0 Davis Road
El Paso County
Colorado
Job #22-0662
By: MJD

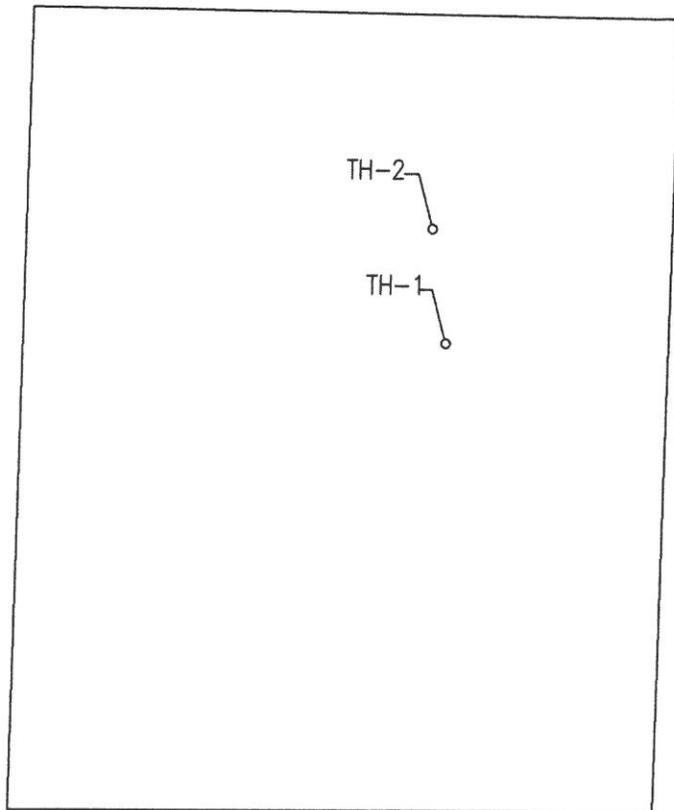

To Davis Road



A simple L-shaped arrow points from the text 'To Davis Road' towards the right side of the rectangular plot.



0 25 50 75 100 125
GRAPHIC SCALE IN FEET
SCALE: 1" = 125'

GEOQUEST LLC



GRADATION TEST RESULTS

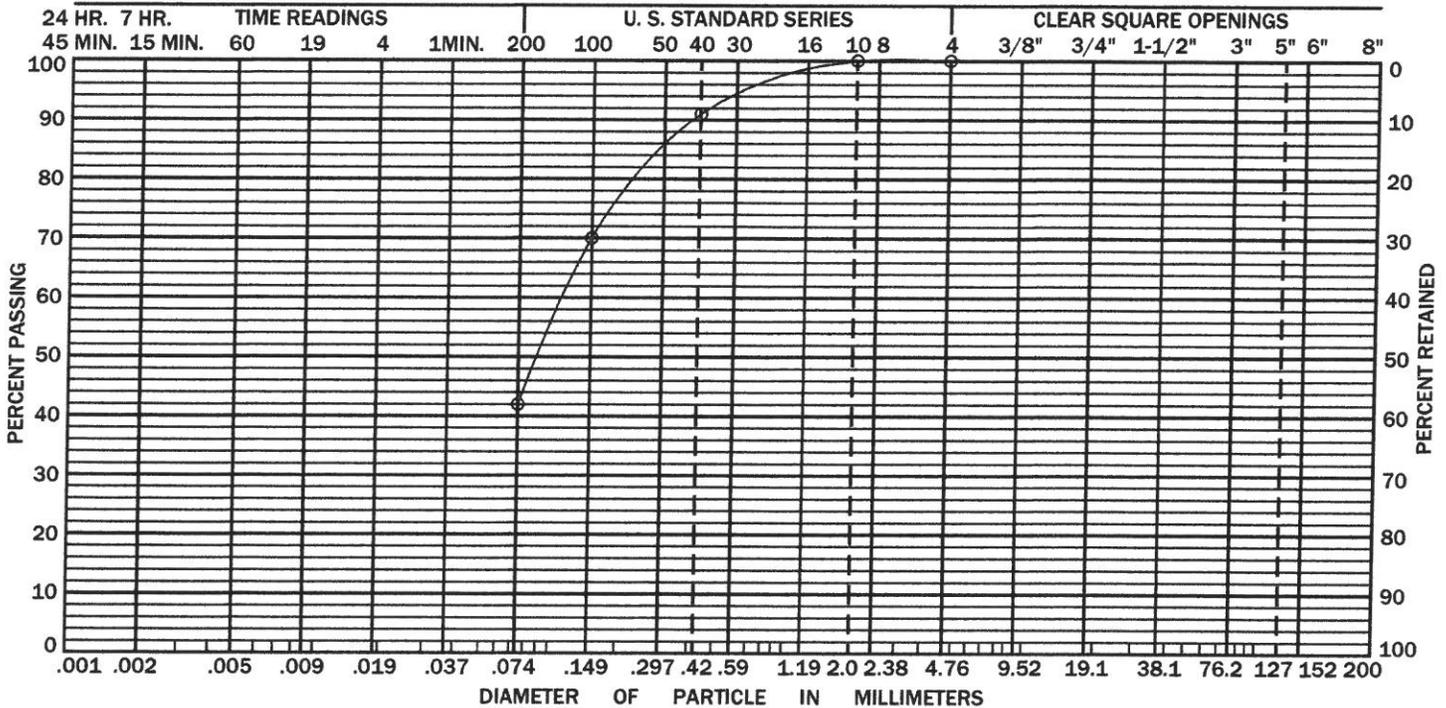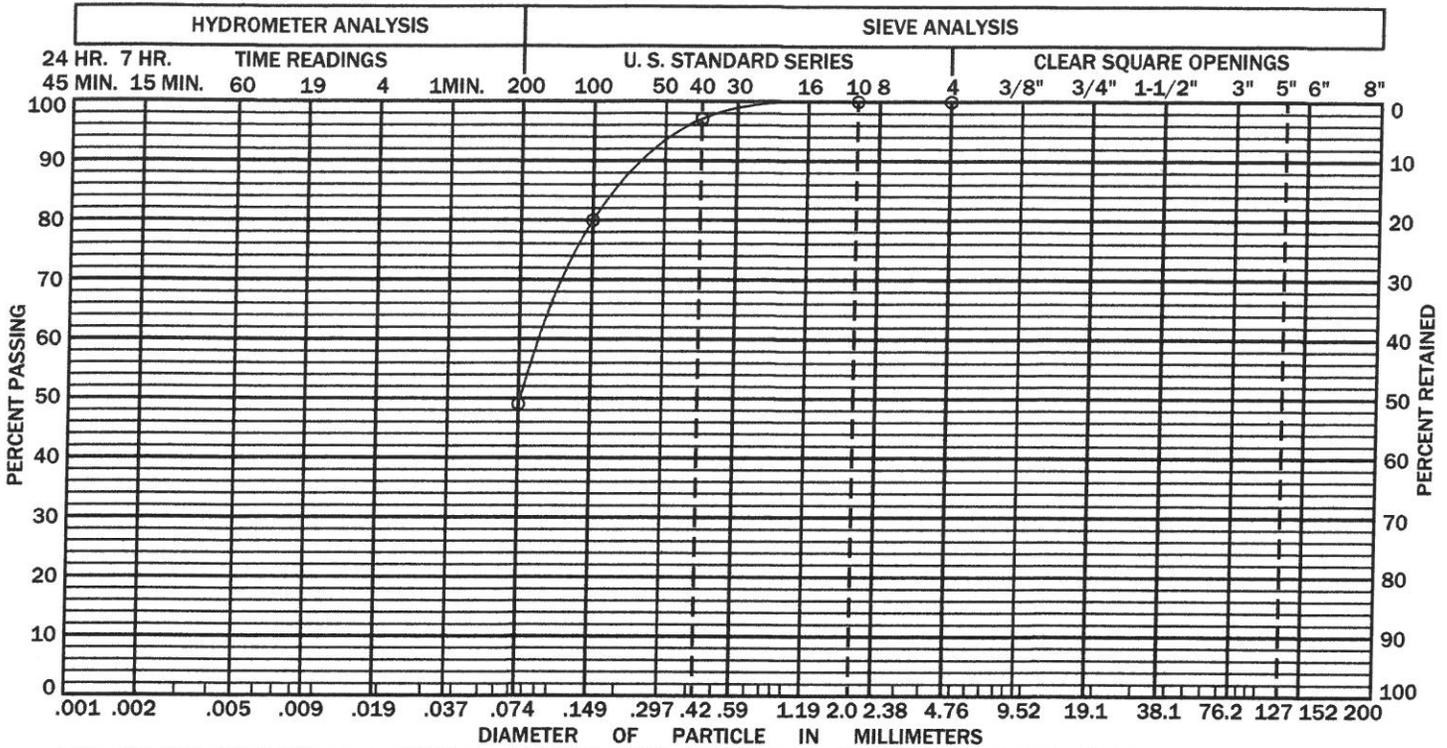

CLAY TO SILT	SAND			GRAVEL		COBBLES
	FINE	MEDIUM	COARSE	FINE	COARSE	
CLASSIFICATION <u>SC</u>	NOTES: <u>5.42 % Moisture content</u>					
GRAVEL <u>0.00 %</u>	<u>Cu = 3.68</u>					
SAND <u>58.29 %</u>	<u>Non Plastic</u>					
FINES <u>41.71 %</u>						
SAMPLE# <u>2</u> HOLE# <u>TH-1</u> DEPTH <u>9</u> FEET	<u>Job: 22-0662</u>	<u>By: acm</u>	<u>08/03/2022</u>			

GEOQUEST LLC


GRADATION TEST RESULTS

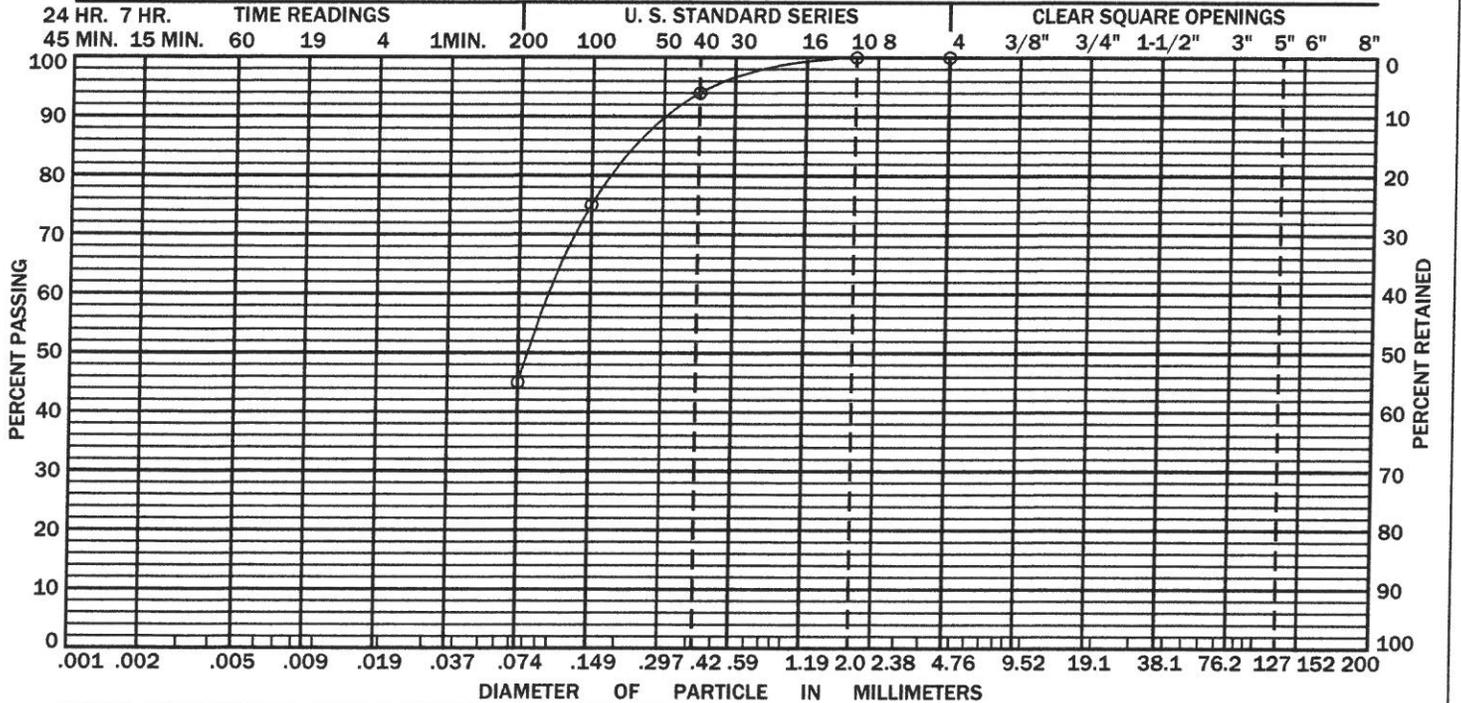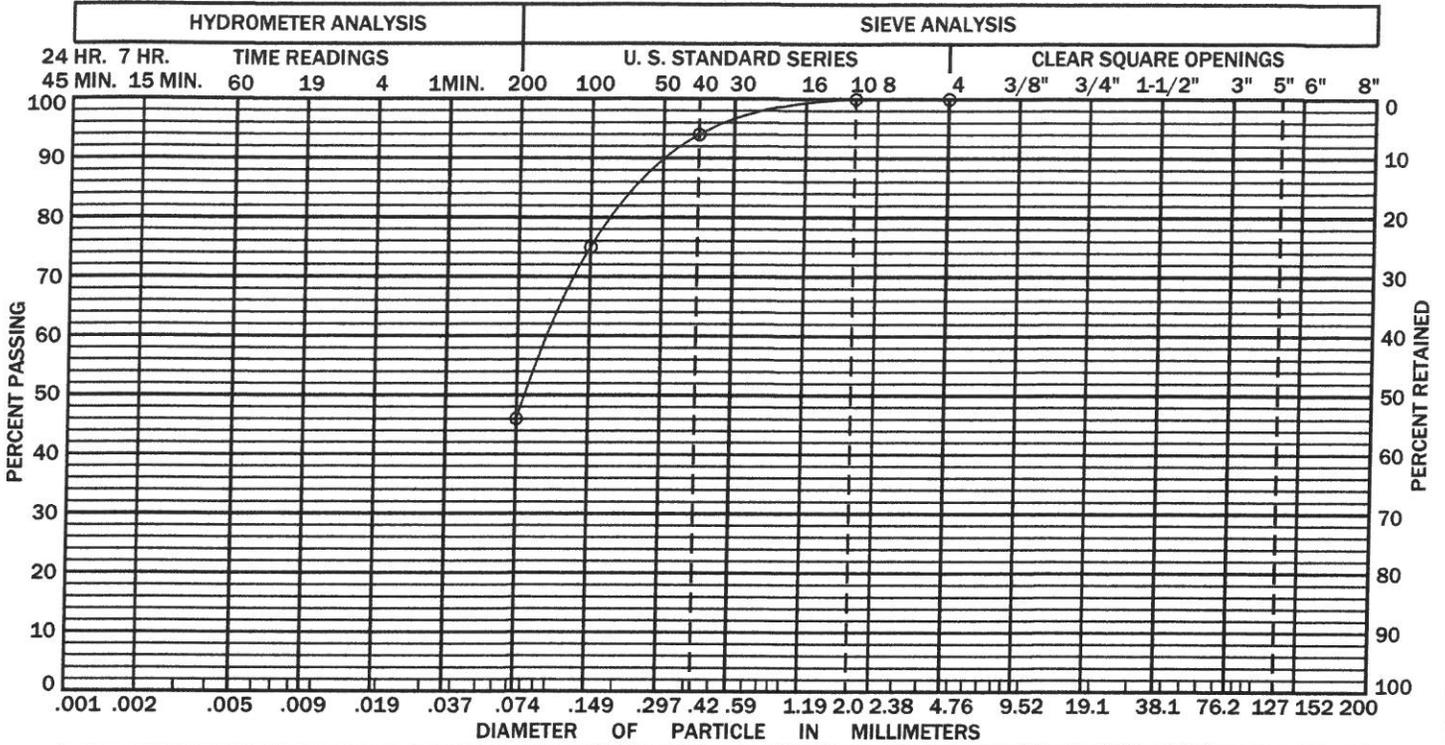

SAMPLE# <u>4</u> HOLE# <u>TH-2</u> DEPTH <u>9</u> FEET		Job: <u>22-0662</u>	By: <u>acm</u>	Date: <u>08/03/2022</u>
--	--	---------------------	----------------	-------------------------


Geoquest LLC

Swell-Consolidation Test Results

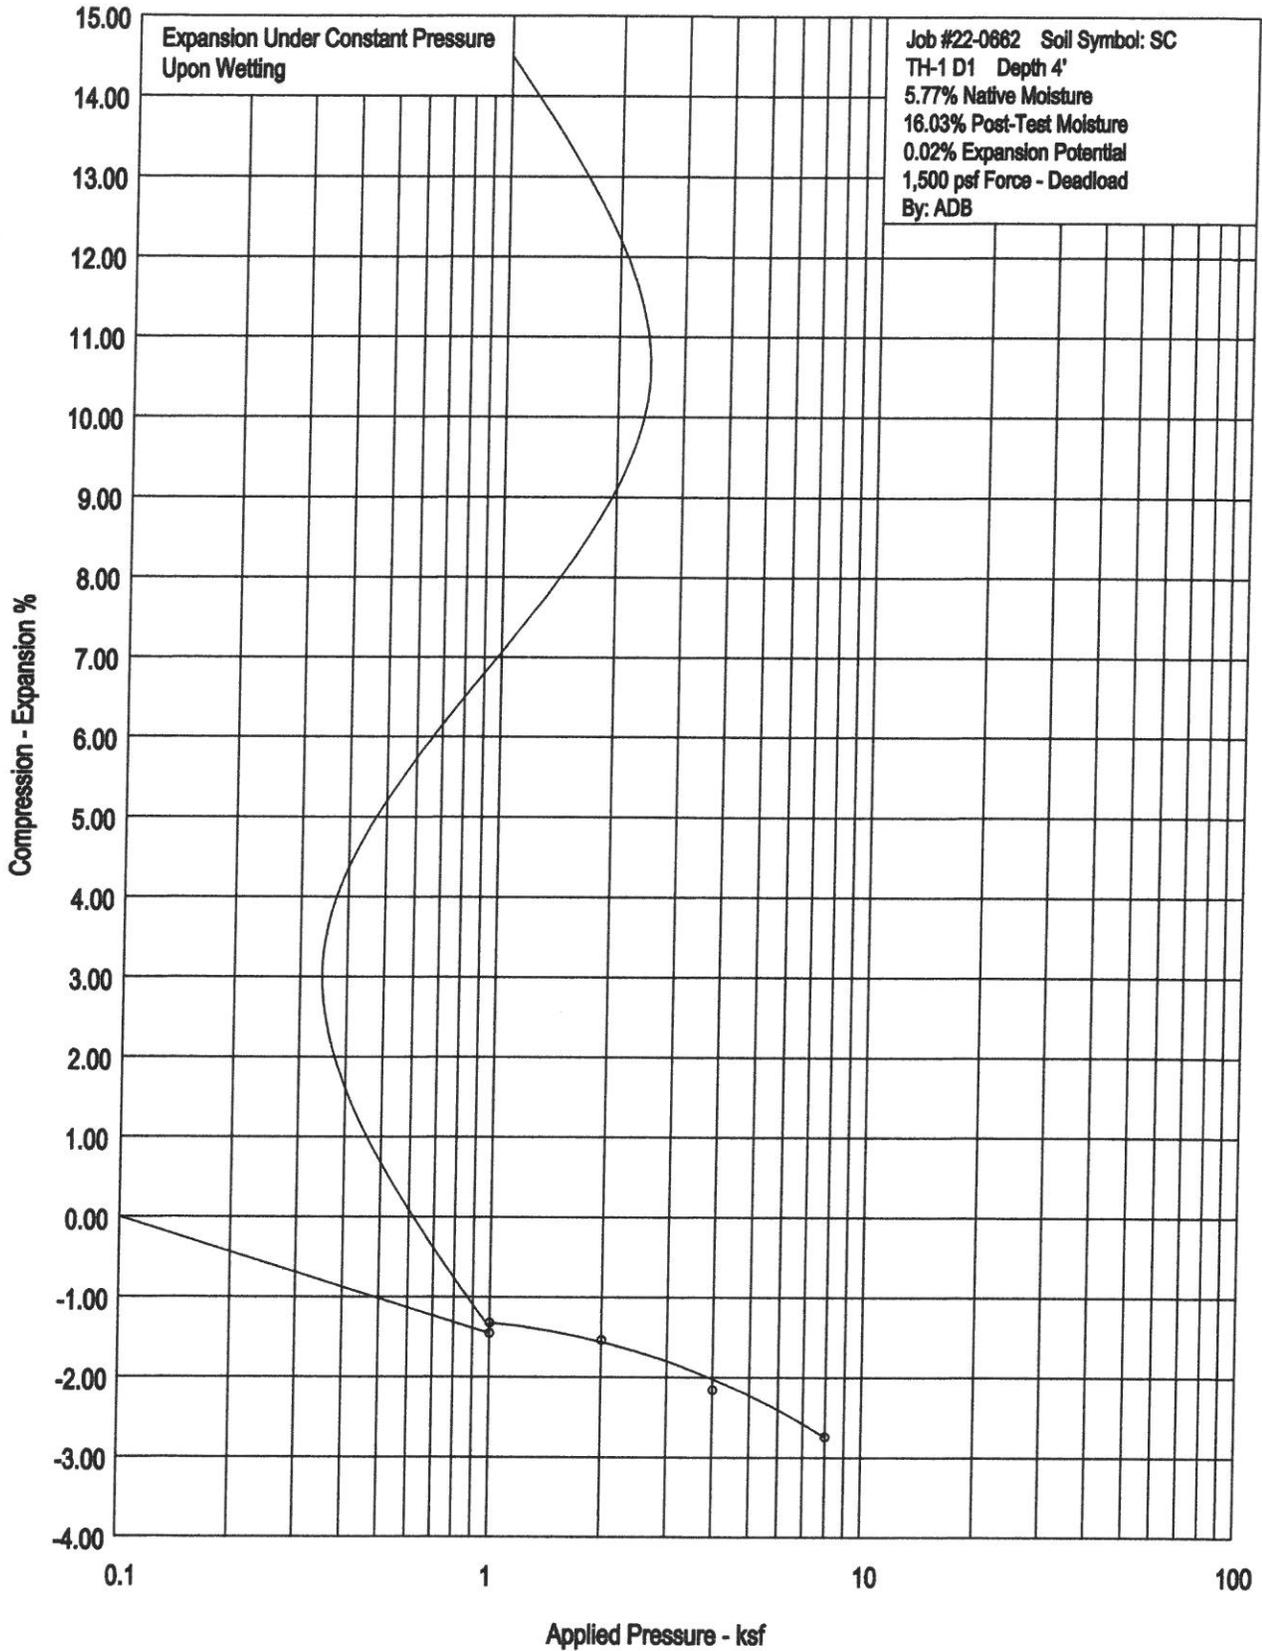



EXTERIOR DRAIN DETAIL

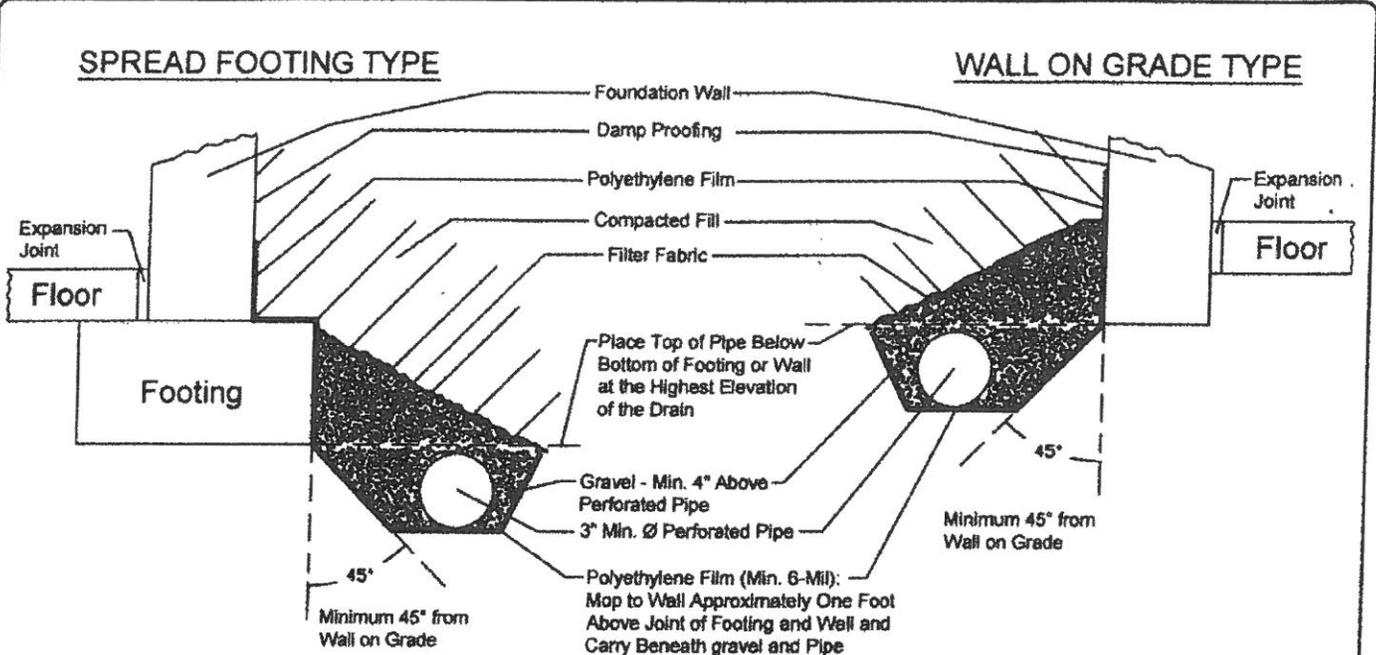

1. Gravel to be Not More Than 1-1/2" and Not Less Than 1/2" Diameter.
2. Perforated Pipe Diameter Varies With Expected Seepage. 3"Ø and 4"Ø are Most Common. ABS and PVC are Most Common Materials for Pipe. We approve the use of an "EZ Flow Drainage System" by Infiltrator. All specifications in this drain detail are still applicable.
3. Pipe to be Laid out in a Minimum Slope of 1" in 10'.
4. Gravity Outfall is Desired if Possible. Portion of Pipe in Area Not Drained Shall be Non-Perforated. Daylight Must be Maintained Clear of Debris in Order to Function Properly.
5. If Gravity Outfall is Not Possible, Provide a Sump With Operational Pump. Pump May Not Connect to Any Sanitary or Storm Sewer.
6. Soil Backfill Should be Compacted to at Least 80% of the Modified Proctor Denisty in the Upper Three Feet of Fill.
7. Filter Fabric to be Mirafi 140s or Approved Equivalent. Roofing Felt and Sheet Plastic are Not Acceptable.
8. Drain Pipe Shall be Laid Below Protected Area, as Shown in The Detail Above.
9. Mop Polyethylene Film to Wall Approximately One Foot Above Joint of Footing and Wall (Do Not Pull Plastic Tight) and Carry Beneath Gravel and Pipe.
10. The Polyethylene Film Shall be Continued to the Edge of the Excavation.